


County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of a Portion of the W. Bdy., T. 27 S., R. 3 W.

CHAINS

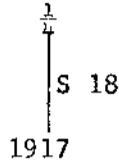

from which

A down hemlock, 20 ins. diam., bears S. 51° E., 27 lks. dist., with a healed blaze.

A partially rotted maple, 12 ins. diam., bears N. 10° E., 12 lks. dist., no marks visible.

add new bearing trees

A cedar, 5 ins. diam., bears N. 46° E., 42 lks. dist., mkd. $\frac{1}{4}$ S18 BT.

A cedar, 6 ins. diam., bears S. 35 $\frac{1}{2}$ ° E., 13 lks. dist., mkd. $\frac{1}{4}$ S18 BT.

N. 1° 04' E., beginning new measurement.

Descend 76 ft. over NE. slope.

7.45 Creek, 4 lks. wide, course NW.; desc. 37 ft. over NW. slope.

12.10 Creek, 2 lks. wide, course NW.; desc. 5 ft. over NW. slope.

13.50 Foot of descent, slopes W.; asc. 256 ft. over broken S. slope.

17.05 Dirt access road, 20 lks. wide, bears NW. and SE.

30.50 Spur, slopes E.; desc. 65 ft. over NE. slope.

34.05 Foot of descent, slopes E.; asc. 19 ft. over SE. slope.

40.13 The cor. of secs. 7, 12, 13, and 18, monumented with an iron post, 2 ins. diam., firmly set, 12 ins. above ground, with brass cap marked and witnessed as described in the official record.

Land, rolling hills.

Soil, rocky clay.

Timber, fir, cedar, hemlock, maple, and madrone; undergrowth, hazel, madrone, salal, manzanita, dogwood, vinemaple, poison oak, and chinquapin.

N. 0° 26' E., bet. sec. 7 and 12.

Descend 671 ft. over NW. slope, through heavy timber and dense undergrowth.

2.80 Skid road, 15 lks. wide, bears NE. and SW.

12.50 Skid road, 15 lks. wide, bears E. and W.

27.30 Maintained dirt road, 35 lks. wide, bears E. curving to NE. and W. curving to NW.

28.45 Creek, 3 lks. wide, course NW.; desc. 102 ft. over NW. slope.

35.60 Creek, 2 lks. wide, course NE.; desc. 72 ft. over NE. slope.

40.18 The $\frac{1}{4}$ sec. cor. of secs. 7 and 12, monumented with a granite stone, 15 x 12 x 10 ins., firmly set, 6 ins. above ground, with $\frac{1}{4}$ chiseled on the W. face.