


County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of a Portion of the Subdivisional Lines, T. 27 S., R. 3 W.

CHAINS

T 27 S R 3 W

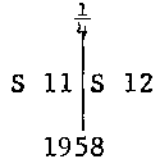

*FD. OK 2/86
M 100-48
R. GEISLER*

from which

A hemlock, 10 ins. diam., bears S. $71\frac{3}{4}^{\circ}$ E., 65 lks. dist.,
mkd. $\frac{1}{4}$ S12 BT.

A fir, 17 ins. diam., bears S. $11\frac{1}{2}^{\circ}$ W., 57 lks. dist.,
mkd. $\frac{1}{4}$ S11 BT.

Deposit local corner stone alongside iron post.

N. $2^{\circ} 25'$ E., beginning new measurement.

Descend 334 ft. over N. slope, through heavy timber and dense undergrowth.

- 7.85 Leave timber, enter logged area, edge bears E. and W.
- 10.45 Left bank of Little River, course W.
- 11.35 Right bank of Little River; asc. 162 ft. over SW. slope.
- 16.70 Asphaltic road, 35 lks. wide, bears E. and W.
- 30.85 Spur, slopes W.; desc. 67 ft. over NW. slope.
- 32.05 Dirt access road, 25 lks. wide, bears W. and E. curving to N.
- 39.45 Bond Creek, 5 lks. wide, course W.; asc. 16 ft. over SE. slope.
- 40.02 The cor. of secs. 1, 2, 11, and 12, perpetuated with a wooden stake, 3 x 3 ins. cross section, firmly set, 24 ins. above ground, at record bearing and distance from the only remaining original bearing tree:

A down fir, 14 ins. diam., bears N. 40° E., 44 lks. dist.,
with a partially opened blaze.

and county surveyor's bearing trees:


A maple, 14 ins. diam., bears E., 73 lks. dist.,
with a healed blaze.

A yew, 8 ins. diam., bears N. 49° W., 60 lks. dist.,
with scribe marks T27S R3W S2 CS BT visible on opened blaze.

At the corner point

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 20 ins. in the ground,
and in a mound of stone, $2\frac{1}{2}$ ft. base, to top, with brass cap mkd.

T 27 S R 3 W

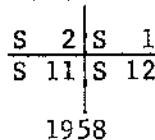

*FD. OK 2/86
M 100-48
R. GEISLER*

from which

A fir, 13 ins. diam., bears N. 30° E., 158 lks. dist.,
mkd. T27S R3W S1 BT.