

County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of a Portion of the Subdivisional Lines, T. 27 S., R. 3 W.

CHAINS


From the cor. of secs. 27, 28, 33, and 34, perpetuated with an iron pipe, $\frac{1}{2}$ in. diam., firmly set, 6 ins. above ground, at record bearing and distance from the two remaining original bearing trees:

A fir, 48 ins. diam., bears S. 45° W., 45 lks. dist., bark scribed T27S R3W 33 BT.

A cedar, 30 ins. diam., bears N. 30° W., 36 lks. dist., with a healed blaze.

At the corner point

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 26 ins. in the ground, with brass cap mkd.

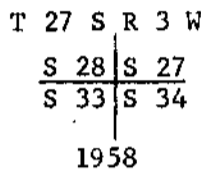

from which

A hemlock, 11 ins. diam., bears N. 20° E., 66 lks. dist., mkd. T27S R3W S27 BT.

A fir, 8 ins. diam., bears S. 43° E., 71 lks. dist., mkd. T27S R3W S34 BT.

A cedar, 13 ins. diam., bears S. 35° W., 60 lks. dist., mkd. T27S R3W S33 BT.

A cedar, 27 ins. diam., bears N. 32° W., 81 lks. dist., mkd. T27S R3W S28 BT.

Deposit local corner material alongside iron post.


N. 0° 03' W., bet. secs. 27 and 28.

Descend 47 ft. over NE. slope, through heavy timber and dense undergrowth.

9.55 Ravine, drains E.; asc. 68 ft. over SE. slope.

20.04 Point for the S 1/16 sec. cor. of secs. 27 and 28.

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

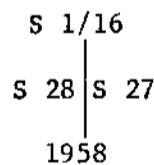

from which

A fir, 10 ins. diam., bears N. 13 $\frac{1}{2}$ ° E., 26 lks. dist., mkd. S 1/16 S27 BT.

A chinquapin, 8 ins. diam., bears S. 13° W., 38 lks. dist., mkd. S 1/16 S28 BT.

Ascend 60 ft. over SE. slope.

36.80 Top of ascent, slopes E.; desc. 18 ft. over NE. slope.

40.08 Point for the $\frac{1}{4}$ sec. cor. of secs. 27 and 28, at proportionate distance; there is no remaining evidence of the original corner.