


County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of a Portion of the Subdivisional Lines, T. 27 S., R. 3 W.

CHAINS

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

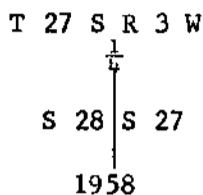

*FDOK
M. Heimburger
11/96 M126-11*

from which


A cedar, 40 ins. diam., bears S. 31° E., 78 lks. dist., mkd. $\frac{1}{4}$ S27 BT.

A fir, 18 ins. diam., bears N. 16° W., 44 lks. dist., mkd. $\frac{1}{4}$ S28 BT.

Descend 93 ft. over NE. slope.

45.60 Creek, 3 lks. wide, course E.; asc. 323 ft. over SE. slope.

80.16 The cor. of secs. 21, 22, 27, and 28, perpetuated and recorded by J. W. Byron, Deputy County Surveyor, in 1957, at record distance from the original bearing trees, monumented with an iron pipe, 1 in. diam., firmly set, 8 ins. above ground, with brass cap mkd.

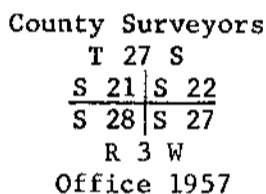

from which the original bearing trees:

A fir, 42 ins. diam., bears N. $47\frac{1}{2}^\circ$ E., 52 lks. dist., with a partially opened blaze. (Record bearing N. 50° E.)

A madrone, 32 ins. diam., bears S. 54° E., 113 lks. dist., with a healed blaze. (Record bearing S. 50° E.)

A rotted fir stump, bears S. 45° W., 6 lks. dist.

A fir, 33 ins. diam., bears N. 10° W., 37 lks. dist., bark scribed S BT.

and country surveyor's bearing trees:

A cedar, 12 ins. diam., bears N. $68\frac{1}{2}^\circ$ E., 91 lks. dist., mkd. T27S R3W S22 CS BT on an unhealed blaze.

A cedar, 10 ins. diam., bears S. 15° E., $89\frac{1}{2}$ lks. dist., mkd. T27S R3W S27 CS BT on an unhealed blaze.

A fir, 36 ins. diam., bears S. 75° W., $7\frac{1}{2}$ lks. dist., bark scribed T27S R3W S28 CS BT.

A pine, 14 ins. diam., bears N. $27\frac{1}{2}^\circ$ W., $21\frac{1}{2}$ lks. dist., mkd. T27S R3W S21 CS BT on an unhealed blaze.

At the corner point

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 22 ins. in the ground, with brass cap mkd.