


County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of the East Boundary of T. 21 S., R. 8 W.

CHAINS

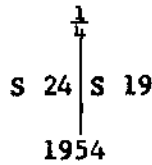

from which


A fir, 68 ins. diam., bears S. 20° E., 25 lks. dist., marked $\frac{1}{4}$ S19 BT.

A fir, 36 ins. diam., bears N. 20 $\frac{1}{2}$ ° W., 29 lks. dist., marked $\frac{1}{4}$ S24 BT.

Descend 60 ft. over steep NW. slope.

- 38.10 Dry bed of stream, 2 lks. wide, course W.; asc. 46 ft. along W. slope.
- 39.70 Spur, slopes S. 70° W.; asc. 235 ft. over SW. slope.
- 47.15 Spur, slopes N. 65° W.; desc. 288 ft. over N. slope.
- 53.20 Branch, 2 lks. wide, course N. 70° W.; asc. 282 ft. over SW. slope.
- 66.50 Ridge, bears N. 40° W. and S. 40° E.; asc. 45 ft. along E. slope.
- 72.60 Spur, slopes NE.; desc. 97 ft. over NE. slope.
- 74.80 Point for the cor. of secs. 13, 18, 19, and 24, at proportionate distance; there is no remaining evidence of the original corner.

Set an iron post, 3 ft. long, 2 ins. diam., 28 ins. in the ground, and in a small mound of stone to top, with brass cap marked

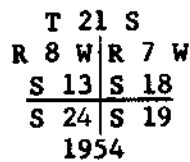

from which

A fir, 20 ins. diam., bears N. 47° E., 36 lks. dist., marked T21S R7W S18 BT.

A fir, 8 ins. diam., bears S. 34 $\frac{1}{2}$ ° E., 21 lks. dist., marked T21S R7W S19 BT.

A hemlock, 8 ins. diam., bears S. 71° W., 45 lks. dist., marked T21S R8W S24 BT.

A fir, 22 ins. diam., bears N. 10 $\frac{1}{2}$ ° W., 43 lks. dist., marked T21S R8W S13 BT.

Land, mountainous. Soil, sandy clay loam. Timber, fir, hemlock, cedar, maple, madrona, and alder. Undergrowth, vine maple, hazel, arrowwood, huckleberry, and salal.

N. 0° 20' W., bet. secs. 13 and 18.

Descend 550 ft. over NE. slope, through heavy timber and dense undergrowth.

- 14.60 Branch, 4 lks. wide, course N. 40° W.; asc. 70 ft. over SW. slope.
- 18.30 Spur, slopes NW.; desc. 60 ft. over N. slope.