

County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of a Portion of the Subdivisional Lines of T. 21 S., R. 8 W.

CHAINS

N. 0° 36' E., bet. secs. 13 and 14.


Ascend 400 ft. over S. slope, through heavy timber, partially fire-killed, and burned undergrowth.

22.40 Ridge, the divide bet. Umpqua River and Smith River, and a tractor trail, bear N. 65° E. and S. 65° W.; desc. 390 ft. over steep N. slope.

32.40 Ravine, course W.; asc. 130 ft. over SW. slope.

38.37 Point for the $\frac{1}{4}$ sec. cor. of secs. 13 and 14, at proportionate distance; there is no remaining evidence of the original corner.

Set an iron post, 3 ft. long, 1 in. diam., 28 ins. in the ground, with brass cap marked

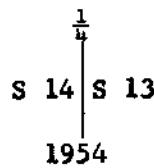

from which

A fir, 50 ins. diam., bears S. 89° E., 74 lks. dist., marked $\frac{1}{4}$ S13 BT.

A fir, 40 ins. diam., bears S. 68° 45' W., 310 lks. dist., marked $\frac{1}{4}$ S14 BT.

Ascend 150 ft. over SW. slope.

46.75 Spur ridge and a tractor trail along edge of burned area, bear N. 60° W. and S. 30° E.; desc. 250 ft. over N. slope, changing to NE. slope, through heavy timber and dense undergrowth.

50.50 Branch, 1 lk. wide, course N. 30° E.; desc. 450 ft. over broken NE. slope.

76.74 The cor. of secs. 11, 12, 13, and 14, determined from the remaining original bearing trees, as follows:


A maple, 20 ins. diam., bears N. 48° E., 30 lks. dist., with blaze healed.

A maple, 16 ins. diam., bears S. 3 $\frac{1}{2}$ ° W., 52 lks. dist., with blaze healed. (Record bearing, S. 8° W., 36 lks. dist.)

A fir snag, 80 ins. diam., bears N. 75° W., 33 lks. dist., with blaze healed.

At the corner point

Set an iron post, 3 ft. long, 2 ins. diam., 30 ins. in the ground, with brass cap marked

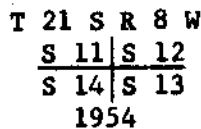

from which new bearing trees,

A hemlock, 12 ins. diam., bears N. 22 $\frac{1}{2}$ ° E., 81 lks. dist., marked T21S R8W S12 BT.

A hemlock, 22 ins. diam., bears S. 37° 45' E., 112 lks. dist., marked T21S R8W S13 BT.

Fl. OK JULY, 1961
LES ROBERTS M 88 22