


County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of a Portion of the Subdivisional Lines of T. 21 S., R. 8 W.

CHAINS

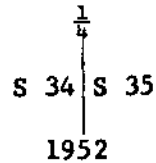

from which

A fir, 62 ins. diam., bears S. $20\frac{1}{2}^{\circ}$ E., 94 lks. dist., marked $\frac{1}{4}$ S35 BT.

A fir, 40 ins. diam., bears S. $47\frac{1}{2}^{\circ}$ W., 57 lks. dist., marked $\frac{1}{4}$ S34 BT.

N. $0^{\circ} 23'$ E., beginning new measurement.

Ascend 136 ft. over steep SW. slope.

- 2.75 Top of sandstone ledge, 12 ft. high, bears NW. and SE., faces SW.
- 8.40 Ravine, drains S. 25° W.; asc. 119 ft. along W. slope.
- 13.40 Low spur, slopes S. 15° W.; asc. 171 ft. over broken SW. slope.
- 25.40 Spur, slopes S. 30° W.; asc. 107 ft. over broken SW. slope.
- 34.40 Ridge, bears N. 80° W. and S. 80° E.; desc. 112 ft. over NE. slope.
- 39.31 Point for the cor. of secs. 26, 27, 34, and 35, determined from the remains of the original bearing trees:


A burned and rotted fir stump, bears N. 80° W., 70 lks. dist.

A madrona stool, bears N. 50° E., 66 lks. dist.

A madrona stool, bears S. 66° W., 30 lks. dist.

At the corner point

Set an iron post, 3 ft. long, 2 ins. diam., 14 ins. in the ground, to solid rock and in a mound of stone, 3 ft. base, to top, with brass cap marked

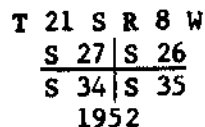

from which

A fir, 27 ins. diam., bears N. $60\frac{1}{4}^{\circ}$ E., 66 lks. dist., marked T21S R8W S26 BT.

A fir, 20 ins. diam., bears S. $20\frac{1}{4}^{\circ}$ E., 113 lks. dist., marked T21S R8W S35 BT.

A fir, 30 ins. diam., bears S. $40\frac{1}{2}^{\circ}$ W., 34 lks. dist., marked T21S R8W S34 BT.

A fir, 18 ins. diam., bears N. $5\frac{1}{4}^{\circ}$ W., 30 lks. dist., marked T21S R8W S27 BT.

Land, mountainous. Soil, rocky clay and sandstone. Timber, fir, hemlock, cedar, alder, maple, dogwood, and madrona. Undergrowth, vine maple, hazel, arrowwood, salal, ceanothus, bracken, and poison oak.