


County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of a Portion of the Subdivisional Lines of T. 21 S., R. 8 W.

CHAINS

Set an iron post, 3 ft. long, 1 in. diam., 26 ins. in the ground, with brass cap marked

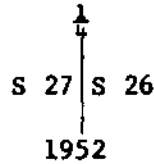

from which

A fir, 25 ins. diam., bears S. $2\frac{1}{2}^\circ$ E., 37 lks. dist., marked $\frac{1}{4}$ S26 BT.

A fir, 30 ins. diam., bears S. $30\frac{1}{2}^\circ$ W., 15 lks. dist., marked $\frac{1}{4}$ S27 BT.

Descend 218 ft. along steep E. slope.


43.85 Branch, 2 lks. wide, course SE.; asc. 290 ft. over SW. slope.

64.80 Spur, slopes SW.; desc. 15 ft. along W. slope.

65.80 A spring branch, 1 lk. wide, course SW.; asc. 300 ft. over steep, rocky SE. slope, changing to E. slope.

73.74 Point for the cor. of secs. 22, 23, 26, and 27, at proportionate distance; there is no remaining evidence of the original corner.

Set an iron post, 3 ft. long, 2 ins. diam., 26 ins. in the ground, with brass cap marked

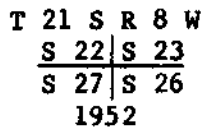

from which

A fir, 58 ins. diam., bears N. 27° E., 190 lks. dist., marked T21S R8W S23 BT.

A fir, 30 ins. diam., bears S. 29° E., 96 lks. dist., marked T21S R8W S26 BT.

A fir, 25 ins. diam., bears S. $27^\circ 45'$ W., 128 lks. dist., marked T21S R8W S27 BT.

A cedar, 41 ins. diam., bears N. $22\frac{1}{2}^\circ$ W., 68 lks. dist., marked T21S R8W S22 BT.

Land, mountainous. Soil, rocky clay and sandstone. Timber, fir, hemlock, cedar, alder, maple, chinquapin, and madrona. Undergrowth, burned over vine maple, salal, hazel, bracken, and ceanothus.

From the cor. of secs. 23, 24, 25, and 26.

N. $88^\circ 44'$ W., bet. secs. 23 and 26.

Ascend 198 ft. over steep E. slope, through heavy timber and dense undergrowth.

3.50 Ridge and tractor trail, bears N. and S.; desc. 129 ft. over steep NW. slope.

6.80 Ravine, drains NW.; asc. 74 ft. over NE. slope.