

County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of Portion of S. Bdy. of Sec. 31, T. 24 S., R. 3 W.


CHAINS

A fir, 24 ins. diam., bears S. 73° E., 25 lks. dist., with healed blaze.

Land, rolling hills. Soil, clay loam and rocky. Timber, fir, hemlock, madrone, cedar, and alder; undergrowth, vine maple, fern, hazel, blackberry, Oregon grape, and reproduction.

Dependent Resurvey of Portion of the W. Bdy., Sec. 31, T. 24 S., R. 3 W.
(Restoring the survey by Gordon and Gardner, in 1855 and the dependent resurvey by Norman D. Price, in 1950)

From the $\frac{1}{4}$ sec. cor. of secs. 31 and 36, monumented by N. D. Price, in 1944, with an iron post, 1 in. diam., 12 ins. above ground, firmly set, with brass cap mkd.

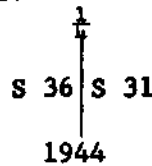

from which bearing trees by Price, in 1944:

A sawed cedar stump, 28 ins. diam., bears N. 47° E., 107 lks. dist., with scribe marks $\frac{1}{4}$ S31 BT visible on open blaze.

A sawed fir stump, 26 ins. diam., bears S. 17 $\frac{3}{4}$ ° W., 95 lks. dist., with scribe marks $\frac{1}{4}$ S36 BT visible on open blaze.

County Surveyor's bearing trees:

A cedar, 8 ins. diam., bears S. 9 $\frac{1}{2}$ ° E., 37 lks. dist., mkd. $\frac{1}{4}$ S31 CS BT.

A sawed madrone stump, 26 ins. diam., bears N. 2° W., 59 lks. dist., with illegible scribe marks visible on partially healed blaze.

and new bearing tree:

A fir, 6 ins. diam., bears S. 48 $\frac{1}{2}$ ° W., 26 $\frac{1}{2}$ lks. dist., mkd. $\frac{1}{4}$ S36 BT.

From this point a fence cor. bears S. 5° E., 29 lks. dist., with fences extending approximately N. and E.

North, bet. secs. 31 and 36.

Ascend 85 ft. over SW. slope, through logged area with scattering undergrowth.

4.00 Spur, slopes S. 70° W.; desc. 70 ft. over NW. slope.

10.15 Ravine, drains SW. and skid road, bears NE. and SW.; asc. 286 ft. over broken S. slope.

19.67 Point for the N 1/16 sec. cor. of secs. 31 and 36.

Set an iron post, 28 ins. long, 2 $\frac{1}{2}$ ins. diam., 26 ins. in the ground, with brass cap mkd.

