

County Surveyor's Record, Douglas County, Oregon

Remonumentation of Certain Original Corner Points, T. 24 S., R. 8 W.

CHAINS


A hemlock, 19 ins. diam., bears S. $60\frac{1}{2}^\circ$ W., 16 lks. dist.,
mkd. $\frac{1}{4}$ S13 BT.

The $\frac{1}{4}$ sec. cor. of secs. 11 and 12, determined at record bearing
and distance from the only remaining original bearing tree:

A cedar, 28 ins. diam., bears S. 80° E., 90 lks. dist.,
with scribe marks $\frac{1}{4}$ visible on partially opened blaze.

At the corner point

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 26 ins. in the
ground, with brass cap mkd.

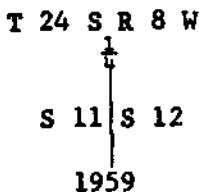

from which

A white fir, 7 ins. diam., bears N. $14\frac{3}{4}^\circ$ E., 73 lks. dist.,
mkd. $\frac{1}{4}$ S12 BT.

A white fir, 6 ins. diam., bears S. 71° W., 89 lks. dist.,
mkd. $\frac{1}{4}$ S11 BT.

The cor. of secs. 1, 2, 11, and 12, determined at record bearing
and distance from the original bearing trees:

A rotted hemlock snag, bears N. $42\frac{1}{2}^\circ$ E., 25 lks. dist.,
with scribe marks 24S R8W S1 and other illegible scribe
marks visible on partially opened blaze.


A fir, 60 ins. diam., bears S. 57° E., 45 lks. dist.,
with healed blaze.

A fir, 48 ins. diam., bears S. 63° W., 17 lks. dist.,
with healed blaze.

A hemlock, 30 ins. diam., bears N. 22° W., 58 lks. dist.,
with scribe marks 24 R8W S2 visible on partially opened
blaze.

At the corner point

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the
ground, with brass cap mkd.

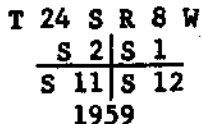

from which

A hemlock, 6 ins. diam., bears N. $49\frac{3}{4}^\circ$ E., 46 lks. dist.,
mkd. T24S R8W S1 BT.

A hemlock, 6 ins. diam., bears S. $68\frac{1}{4}^\circ$ E., 54 lks. dist.,
mkd. T24S R8W S12 BT.

A hemlock, 6 ins. diam., bears S. $33\frac{1}{4}^\circ$ W., 46 lks. dist.,
mkd. T24S R8W S11 BT.