

County Surveyor's Record, Douglas County, Oregon  
18


Dependent Resurvey of the East Boundary, T. 23 S., R. 6 W.

CHAINS

- 16.20 Creek, 2 lks. wide, course N. 45° W.; asc. 25 ft. over SW. slope.
- 18.85 Spur, slopes W.; desc. 25 ft. over NW. slope.
- 20.10 Ravine, course W.; asc. 181 ft. over SW. slope.
- 26.85 Spur, slopes N. 70° W.; desc. 179 ft. over N. slope.
- 30.20 Creek, 1 lk. wide, course N. 60° W.; asc. 128 ft. over SW. slope.
- 39.84 Point for the  $\frac{1}{4}$  sec. cor. of secs. 13 and 18, at proportionate distance; there is no remaining evidence of the original corner.

Set an iron post, 3 ft. long, 1 in. diam., 27 ins. in the ground, with brass cap mkd.

*FOOK  
3/94 BY BAKER  
M 118-60*

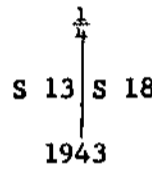

from which

A fir, 48 ins. diam., bears S. 18° E., 153 lks. dist., mkd.  $\frac{1}{4}$  S18 BT.


A fir, 36 ins. diam., bears N. 29 $\frac{1}{2}$ ° W., 82 lks. dist., mkd.  $\frac{1}{4}$  S13 BT.

Ascend 67 ft. over SW. slope.

- 46.00 Spur, slopes N. 80° W.; desc. 176 ft. over NW. slope.
- 65.00 Spur, slopes N. 25° W.; desc. 344 ft. over NE. slope.
- 79.68 Point for the cor. of secs. 7, 12, 13, and 18, at proportionate distance; there is no remaining evidence of the original corner.

Set an iron post, 3 ft. long, 2 ins. diam., 27 ins. in the ground, with brass cap mkd.

*Ed. 7/90 US 43/604*

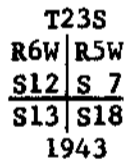

from which

A fir, 36 ins. diam., bears N. 23 $\frac{1}{2}$ ° E., 223 lks. dist., mkd. T23S R5W S7 BT.

A fir, 30 ins. diam., bears S. 80° E., 25 lks. dist., mkd. T23S R5W S18 BT.

A fir, 12 ins. diam., bears S. 42° W., 109 lks. dist., mkd. T23S R6W S13 BT.

A fir, 10 ins. diam., bears N. 50° W., 61 lks. dist., mkd. T23S R6W S12 BT.

Land, mountainous. Soil, sandy and rocky loam. Timber, fir, cedar, hemlock and oak. Undergrowth, salal, vine maple, alder, huckleberry, blackberry, laurel, madrone, and manzanita.