

County Surveyor's Record, Douglas County, Oregon
45

Dependent Resurvey of the Subdivisional Lines, T. 23 S., R. 6 W.

CHAINS

A cedar, 13 ins. diam., bears N. 2° W., 101 lks. dist.,
mkd. $\frac{1}{4}$ S12 BT.

A fir, 9 ins. diam., bears S. 41° W., 19 lks. dist.,
mkd. $\frac{1}{4}$ S13 BT.

Ascend 317 ft. over NE. slope.

48.86 Spur, slopes N. 30° W.; desc. 360 ft. over W. slope.

59.60 E. edge of pond, bears N. and S.

64.12 W. edge of pond, bears N. and S.; asc. 477 ft. over E. slope.

78.62 Road, 30 lks. wide, bears NE. and SW.

79.96 The cor. of secs. 11, 12, 13, and 14.

Land, mountainous. Soil, clay loam. Timber, fir, cedar, and hemlock. Undergrowth, salal, vine maple, laurel, madrone, and poison oak.

N. 1°19' W., bet. secs. 11 and 12.

Descend 444 ft. over NE. slope, changing to N. slope.

10.65 Road, 25 lks. wide, bears N. 35° W. and S. 35° E.

18.63 Road, 25 lks. wide, bears E. curves S. and W. curves S.


27.23 Creek, 4 lks. wide, course N. 50° E.; asc. 188 ft. over SE. slope.

31.17 Spur, slopes E.; desc. 145 ft. over NE. slope.

36.50 Creek, 2 lks. wide, course S. 70° E.; asc. 105 ft. over SW. slope.

39.03 Point for the $\frac{1}{4}$ sec. cor. of secs. 11 and 12, at proportionate distance; there is no remaining evidence of the original cor.

Set an iron post, 3 ft. long, 1 in. diam., 27 ins. in the ground, with brass cap mkd.

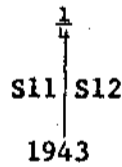

*FD. 62 6/81
B. SHAWER
M 79.78 &
3/90 K. HOFFINE
C.S. 63/104*

from which

A fir, 31 ins. diam., bears N. 7° E., 97 lks. dist.,
mkd. $\frac{1}{4}$ S12 BT.

A fir, 25 ins. diam., bears N. 39° W., 97 lks. dist.,
mkd. $\frac{1}{4}$ S11 BT.

Ascend 263 ft. over SW. slope.

48.60 Spur, slopes S. 60° E.; desc. 232 ft. over NE. slope.

57.43 Ravine, drains S. 75° E.; asc. 555 ft. over SW. slope.

77.43 Spur, slopes N. 70° E.; desc. 21 ft. over SW. slope.

78.06 Point for the cor. of secs. 1, 2, 11, and 12, determined at record bearings and distances to two of the original bearing trees: