

County Surveyor's Record, Douglas County, Oregon
54

Dependent Resurvey of the Subdivisional Lines, T. 23 S., R. 6 W.

CHAINS
6.90

Road, improved, 20 lks. wide, bears N. 70° E. and S. 70° W.; asc. 31 ft. over SE slope.

8.35


Saddle, bears N. 80° W. and S. 80° E.; desc. 993 ft. over steep N. slope, changing to NE. slope.

37.69

Point for the $\frac{1}{4}$ sec. cor. of secs. 14 and 15, at proportionate distance; there is no remaining evidence of the original corner.

Set an iron post, 30 ins. long, 2 ins. diam., 28 ins. in the ground, with brass cap mkd.

T23SR6W

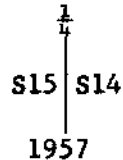

from which

A fir, 10 ins. diam., bears N. 61° E., 51 lks. dist., mkd. $\frac{1}{4}$ S14 BT.

A fir, 15 ins. diam., bears N. 61° W., 55 lks. dist., mkd. $\frac{1}{4}$ S15 BT.

This corner falls in a ravine, 1 lk. wide, drains N. 20° W.

Ascend 48 ft. over SW. slope.

40.50

Spur, slopes S. 80° W.; desc. 85 ft. over NW. slope.

45.10

Creek, 20 lks. wide, course N. 25° E.; desc. 16 ft. along E. slope.

48.40

Dry bed of creek, 3 lks. wide, course E.; desc. 118 ft. over NE. slope.

61.80

Dry bed of creek, 3 lks. wide, course N. 70° E.; asc. 53 ft. over slight S. slope.

74.75

Spur, slopes E.; desc. 8 ft. over NE. slope.

75.38

The cor. of secs. 10, 11, 14, and 15, determined at record bearings and distances from the remains of the original bearing trees:


A fir, 46 ins. diam., bears N. 38° E., 100 lks. dist., scribe marks not legible, I re-mark alongside of old marks T23S R6W S11 BT.

A fir, 36 ins. diam., bears S. 3° E., 28 lks. dist., marked T23S R6W S14 BT. I re-mark alongside of old marks T23S R6W S14 BT.

A fir, 46 ins. diam., bears N. 67° W., 19 lks. dist., mkd. T23S R6W S10 BT. I re-mark alongside of old marks T23S R6W S10 BT.

At the corner point

Set an iron post, 3 ft. long, 2 ins. diam., 27 ins. in the ground, with brass cap mkd.

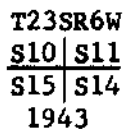

from which

FD. OK 2/93
BT. HOFFME
C.S. 63/149