


County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of the Subdivisional Lines, T. 23 S., R. 6 W.

CHAINS

T23SR6W

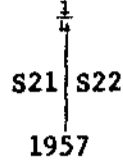

from which

A hemlock, 8 ins. diam., bears S. 11° E., 29 lks. dist.,
mkd. $\frac{1}{4}$ S22 BT.

A hemlock, 9 ins. diam., bears N. 36° W., 14 lks. dist.,
mkd. $\frac{1}{4}$ S21 BT.

N. 0°33' W., beginning new measurement.

Descend 112 ft. along E. slope, through heavy timber and undergrowth.

- 9.40 Branch, 1 lk. wide, course E.; desc. 220 ft. along broken E. slope.
- 24.20 Wet ravine, drains N. 60° E.
- 36.25 Creek, 1 lk. wide, course NE.
- 36.57 Point for the cor. of secs. 15, 16, 21, and 22, determined at record distance from three of the original bearing trees:


A hemlock, 10 ins. diam., bears N. 46° E., 7 lks. dist.,
mkd. with T 23 R 6 BT, on the bark. (Record bearing,
N. 41° E.)

A hemlock, 12 ins. diam., bears S. 81° E., 6 lks. dist.,
with portions of scribe marks.

A maple, 6 ins. diam., bears S. 22° W., 33 lks. dist.,
with portions of scribe marks.

A fir, 34 ins. diam., bears N. 56° E., 40 lks. dist.,
mkd. T 23 R 6 BT, on the bark. (Record bearing and
dist., N. 31° E., 10 lks. dist.)

Set an iron post, 36 ins. long, 2 ins. diam., over a cross (X) on solid bedrock and in a mound of stone, 6 ft. base, to top, with brass cap mkd.

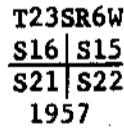

*Fd 8/90
M 110-53*

from which

A hemlock, 10 ins. diam., bears N. 41° E., 25 lks. dist.,
mkd. T23S R6W S15 BT.

A hemlock, 10 ins. diam., bears S. 32½° E., 75 lks. dist.,
mkd. T23S R6W S22 BT.

A hemlock, 7 ins. diam., bears S. 6° W., 99 lks. dist.,
mkd. T23S R6W S21 BT.

A hemlock, 10 ins. diam., bears N. 64½° W., 75 lks. dist.,
mkd. T23S R6W S16 BT.

From the cor. of secs. 14, 15, 22, and 23.

N. 88°07' W., bet. secs. 15 and 22.