


County Surveyor's Record, Douglas County, Oregon  
65

Dependent Resurvey of the Subdivisional Lines, T. 23 S., R. 6 W.

CHAINS

T23SR6W

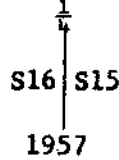

from which

A fir, 9 ins. diam., bears S. 46° E., 35 lks. dist.,  
mkd.  $\frac{1}{4}$  S15 BT.

A fir, 10 ins. diam., bears S. 62 $\frac{1}{2}$ ° W., 71 lks. dist.,  
mkd.  $\frac{1}{4}$  S16 BT.

Ascend 31 ft. over SW. slope.

53.52 Ridge, bears N. 30° W. and S. 30° E.; desc. 81 ft. along ridge top.

66.40 Leave ridge, bears NW. and E. curving to S.; desc. 145 ft. over NE. slope.

77.50 Spur, slopes SE.; desc. 7 ft. over NE. slope to corner.

78.92 The cor. of secs. 9, 10, 15, and 16, determined at record bearings and distances from the remains of the original bearing trees:


A fir, 53 ins. diam., bears N. 33° E., 45 lks. dist.,  
with a chopped blaze.

A burned stump, 10 ins. diam., bears N. 22° W.

At the corner point

Set an iron post, 3 ft. long, 2 ins. diam., 27 ins. in the ground,  
and in a mound of stone, 3 ft. base, to top, with brass cap mkd.

T23SR6W

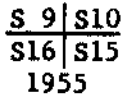

from which

A fir, 8 ins. diam., bears N. 65° E., 100 lks. dist.,  
mkd. T23S R6W S10 BT.

A fir, 10 ins. diam., bears S. 70° E., 58 lks. dist.,  
mkd. T23S R6W S15 BT.

A maple, 30 ins. diam., bears S. 30° W., 87 lks. dist.,  
mkd. T23S R6W S16 BT.

A fir, 6 ins. diam., bears N. 85° W., 69 lks. dist.,  
mkd. T23S R6W S9 BT.

Land, mountainous. Soil, clay loam. Timber, fir, hemlock, and cedar. Undergrowth, poison oak, salal, vine maple, madrone, and bracken fern.

From the cor. of secs. 10, 11, 14, and 15.

N. 85°08' W., bet. secs. 10 and 15.

Ascend 525 ft. over SE. slope, through heavy timber and dense undergrowth.