

County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 8 W.

CHAINS

from which

A fir, 20 ins. diam., bears N. $70\frac{1}{2}^{\circ}$ E., 55 lks. dist., mkd.
 $\frac{1}{4}$ S 35 BT.

A fir, 27 ins. diam., bears N. $72\frac{1}{4}^{\circ}$ W., 35 lks. dist., mkd.
 $\frac{1}{4}$ S 34 BT.

N. $0^{\circ} 22'$ E., beginning new measurement.

Descend 202 ft. over steep N. slope.

3.40 Bottom of dry ravine, course E.; ascend 272 ft. over steep, rocky S. slope.

5.95 A low, rocky crag, falls E.; continue ascent over SE. slope.

11.50 Top of high spur, slopes NE.; descend 351 ft. over steep NW. slope.

17.30 Slope changes to W., continue descent.

20.70 Slope changes to NW.; continue descent.

23.60 Bottom of dry canyon, drains NE.; ascend 240 ft. over SE. slope.

30.10 Top of high spur, slopes E.; descend 330 ft. over steep N. slope.


39.70 The mouth of a creek, 5 lks. wide, from S. 20° E., bears E. 15 lks. distant.

39.77 Esmond Creek, 20 lks. wide, course winding W.

39.92 Point for the cor. of secs. 26, 27, 34 and 35 as determined by the intersection of blazed lines N., S., E. and W., from which a stump hole of a fallen large alder bears N. $80\frac{1}{2}^{\circ}$ E., 38 lks. dist., evidently the position of the original NE. bearing tree; no evidence of the other bearing trees was recovered.

At the corner point.

Set an iron post, 3 ft. long, 2 ins. diam., 28 ins. in the ground, with brass cap mkd.

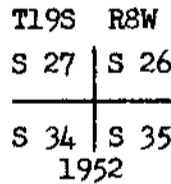

from which

An alder, 11 ins. diam., bears N. $30\frac{1}{2}^{\circ}$ E., 93 lks. dist., mkd.
T19S R8W S26 BT.

A fir, 77 ins. diam., bears S. $6\frac{1}{4}^{\circ}$ E., 362 lks. dist., mkd.
T19S R8W S35 BT.

An alder, 17 ins. diam., bears S. $23\frac{1}{2}^{\circ}$ W., 211 lks. dist., mkd.
T19S R8W S34 BT.

A maple, 22 ins. diam., bears N. 70° W., 86 lks. dist., mkd.
T19S R8W S27 BT.