

County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 8 W.

CHAINS

A fir, 50 ins. diam., bears S. 55½° E. 71 lks. dist., mkd.
¼ S27 BT.

A cedar, 10 ins. diam., bears N. 67¼° W. 83 lks. dist., mkd.
¼ S28 BT.

N. 0° 04' W., beginning new measurement.

Descend 17 ft. over rough and broken W. slope; through heavy timber and dense undergrowth.

1.03 A stream, 1 lk. wide, course W.; descend 33 ft.

5.02 A draw, drains W.; descend 5 ft.

10.39 A stream, 5 lks. wide, course SW.; ascend 75 ft. over rough E. slope.

18.23 A stream, 3 lks. wide, course SE.; ascend 93 ft. along NE. slope.

25.45 A stream, 1 lk. wide, course SE.; ascend 343 ft. along SE. slope.

33.26 Top of ridge, bears NE. and SW.; descend 135 ft. over steep NW. slope.

40.15 Dry ravine, course SW.; ascend 38 ft. along SW. slope.


41.20 Point for the cor. of secs. 21, 22, 27 and 28 as determined from the two remaining bearing trees:

A fir, 28 ins. diam., bears N. 83° E., 71 lks. dist., showing a healed blaze facing SW.

A fir, 20 ins. diam., bears S. 79½° E., 30 lks. dist., showing a healed blaze facing NW.

At the corner point

Set an iron post, 3 ft. long, 2 ins. diam., 27 ins. in the ground, with brass cap mkd.

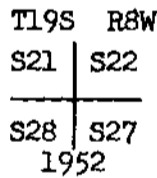

from which

A fir, 42½ ins. diam., bears S. 67° W., 70 lks. dist., mkd.
T19S R8W S28 BT.

A maple, 6 ins. diam., bears N. 45° W., 64 lks. dist., mkd.
T19S R8W S21 BT.

Land, mountainous.

Soil, clay and sandstone.

Timber, heavy fir, hemlock, cedar, alder, maple, chinquapin, madrona and dogwood.

Undergrowth, dense vine maple, manzanita, huckleberry, blackberry salmonberry, arrowwood, Oregon grape and salal.

N. 0° 02' E., between secs. 21 and 22.

Ascend 99 ft. over broken SW. slope; through heavy timber and dense undergrowth.

2.97 Top of spur, slopes NW.; descend 469 ft. along NW. slope, changing to north.