

County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 8 W.

CHAINS


- 14.02 A stream, 4 lks. wide, course NW.; ascend 340 ft. over steep SW. slope.
- 22.56 Top of spur, slopes SW.; ascend 75 ft. along broken W. slope.
- 30.94 Ridge, bears NW. and SE.; descend 344 ft. over steep N. slope.
- 37.60 A stream, 1 lk. wide, course NW.; ascend 63 ft.
- 40.14 Point for the $\frac{1}{4}$ sec. cor. of secs. 21 and 22, as determined from the remaining original bearing trees:

A fir, 45 ins. diam., bears S. 55° E., 43 lks. dist., showing a healed blaze facing NW.

A Maple, 10 ins. diam., bears S. 25° W., 52 lks. dist., showing a healed blaze on NE. face.

At the corner point

Set an iron post, 3 ft. long, 1 in. diam., 27 ins. in the ground, with brass cap mkd.

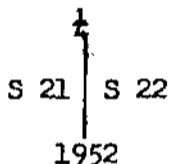

Fd. by:
M. KRUSH
11/11/82
M 93-36

See CS 62/30
for Reference
out corner info.
L. Roberts
1/27/85

from which

A fir, 8 ins. diam., bears S. 31° W., 29 lks. dist., mkd. $\frac{1}{4}$ S21 BT.

N. 0° 31' E., beginning new measurement.

Descend 59 ft. over broken W. slope.


- 10.40 Draw, drains NW.; ascend 248 ft. along W. slope.
- 22.50 Slope changes to SW.; becomes rocky and steep.
- 26.50 Top of high spur, projects W.; descend 403 ft. over steep NE. slope.
- 37.45 Bottom of dry ravine, drains NW.; ascend 39 ft. over SW. slope.
- 40.39 The point for the cor. of secs. 15, 16, 21 and 22 as determined from the remaining original bearing trees:

A fir, 36 ins. diam., bears S. 74° E., 33 lks. dist., mkd. by a healed blaze on NW. face. (Record bearing, S. 10° E.)

A hemlock, 26 ins. diam., bears S. 78° W., 46 lks. dist., with healed blaze on NE. face. (Record bearing, S. 79° 45' W.)

At the corner point

Set an iron post, 3 ft. long, 2 ins. diam. 27 ins. in the ground with brass cap mkd.

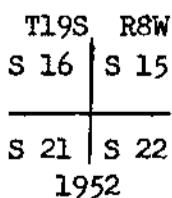

Fd. by:
M. KRUSH
11/11/82
M 93-36

from which