

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 8 W.

CHAINS

Ascend 130 ft. along steep SW. slope.

4.00 Top of spur, slopes W.; continue ascent, 56 ft. along W. slope.

9.40 Top of spur, slopes W.; ascend 43 ft. along broken SW. slope.


17.60 Top of spur, slopes W.; descend 411 ft. along NW. slope.

30.30 Bottom of raine and stream, 1 lk. wide, course NW.; ascend 246 ft. over S. slope.

39.60 Top of spur, slopes W.; descend 17 ft. over NW. slope.

40.21 Point for the witness to the cor. of secs. 9, 10, 15 and 16.

Set an iron post, 3 ft. long, 2 ins. diam., 27 ins. in the ground, with brass cap mkd.

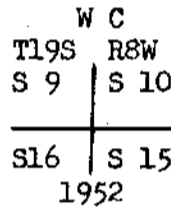

from which

A fir, 26 ins. diam., bears N. 73½° E., 28 lks. dist., mkd.
WC T19S R8W S10 BT.

A fir, 34 ins. diam., bears S. 66° 45' E., 67 lks. dist., mkd.
WC T19S R8W S15 BT.

A fir, 28 ins. diam., bears S. 28° W., 41 lks. dist., mkd.
WC T19S R8W S16 BT.

A fir, 36 ins. diam., bears N. 72° W., 37 lks. dist., mkd.
WC T19S R8W S 9 BT.

40.26 The cor. of secs. 9, 10, 15 and 16, which is marked with a dead fir, 22 ins. diam, with partially healed blazes in each quadrant, all showing scribe marks, from which the original bearing trees:

A fir, 26 ins. diam., bears N. 74½°E., 25 lks. dist., with old blaze on SW. face.

The stump hole of a fallen fir, 36 ins. diam., bears S. 51¼° E., 50 lks. dist.

A fir, stump, 10 ins. diam., bears S. 56½° W., 40 lks. dist. with a resin scar facing the corner.

A stump hole of a fallen fir, 36 ins. diam., bears N. 20° W., 21 lks. dist.

Land, mountainous, along broken west slope of Esmond Creek canyon. Soil, clay and sandstone.

Timber, heavy fir, hemlock, cedar, alder, maple, chinquapin, and madrona.

Undergrowth, dense vine maple, salal, huckleberry, blackberry, salmonberry, manzanita, bracken, and Oregon grape.

N. 0° 40' E., between secs. 9 and 10.

Descend 216 ft. over very steep N. slope; through heavy timber and dense undergrowth, and fallen timber.