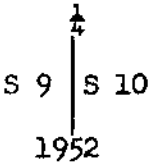


County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 8 W.

CHAINS 5.50	A stream, 2 lks. wide, course S. 85° W.; ascend 217 ft. over steep SW. slope.
14.70	Top of spur, slopes N. 70° W.; descend 365 ft. along very steep NE. slope.
20.00	A ravine, drains NE.; continue descent, 116 ft.
25.25	The same ravine, course NW.; ascend 65 ft. over SW. slope.
37.50	Top of small spur, slopes NW.; descend slightly.
38.00	Bottom of small draw, drains SW.; ascend 62 ft. over SW. slope.
41.16	Point for the $\frac{1}{4}$ sec. cor. of secs. 9 and 10, determined from the remains of the original bearing trees: A fir stump bears N. 17 $\frac{1}{4}$ ° E., 42 lks. dist., with evidence of a healed blaze on SW. face, badly decayed. A fir stump, badly decayed, bears S. 63° W., 36 lks. dist., (record bearing, S. 27° W.) with evidence of a healed blaze facing NE. At the corner point Set an iron post, 3 ft. long, 1 in. diam., 27 ins. in the ground with brass cap mkd. <div style="text-align: center;">  </div> from which A fir, 32 ins. diam., bears S. 86 $\frac{1}{4}$ ° E., 88 lks. dist., mkd. $\frac{1}{4}$ S10 BT. A fir, 18 ins. diam., bears S. 45° 45' W., 193 lks. dist., mkd. $\frac{1}{4}$ S 9 BT. <hr style="width: 20%; margin: auto;"/> North, beginning new measurement. Ascend 12 ft. over broken W. slope.
0.60	Top of low spur, slopes N. 70° W.; descend slightly.
1.80	A short dry draw, drains S. 60° W.; ascend 31 ft. over SW. slope.
3.40	A low spur, slopes W.; descend 6 ft.
4.40	A shallow draw, drains SW.; ascend 99 ft. over S. slope.
11.00	Top of spur, slopes NW.; Descend 325 ft. along steep N. slope.
18.25	Descent becomes gradual.
21.40	Enter bottom land, edge bears NE. and SW.
30.70	Left bank of Siuslaw River, bears N. 80° E. and S. 80° W., course S. 80° W.
31.95	Right bank of Siuslaw River; ascend 100 ft. over steep S. slope.
34.30	Top of steep ascent, bears NE. and SW.; thence along slightly broken W. slope.