

County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 8 W.

CHAINS

- 22.30 Enter bottom land, edge bears N. 20° W. and S. 20° E.
- 23.85 Esmond Creek, 20 lks. wide, course N. 10° W.
- 26.70 Leave bottom land, edge bears N. and S.; ascend slightly over E. slope.
- 27.70 An unimproved earth road, bears N. and S.
- 28.70 Trail to Twin Sisters Guard Station, bears NE. and SW.; ascend 316 ft. over broken E. slope.
- 38.50 Top of high spur, slopes S. 20° E.; descend 24 ft. over SW. slope.
- 39.25 The cor. of secs. 28, 29, 32 and 33.

Land, mountainous, across the canyon of Esmond Creek.
 Soil, rocky clay.
 Timber, heavy fir, hemlock, cedar, maple, alder, and dogwood,
 with some chinquapin and madrona.
 Undergrowth, dense vine maple, hazel, salal, arrowwood,
 salmon berry, and bracken.

N. 0° 02' E., between secs. 28 and 29.


Over mountainous land, through heavy timber and dense undergrowth;
 ascend 54 ft. along broken SW. slope.

- 1.85 Top of spur, slopes S. 25° E.; descend 20 ft. over E. slope.
- 5.40 Bottom of draw, drains SE.; ascend 196 ft. over steep S. slope.
- 10.80 Top of spur, slopes N. 20° E.; descend 59 ft. over W. slope.
- 17.40 Top of spur, slopes N. 25° W.; descend 161 ft. along steep,
 broken E. slope.
- 26.30 Top of spur, slopes NE.; descend 376 ft. on very steep N. slope.
- 35.00 A stream, 5 lks. wide, course E.; ascend 36 ft. over SE. slope.
- 38.06 Trail, bears E. and SW.
- 41.05 Point for the $\frac{1}{4}$ sec. cor. of secs. 28 and 29, determined from the
 one remaining original bearing tree:

A cedar, 22 ins. diam., bears S. 17° E., 30 lks. dist., mkd.
 with an old blaze on NW. face.

At the corner point

Set an iron post, 3 ft. long, 1 in. diam., 27 ins. in the ground,
 with brass cap mkd.

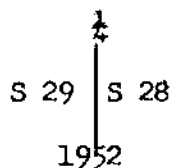

from which

A cedar, 33 ins. diam., bears N. 64° W., 51 lks. dist., mkd.
 $\frac{1}{4}$ S29 BT.

A cedar, 15 ins. diam., bears S. 61 $\frac{1}{2}$ ° E., 60 lks. dist., mkd.
 $\frac{1}{4}$ S28 BT.