

County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 8 W.

CHAINS

N. 0° 25' E., beginning new measurement.

Ascend 119 ft. along broken E. slope.

5.60 Top of spur, slopes SW.; descend 48 ft.

8.35 A dry draw, drains SW.; ascend 114 ft. over SE. slope.

11.80 Top of spur, slopes E.; descend 29 ft. over N. slope.

13.40 A dry draw, drains E.; ascend 192 ft. over S. slope.

18.20 Top of spur, slopes E.; descend 39 ft. over N. slope.

20.25 Bottom of draw, drains E., ascend 17 ft. over S. slope.

21.70 Top of spur, slopes E.; descend 261 ft. over N. slope.


26.80 Ravine, drains NE.; ascend 22 ft. along E. slope.

29.50 Top of spur, slopes E.; descend 142 ft. along E. slope.

34.40 Enter bottom land, edge bears N. 20° W. and S. 20° E.

40.38 Point for the witness to the cor. of secs. 20, 21, 28 and 29.

Set an iron post, 3 ft. long, 2 ins. diam., 27 ins. in the ground, with brass cap mkd.

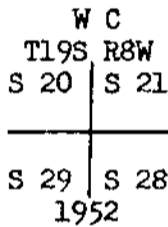

*FD. OK 4/80
W. E. M. STAD
MB-77*

from which

A fir, 40 ins. diam., bears N. 31½° E., 101 lks. dist., mkd.
WC T19S R8W S21 BT.

A maple, 27 ins. diam., bears S. 80° E., 111 lks. dist., mkd.
WC T19S R8W S28 BT.

An alder, 10 ins. diam., bears S. 30° 45' W., 77 lks. dist., mkd.
WC T19S R8W S29 BT.

A maple, 27 ins. diam., bears N. 65½° W., 53 lks. dist., mkd.
WC T19S R8W S20 BT.

40.44 The cor. of secs. 20, 21, 28 and 29, which is marked with a fir, 50 ins. diam., showing healed blazes in each quadrant. The remaining bearing trees are:

A fir, 37 ins. diam., bears N. 72½° E., 29 lks. dist., with an old blaze facing SW. (Record bearing, N. 77° E.)

A fir, 70 ins. diam., bears S. 64½° E., 54 lks. dist., with an old blaze facing NW. (Record bearing, S. 63½° E., 50 lks. dist.)

Land, mountainous.

Soil, rocky clay.

Timber, heavy fir, hemlock, cedar, alder, maple, chinquapin, dogwood, and madrona.

Undergrowth, dense vine maple, salal, arrowwood, hazel, manzanita, rhododendron, huckleberry, salmonberry, bracken and Oregon grape.