

County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey of a Portion of the Subdivision, T. 19 S., R. 8 W.

CHAINS

N. 0° 10' W., between secs. 20 and 21.

Over mountainous land; through heavy timber and undergrowth; on nearly level course over bottom land.

5.25 A stream, 10 lks. wide, course E.

7.99 A fir, 45 ins. diam.

14.00 Leave bottom land, edge bears NE. and SW.; ascend 519 ft. over steep S. slope.

27.70 Top of spur, slopes E.; descend 299 ft. over very steep N. slope.

32.90 A dry ravine, course NE.; ascend 84 ft. over SE. slope.

38.25 Top of spur, slopes NE.; descend 76 ft. over NE. slope.


39.81 Point for the $\frac{1}{4}$ Sec. Cor. of secs. 20 and 21 as determined from the original bearing trees:

A fir, 37 ins. diam., bears N. 43° W., 25 lks. dist., with old blaze on SE. face.

A stump hole of a fallen fir bears S. 88° 45' E., 63 lks. dist.

At the corner point

Set an iron post, 3 ft. long, 1 in. diam., 6 ins. in the ground to solid rock and in a mound of stone to top, with brass cap mkd.

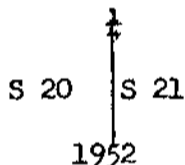

from which

A fir, 20 ins. diam., bears N. 70 $\frac{1}{2}$ ° E., 102 lks. dist., mkd. $\frac{1}{4}$ S21 BT.

A fir, 35 ins. diam., bears S. 30° 45' W., 18 lks. dist., mkd. $\frac{1}{4}$ S20 BT.

N. 0° 32' E., beginning new measurement.

Descend 127 ft. over steep NE. slope.

2.70 Ravine, drains NE.; ascend 417 ft. over steep SE. slope.

13.90 Top of spur, slopes NE.; descend 164 ft. over steep, broken NW. slope.

22.20 Top of small spur, slopes N.; descend 318 ft.

30.35 A stream, 4 lks. wide, course NE.; ascend 309 ft. over SE. slope.

39.93 Point for the cor. of secs. 16, 17, 20 and 21 as determined from the two remaining original bearing trees;

A fir, 32 ins. diam., bears S. 84° W., 29 lks. dist., with an old blaze on E. face.

A fir, 42 ins. diam., bears N. 64° W., 23 lks. dist., with an old blaze on NE. face.