

County Surveyor's Record, Douglas County, Oregon


Dependent Resurvey of a Portion of the E. Bdy., T. 21 S., R. 6 W.

CHAINS

- A fir, 6 ins. diam., bears S. 27° E., 11 lks. dist., mkd. S 1/16 S6 BT.
- A fir, 10 ins. diam., bears S. 26° W., 37 lks. dist., mkd. S 1/16 S1 BT.
- A water pipe, 1 in. diam., protruding 8 ins. from the ground, firmly set, bears N. 50° W., 23 lks. dist.

Descend 20 ft. over NW slope.

- 21.20 A picket fence, 4 ft. high, bears N. 60° E. and S. 60° W.
- 21.70 Tip Davis Creek, 10 lks. wide, course S. 60° W.; asc. 13 ft. over gentle S. slope.
- 26.00 Intersect SE. side of occupied wood frame dwelling, 24 x 48.5 ft.; long side bears N. 45° E.; SE. cor. bears N. 45° E., 39 lks. dist.
- 27.00 Dirt road, 15 lks. wide, bears N. 55° E. and S. 55° W.
- 28.50 Dirt road, 15 lks. wide, bears N. 55° E. and S. 55° W.; asc. 39 ft. over gently rolling land, through scattering timber.
- 31.30 A wood frame barn, 36 x 16.5 ft., SW. cor. bears East, 13 lks. dist.; asc. 26 ft. over rolling logged land.
- 39.88 The 1/4 sec. cor. of secs. 1 and 6, which has been perpetuated with a Douglas County survey marker, an iron post, 1 in. diam., protruding 8 ins. from the ground, firmly set, with brass cap mkd.

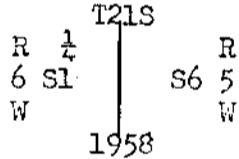

from which the original bearing trees:

- A rotted fir snag, bears S. 83° E., 8 lks. dist., with no marks visible.
- A fir, 24 ins. diam., bears N. 37° W., 11 lks. dist., with fragmentary scribe marks visible on opened blaze.

trees mkd. by the County Surveyor:

- A fir, 18 ins. diam., bears N. 33° W., 26 lks. dist., mkd. 1/4 S1 CS BT.
- A fir, 6 ins. diam., bears S. 55 3/4° E., 24 lks. dist., mkd. 1/4 S6 CS BT.

and new bearing trees:

- A fir, 9 ins. diam., bears S. 71° E., 93 lks. dist., mkd. 1/4 S6 BT.
- A fir, 36 ins. diam., bears S. 12° W., 132 lks. dist., mkd. 1/4 S1 BT.

I stamp USBLM 1962 on brass cap.

N. 0° 27' W., beginning new measurement.

Over nearly level land, through logged area.