

County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey, Portion of Subdivisional Lines, T. 30 S., R. 8 W.

CHAINS

A hemlock, 10 ins. diam., bears S. $62\frac{1}{4}^{\circ}$ E., 26 lks. dist., mkd. $\frac{1}{4}$ S11 BT.

Deposit original corner stone alongside iron post.

S. $87^{\circ} 49'$ W., beginning new measurement.

Descend 40 ft. over broken N. slope.

4.45 Ravine, drains N.; asc. 120 ft. over NE. slope.

14.00 Ridge, bears N. 70° W. and S. 70° E.; desc. 125 ft. over SW. slope.

31.90 Same ridge, bears N. 35° E. and S. 35° W.; desc. 155 ft. over NW. slope.

37.35 Ravine, drains N. 65° E.; asc. 115 ft. over SE. slope.

39.88 The cor. of secs. 2, 3, 10 and 11.

Land, mountainous.

Soil, rocky clay.

Timber, fir, pine, cedar, hemlock, madrone, maple, alder, dogwood, yew, chinquapin and live oak; undergrowth, salal, poison oak, Oregon grape, hazel, arrowwood, manzanita, vines and ferns.

Subdivision of Section 11, T. 30 S., R. 8 W.

The following subdivision of section 11 was executed in conformity with legal surveying practice. The record of true line notes only, is set forth in the following field notes.

From the $\frac{1}{4}$ sec. cor. of secs. 11 and 14.

N. $0^{\circ} 48'$ E., on the N. and S. center line of sec. 11.

Ascend 360 ft. over SE. slope, through heavy timber and light undergrowth.


10.05 Dirt road, 15 lks. wide, bears N. 60° W. and S. 60° E.

11.65 Enter logged area, edge bears N. 35° E. and S. 40° W.

13.75 Same road, bears N. 40° E. and S. 40° W.

19.72 Point for the center S $1/16$ sec. cor. of sec. 11.

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

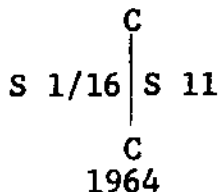

from which