

County Surveyor's Record, Douglas County, Oregon

14962

Dependent Resurvey, Portion of Subdivisional Lines, T. 25 S., R. 7 W.

CHAINS
2.00

Rocky spur, slopes S. 60° E.; desc. 405 ft. over NE. slope.

19.95 Point for the S 1/16 sec. cor. of secs. 21 and 22.

Set an iron post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

S 1/16
S 21 | S 22
1968

from which

A fir, 13 ins. diam., bears N. 74° E., 37½ lks. dist., mkd. S 1/16 S22 BT.

A fir, 18 ins. diam., bears S. 81 3/4° W., 33½ lks. dist., mkd. S 1/16 S21 BT.

Descend 380 ft. over NE. slope.

31.40 Asphalt surfaced road, newly constructed at S. edge of valley bottom, 35 lks. wide, bears N. 65° W., and S. 65° E.; desc. 50 ft. over NE. slope.


32.00 Wire fence, bears N. 65° W. and S. 65° E.; enter open pasture.

36.40 Wire fence, bears NW. and SE., along road right of way.

36.70 Old asphalt surfaced road, 35 lks. wide, bears NW. and SE.; enter timber and undergrowth.

37.22 Point for the witness cor. to the meander cor. of secs. 21 and 22 on the left bank of the Umpqua River.

Set an iron post, 28 ins. long 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

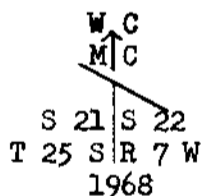

from which

A twin ash, 32 ins. diam., bears S. 66½° E., 34 lks. dist., mkd. X at breast height and BT at base.

A cottonwood, 37 ins. diam., bears N. 23 3/4° W., 93 lks. dist., mkd. X at breast height and BT at base.

Descend 5 ft. over NE. slope.

38.80 True point for the meander cor. of secs. 21 and 22 at proportionate distance; there is no remaining evidence of the original corner. It is impracticable to establish a permanent monument at this point. Thence across river.

39.90 True point for the ¼ sec. cor. of secs. 21 and 22, at proportionate distance, falls in the Umpqua River where it is impracticable to establish a permanent monument.