

County Surveyor's Record, Douglas County, Oregon

1-363

Dependent Resurvey, Portion of Subdivisional Lines, T. 25 S., R. 7 W.

CHAINS

46.12


True point for the meander cor. of secs. 21 and 22, at proportionate distance; there is no remaining evidence of the original corner. It is impracticable to establish a permanent monument at this point.

Ascend 25 ft. over river bank.

49.00

Point for the witness cor. to the meander cor. of secs. 21 and 22 on the right bank of the Umpqua River which bears NW. and SE.

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

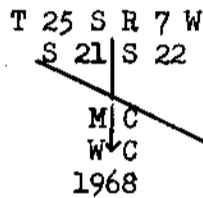

from which

a fir, 14 ins. diam., bears S. $37\frac{3}{4}^\circ$ E., 99 lks. dist., mkd. X at breast height and BT at base.

A twin maple, 13 ins. diam., bears S. $50\frac{3}{4}^\circ$ W., 12 lks. dist., mkd. X at breast height and BT at base.

Ascend 25 ft. over SW. slope.

52.20

Asphalt surface road at N. edge of valley, 35 lks. wide bears NW. and SE.; asc. 220 ft. over SW. slope, across recent burned area.

59.10

Dirt road, 20 lks. wide, bears E. and W.

62.20

Ravine, drains S. 20° W.; asc. 520 ft. over general S. slope.


79.00

Dirt road, 10 lks. wide, bears NW. curving to N. and SE. curving to E.; enter green timber.

79.80

The cor. of secs. 15, 16, 21, and 22, at proportionate distance; there is no remaining evidence of the original corner.

Set an iron post, 28 ins. long $2\frac{1}{2}$ ins. diam., 24 ins. in the ground, with brass cap mkd.

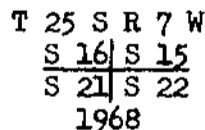

from which

A fir, 13 ins. diam., bears N. $77\frac{1}{2}^\circ$ E., $22\frac{1}{2}$ lks. dist., mkd. T25S R7W S15 BT.

A fir, 8 ins. diam., bears S. 32° E., 9 lks. dist., mkd. T25S R7W S22 BT.

A fir, 10 ins. diam., bears S. 12° W., 30 lks. dist., mkd. T25S R7W S21 BT.

A fir, 15 ins. diam., bears N. $2\frac{3}{4}^\circ$ W., $75\frac{1}{2}$ lks. dist., mkd. T25S R7W S16 BT.