

County Surveyor's Record, Douglas County, Oregon

Corrective Dependent Resurvey of a Portion
of the West Boundary,
T. 23 S., R. 7 W., Willamette Meridian, Oregon


16582

CHAINS

(Restoring the survey by Thomas H. Hutchinson and Ambrose N. Armstrong, U.S. Deputy Surveyors, in 1857-58, and correcting the resurvey by Floyd A. Brooks and Peter A. Peterson, Cadastral Surveyors, in 1964.)

Beginning at the 1/4 sec. cor. of secs. 19 and 24, perpetuated and recorded by James W. Byron, Deputy County Surveyor, in 1960, monumented with an iron post, 1 in. diam., firmly set, projecting 16 ins. above ground, with brass cap mkd.

COUNTY SURVEYOR'S OFFICE
T 23 S

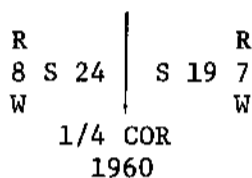

from which the remains of the original bearing trees

A fir, 38 ins. diam., bears N. 3° E., 36 lks. dist., with healed blaze.

A sawed fir stump, 28 ins. diam., bears N. 70° W., 26 lks. dist., with fragmentary scribe marks visible on open blaze.

and a bearing tree mkd. by Byron

A fir, 15 ins. diam., bears S. 80° W., 80 lks. dist., with healed blaze.

N. 0° 31' E., bet. secs. 19 and 24, marking and blazing the true line.

Descend 280 ft. over NE. slope.

10.25 Ravine, drains N. 35° W.; asc. 15 ft. over SW. slope.


18.00 Spur, slopes W.; desc. 10 ft. over NW. slope.

20.46 Point for the N. 1/16 sec. cor. of secs. 19 and 24.

From this point, the N. 1/16 sec. cor. of secs. 19 and 24, erroneously positioned by Brooks and Peterson in 1964, bears S. 0° 01' E., 2.49 chs. dist., monumented with an iron post, 2 1/2 ins. diam., firmly set, projecting 6 ins. above ground, with brass cap mkd. and witnessed as described in the official record.

Remove the iron post, destroy the marks on the bearing trees, and at the true corner point

Reset the iron post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with brass cap mkd.

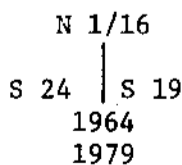

from which new bearing trees

A fir, 8 ins. diam., bears S. 22 3/4° E., 47 lks. dist., mkd. N 1/16 S19 BT.