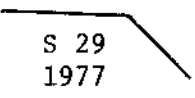


County Surveyor's Record, Douglas County, Oregon

16625

Dependent Resurvey of a Portion of the Claim Lines,
T. 33 S., R. 5 W., Willamette Meridian, Oregon

16625

CHAINS	
1.00	Leave slide area, enter young timber and dense undergrowth, edge bears NE. and SW.
13.12	Intersect the line bet. secs. 29 and 30. The crossing closing cor. of secs. 29 and 30 with line 5-6 of William Ruble Placer, hereinbefore described. From this point, the cor. of secs. 19, 20, 29, and 30, bears N. 0° 08' E., 9.07 chs. dist., hereinbefore described. Ascend slightly along N. slope.
13.20	Top of bank, edge bears N. and S.; desc. 20 ft. along N. slope, across slide area.
14.72	Point for cor. No. 6 William Ruble Placer, Mineral Survey 233, determined by the grant boundary method; there is no remaining evidence of the original corner. Set an iron post, 28 ins. long, 2 1/2 ins. diam., 18 ins. in the ground, to solid rock, in a mound of stone, 2 ft. base, to top, with brass cap mkd. <div style="text-align: center;"> <p>MS 233 WR 6</p>  </div> <p>from which</p> <p style="margin-left: 40px;">A cottonwood, 5 ins. diam., bears N. 65 3/4° W., 35 1/2 lks. dist., mkd. MS 233 WR6 BT.</p> <p style="margin-left: 40px;">An alder, 7 ins. diam., bears S. 22 1/2° W., 72 1/2 lks. dist., mkd. T33S R5W S29 BT.</p> <p>Corner is located at edge of slide area, bears NW. and SE.</p> <p>From this point, a corner established and recorded by H. W. Lawrence, Registered Engineer No. 1543, in 1964, bears S. 26° 23' W., 0.67 chs. dist., monumented with a galvanized iron pipe, 3/4 ins. diam., firmly set, projecting 2 ins. above ground, with lead cap mkd. WR6 1543, from which a bearing tree mkd. by Lawrence:</p> <p style="margin-left: 40px;">A fir, 14 ins. diam., bears S. 12 3/4° W., 86 lks. dist., with scribe marks WR6 BT 1543 visible on bark.</p>
24.25	S. 53° 30' E., on line 6-7 of William Ruble Placer, Mineral Survey No. 233. Ascend 10 ft. along broken NE. slope, across old logged area, through young timber and dense undergrowth.
24.25	Miller Gulch, 2 lks. wide, course NE.; asc. 10 ft. along broken N. slope.
33.01	Point for Cor. No. 7, William Ruble Placer, Mineral Survey No. 233, identical with cor. No. 1, Ruth Ruble Placer, Mineral Survey No. 234, determined by the grant boundary method; there is no remaining evidence of the original corner. No permanent monument established.