

County Surveyor's Record, Douglas County, Oregon

16930

Subdivision of Section 7,
T. 27 S., R. 2 W., Willamette Meridian, Oregon

CHAINS

From which the remains of the original bearing trees

A fir snag, 22ins. diam., bears N. 20 1/2° E., 25 lks. dist., with healed blaze.

A fir, 26 ins. diam., bears S. 31° E., 42 lks. dist., with scribe mark 8 visible on opened blaze.

and bearing trees mkd. by Powell

A fir, 28 ins. diam., bears N. 57° W., 51 lks. dist., with healed blaze.

A fir, 20 ins. diam., bears N. 9° W., 51 lks. dist., with healed blaze.

N. 3° 13' E., on the N. and S. center line of sec. 7.

Ascend 85 ft. over SW. slope, through heavy timber and dense undergrowth.

4.65 Spur, slopes N. 50° W.; desc. 340 ft. over NE. slope.


17.95 Left bank of Little River, bears N. 75° W. and S. 75° E., course N. 75° W.

19.00 Right bank of Little River, bears N. 75° W. and S. 75° E.; asc. 25 ft. over broken S. slope.

20.80 Point for the center S 1/16 sec. cor. of sec. 7.

Set an iron post, 28 ins. long, 2 1/2 ins. diam., 22 ins. in the ground, with brass cap mkd.

*FD OK PER DEGROOT
M109-79 A-90*

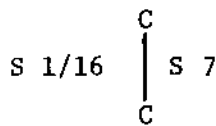

1979

from which

A fir, 12 ins. diam., bears N. 14 1/2° E., 9 1/2 lks. dist., mkd. C S 1/16 S7 BT.

A fir, 13 ins. diam., bears S. 43 1/2° W., 13 lks. dist., mkd. C S 1/16 S7 BT.

Ascend 180 ft. over broken S. slope.

21.50 Little River Road, asphalt surface, 40 lks. wide, bears N. 80° E. and S. 80° W.

22.35 Power line, bears N. 80° E. and S. 80° W.

25.20 Wire fence, extends N. 45° E. and S. 45° W.

25.70 Wire fence, extends N. 45° W. and S. 45° E.

26.35 Gravel road, 15 lks. wide, bears N. 50° W. and S. 50° E.

40.05 Spur, slopes S. 55° W.; desc. 15 ft. over NW. slope.

41.25 Ravine, drains S. 55° W.; asc. 10 ft. over SE. slope.