

County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey, Portion of Subdivisional Lines,
T. 21 S., R. 12 W., Willamette Meridian, Oregon

17196

CHAINS

from which the remains of the original bearing trees

A decayed spruce stump, 24 ins. diam., bears S. 24° E., 38 lks. dist., with a down spruce alongside, with scribe marks BT visible on partially open blaze.

A root hole, bears S. 14° W., 23 lks. dist.

A root hole, bears N. 50° W., 2 lks. dist., with a down spruce alongside, 14 ins. diam., no marks visible.

and bearing trees mkd. by Goodwin

A fir, 15 ins. diam., bears N. 28 1/4° E., 35 lks. dist., with healed blaze.

A fir, 11 ins. diam., bears N. 83° E., 36 lks. dist., with healed blaze.

A fir, 12 ins. diam., bears S. 56 1/4° W., 9 lks. dist., with illegible scribe marks visible on partially healed blaze.

and a new bearing tree

A fir, 5 ins. diam., bears S. 31° E., 6 1/2 lks. dist., mkd. X BT.

South, bet. secs. 16 and 17.

Ascend 20 ft. over NW. slope, through moderate timber and dense undergrowth.

4.40 Spur, slopes W.; desc. 75 ft. over SW. slope.

9.00 Bottom of descent, slopes W.; asc. 175 ft. along broken W. slope.

17.00 Spur, slopes SW.; desc. 50 ft. over SW. slope.


21.65 Draw, drains N. 80° W.; asc. 35 ft. over N. slope.

23.25 Ridge, bears N. 85° E. and S. 85° W.; desc. 225 ft. over broken S. slope.

24.35 Top of cliff, 75 ft. high, bears N. 60° E. and S. 60° W.

25.86 Point selected for the witness cor. to the meander cor. of secs. 16 and 17, on the right bank of the Umpqua River.

Set a brass tablet, 3 1/4 ins. diam., 3 1/2 in. stem, in drill hole, in base of a sandstone cliff, with top mkd.

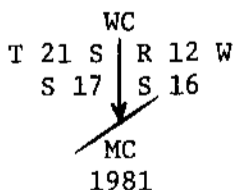

from which

An XBO, chiseled on sandstone cliff, 75 ft. high, bears N. 58° E., 17 lks. dist.

An XBO, chiseled on sandstone cliff, 75 ft. high, bears S. 83° W., 8 1/2 lks. dist.