

County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey, Portion of Subdivisional Lines, **17322**
T. 21 S., R. 5 W., Willamette Meridian, Oregon

CHAINS

- 24.10 Power line, bears N. 65° E. and S. 65° W.
- 24.90 Fitch Creek, 8 lks. wide, course SE.; asc. 5 ft. over S. slope.
- 25.75 Spur, slopes W.; desc. 5 ft. over N. slope.
- 25.90 Creek, 3 lks. wide, course S. 70° W.; asc. 185 ft. over SW. slope.
- 36.50 Woven wire fence, extends E. and W.
- 39.54 The 1/4 sec. cor. of secs. 29 and 30, perpetuated and recorded by Arthur R. Evans, Registered Engineer, No. 2741, in 1952, and further perpetuated and recorded by Milo E. Godfrey, Deputy County Surveyor, in 1964, monumented with an iron pipe, 1/2 in. diam., firmly set, projecting 4 ins. above ground, from which the remains of an original bearing tree

A sawed fir stump, 80 ins. diam., bears N. 56° E.,
31 lks. dist., with axe marks visible on bark.

and the remains of bearing trees mkd. by Evans

A madrone, 12 ins. diam., bears S. 54° E.,
36 lks. dist., with healed double blaze.

A sawed fir stump, 54 ins. diam., bears N. 13° W.,
103 lks. dist., with scribe marks RE 27 1/4 S30 BT
visible on bark blaze.


and a bearing tree mkd. by Godfrey

A fir, 14 ins. diam., bears N. 39 3/4° W.,
277 lks. dist., with healed double blaze.

At the corner point.

Set an iron post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with brass cap mkd.

FD OK
3-91 M III-71

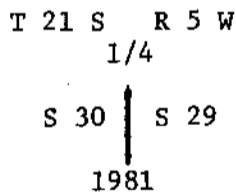

Reset the iron pipe alongside the iron post.

The corner is located at intersection of wire fences, extending generally N., S., and E.

Land, mountainous.
Soil, clay loam.
Timber, fir, ash, maple, oak, yew, cedar, pine, hemlock, madrone, and cherry; undergrowth, poison oak, vine maple, manzanita, arrowwood, hazel, blackberry, salmonberry, Oregon grape, thimbleberry, wild rose, ferns, and young timber.

Subdivision of Section 29,
T. 21 S., R. 5 W., Willamette Meridian, Oregon

From the 1/4 sec. cor. of secs. 29 and 32.