

County Surveyor's Record, Douglas County, Oregon

17403


Subdivision of Section 23,
T. 28 S., R. 8 W., Willamette Meridian, Oregon

CHAINS

20.74

Intersect the S. bdy. of Donation Land Claim No. 40;
point for the crossing closing cor.

Set an iron post, 28 ins. long, 2 1/2 ins. diam., 24 ins.
in the ground, with brass cap mkd.

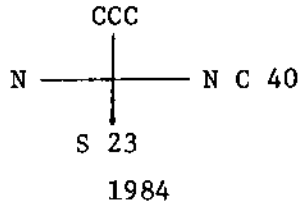

from which

A fir, 7 ins. diam., bears S. 30 1/2° W., 34 lks.
dist., mkd. X BT.

A fir, 7 ins. diam., bears N. 65° W., 25 lks. dist.,
mkd. T28S R8W S23 CCC BT.

From this point, the exterior cor. on the S. bdy. of
Donation Land Claim No. 40, bears S. 0° 42' W., 0.03 chs.
dist.

31.90

Spur, slopes N. 30° E.; desc. over NW. slope.

37.35

Ravine, drains N. 30° E.; asc. over NE. slope.

40.15

The N 1/16 sec. cor. of secs. 22 and 23.

GENERAL DESCRIPTION

The lands included in this resurvey are located in
Douglas County, approximately 4 miles northwesterly from
the town of Tenmile, Oregon.

The area is drained by Tenmile Creek, with numerous
small and seasonal drainages flowing into it. The
elevations range from about 2,000 feet above sea level
near the 1/4 section corner of sections 20 and 21, down to
about 800 feet above sea level at the 1/4 section corner of
sections 23 and 24. Access into the area is via paved
county roads with gravelled and dirt roads branching from
them into the area.

The soil is composed of rocky clay, with some
exposed rock outcroppings in the higher elevations and
clay loam in the creek bottoms. The timber consists of
fir, hemlock, cedar, pine, yew, maple, chinquapin, oak,
walnut, ash, madrone, myrtle, alder, and cottonwood, with
undergrowth of salal, fern, poison oak, vine maple,
Oregon grape, hazel, rhododendron, arrowwood, blackberry,
salmonberry, huckleberry, wild rose, and young timber.

No evidence of mineral activity was noted in the
course of the resurvey.

The average of a number of readings over the area
gives a value of 19° 30' E., for the mean magnetic
declination. There is a range of 3/4° due to local
attraction.