

# County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey, Portion of Subdivisional Lines, 17434  
T. 26 S., R. 3 W., Willamette Meridian, Oregon

**CHAINS**

A root hole, bears N. 11° E., 2 1/2 lks. dist., with down fir alongside, 14 ins. diam., with scribe mark B visible on decayed blaze.

A sawed fir stump, 24 ins. diam., bears S. 34° E., 34 lks. dist., with healed blaze.

A fir snag, 14 ins. diam., bears S. 72° W., 29 lks. dist., no marks visible.

A fir snag, 14 ins. diam., bears N. 36° W., 12 lks. dist., with scribe marks BT visible on open blaze.

and the remains of bearing trees mkd. by Corbin

A fir, 24 ins. diam., bears N. 51 1/2° E., 63 lks. dist., with healed blaze.  
(Record, 66 lks.)

A cedar, 22 ins. diam., bears S. 73 1/4° E., 84 lks. dist., with healed blaze.  
(Record, S. 73 1/4° W., 86 lks.)

A root hole, bears S. 30 1/4° W., 61 lks. dist., with a down fir alongside, 20 ins. diam., no marks visible.

A root hole, bears N. 34° W., 59 lks. dist., with a down fir alongside, 12 ins. diam., no marks visible.

and a bearing tree mkd. by Vernon R. Tracy, Deputy County Surveyor, in 1966

A cedar, 22 ins. diam., bears N. 48° W., 38 lks. dist., with healed blaze.

and a new bearing tree

A cedar, 20 ins. diam., bears S. 61 3/4° W., 25 1/2 lks. dist., mkd. T27S R3W S2 BT.

N. 1° 36' W., bet. secs. 35 and 36, marking and blazing the true line.


Ascend 255 ft. over broken SW. slope, through heavy timber and dense undergrowth.

3.60 End of dirt road, 20 lks. wide, bears N. 30° W.

17.30 Gravelled road, 25 lks. wide, bears N. 50° W. and S. 50° E.

19.79 Point for the S 1/16 sec. cor. of secs. 35 and 36.

Set an iron post, 28 ins. long, 2 1/2 ins. diam., 22 ins. in the ground, with brass cap mkd.

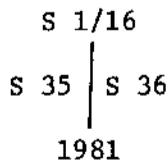

from which