

County Surveyor's Record, Douglas County, Oregon

17497

Subdivision of Section 20,
T. 31 S., R. 5 W., Willamette Meridian, Oregon

CHAINS

A cedar, 12 ins. diam., bears S. 21° E.,
30 lks. dist., mkd. C1/4 S20 BT.

A fir, 8 ins. diam., bears S. 4 1/2° E.,
16 1/2 lks. dist., mkd. C1/4 S20 BT.


Ascend broken SW. slope.

41.65 Dirt road, 20 lks. wide, bears N. 25° E. and N. 80° W.,
in a curve.

50.80 Spur, slopes S. 80° W.; desc. NW. slope.

59.82 Point for the center N 1/16 sec. cor. of sec. 20.

Set an aluminum post, 28 ins. long, 2 1/2 ins. diam.,
23 ins. in ground, with aluminum cap mkd.

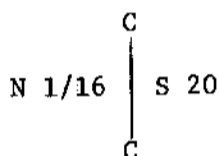

1983

from which

A fir, 18 ins. diam., bears S. 73 1/2° E.,
51 lks. dist., mkd. CN 1/16 S20 BT.

A fir, 20 ins. diam., bears N. 82° W.,
41 lks. dist., mkd. CN 1/16 S20 BT.

Descend NW. slope.

64.60 Creek, 10 lks. wide, course S. 50° W.; asc. SE. slope.

79.76 The 1/4 sec. cor. of secs. 17 and 20.

From the 1/4 sec. cor. of secs. 20 and 21.

S. 89° 30' W., on the E. and W. center line of sec. 20.

Ascend broken SE. slope, through heavy timber and dense
undergrowth.

38.70 Spur, slopes S. 10° W.; desc. broken SW. slope.

39.66 The center 1/4 sec. cor. of sec. 20.

Descend broken SW. slope, changing to NW. slope.

48.55 Dirt road, 20 lks. wide, bears N. 60° E. and S. 60° W.

50.20 Same road, bears N. 35° W. and S. 55° E.

54.85 Same road, bears N. 50° E. and S. 55° W.

57.90 Same road, bears N. 40° W. and S. 40° E.

70.60 Creek, 5 lks. wide, course S. 30° W.; asc. SE. slope.

71.60 Dirt road, 15 lks. wide, bears N. 40° E. and S. 40° W.

76.20 Spur, slopes S. 5° E.; desc. SW. slope.