

# County Surveyor's Record, Douglas County, Oregon

Dependent Resurvey, Portion of the Subdivisional Lines, **17544**  
T. 23 S., R. 4 W., Willamette Meridian, Oregon

**CHAINS**

- Descend over NW. slope.
- 1.30 Ravine, drains N. 30° E.; asc. over NE. slope.
- 7.55 Ridge, bears N. and S. 10° W.; desc. over NW. slope.
- 15.65 Ravine, drains N. 10° W.; asc. over NE. slope.
- 19.83 The 1/4 sec. cor. of secs. 14 and 23, monumented with an iron post, 2 1/2 ins. diam., firmly set, projecting 2 ins. above ground, with brass cap mkd.

*FIND OK  
6-91 D. PEEL  
M 113-42*

1/4  $\frac{S\ 14}{S\ 23}$   
T 23 S R 4 W  
1976

from which the bearing trees mkd. by Jelley

A fir, 7 ins. diam., bears N. 67 1/2° E., 70 lks. dist., with healed blaze.


A fir, 20 ins. diam., bears S. 53 1/4° E., 58 lks. dist., with fragmentary scribe marks visible on partially healed blaze.

Land, mountainous.  
Soil, rocky clay.

Timber, fir, cedar, hemlock, yew, maple, alder, madrone, ash, and chinquapin; undergrowth, poison oak, vine maple, arrowwood, hazel, blackberry, huckleberry, Oregon grape, salal, fern, wild rose, and young timber.

Subdivision of Section 14,  
T. 23 S., R. 4 W., Willamette Meridian, Oregon

- From the 1/4 sec. cor. of secs. 14 and 23.
- N. 0° 19' E., on the N. and S. center line of sec. 14.
- Descend over NE. slope, through heavy timber and dense undergrowth.
- 7.45 Creek, 2 lks. wide, course N. 50° W.; asc. over broken SW. slope.
- 17.70 Spur, slopes N. 50° W.; desc. over NW. slope.
- 19.94 Point for the center S 1/16 sec. cor. of sec. 14.
- Set an aluminum post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with aluminum cap mkd.

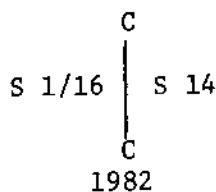

from which