

County Surveyor's Record, Douglas County, Oregon

Subdivision of Section 33,
T. 22 S., R. 5 W., Willamette Meridian, Oregon **17686**

CHAINS


From this same point, the standard 1/4 sec. cor. of sec. 4, T. 23 S., R. 5 W., bears S. 89° 54' E., 4.87 chs. dist., described in the field notes of the dependent resurvey of a portion of the N. bdy., T. 23 S., R. 5 W. (Fifth Standard Parallel South), executed concurrently under this same Group.

N. 0° 07' E., on the N. and S. center line of sec. 33.

Descend over NE. slope, through heavy timber and dense undergrowth.

- 0.25 Creek, 2 lks. wide, course N. 80° E.; desc. over NE. slope.
- 2.55 Creek, 5 lks. wide, course S. 60° E.; asc. over SW. slope.
- 4.65 Spur, slopes S. 70° W.; desc. over NW. slope.
- 6.05 Ravine, drains S. 50° W.; asc. over SW. slope.
- 19.885 Point for the center S 1/16 sec. cor. of sec. 33.

Set an aluminum post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with aluminum cap mkd.

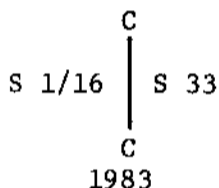

from which

A fir, 24 ins. diam., bears S. 63° E., 74 lks. dist., mkd. CS 1/16 S33 BT.

A fir, 8 ins. diam., bears N. 47 1/2° W., 106 lks. dist., mkd. CS 1/16 S33 BT.

From this point, a locally established point, bears S. 13° 45' E., 0.341 chs. dist., monumented with an iron rod, 1/2 in. diam., firmly set, projecting 10 ins. above ground, from which bearing trees mkd. by person(s) unknown

A fir, 12 ins. diam., bears S. 65° E., 24 lks. dist., with healed double blaze.

A fir, 19 ins. diam., bears N. 24° W., 89 lks. dist., with healed double blaze.

SEE HAINES
F.B. #110
H. EN. 3

Ascend over SW. slope.

- 26.60 Ridge, bears N. 50° W. and S. 50° E.; desc. over broken NE. slope.
 - 34.80 Gravelled road, 25 lks. wide, bears N. 50° W. and S. 45° E.
 - 39.77 Point for the center 1/4 sec. cor. of sec. 33, at intersection with the E. and W. center line.
- Set an aluminum post, 28 ins. long, 2 1/2 ins. diam., 26 ins. in the ground, with aluminum cap mkd.