

County Surveyor's Record, Douglas County, Oregon


Corrective Dependent Resurvey
 Portion of the Subdivisional Lines,
 T. 22 S., R. 9 W., Willamette Meridian, Oregon

17021

CHAINS

Remove the iron post, destroy the marks on the bearing trees, and at the true corner point

Reset the iron post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

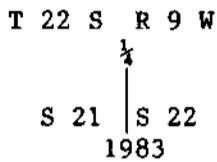

from which

A fir, 11 ins. diam. bears N. 87° E.,
 39 lks. dist., mkd. ¼ S22 BT.

A fir, 20 ins. diam., bears S. 36° W.,
 29 lks. dist., mkd. ¼ S 21 BT.

Deposit corner stone and iron pipe alongside the iron post.

N. 0° 26' W., beginning new measurement.

Descend over NW. slope.

5.50 Creek, 4 lks. wide, course N. 60° E.; asc. over SE. slope.


10.50 Creek, 2 lks. wide, course S. 30° E.; asc. over SW. slope.

19.135 Point for the N 1/16 sec. cor. of secs. 21 and 22

From this point the N 1/16 sec. cor. of secs. 21 and 22, erroneously established by Wofford, Rogers, and Chatters, in 1973-79, bears S. 20° 53' W., 0.525 chs. dist., monumented with an iron post, 2½ ins. diam., firmly set, projecting 4 ins. above ground, with brass cap mkd. and witnessed as described in the official record.

Remove the iron post, destroy the marks on the SW. bearing tree, and at the true corner point

Reset the iron post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, with brass cap mkd.

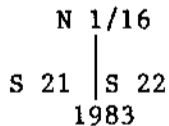

from which a bearing tree mkd. by Wofford, Rogers, and Chatters

A fir, 25 ins. diam., bears S. 21° E.,
 62 lks. dist., mkd. N 1/16 S22 BT.

and a new bearing tree

A fir, 22 ins. diam., bears N. 58 ¼° W.,
 19½ lks. dist., mkd. N 1/16 S21 BT.

Continue ascent over SW slope.