

County Surveyor's Record, Douglas County, Oregon

Subdivision of Section 11,
T. 27 S., R. 3 W., Willamette Meridian, Oregon

17969

CHAINS

20.21

The center $\frac{1}{4}$ sec. cor. of sec. 11.

S. 89° 23' W., beginning new measurement.

Ascend over broken SE. slope.


17.40

Gravelled road, 20 lks. wide, bears N. 15° E. and S. 10° W.

20.63

Point for the center W 1/16 sec. cor. of secs. 11.

Set an iron post, 28 ins. long, 2½ ins. diam., 22 ins. in the ground, with brass cap mkd.

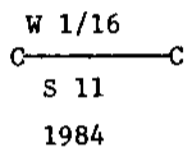

from which

A yew, 10 ins. diam., bears S. 1° W., 56 lks. dist., mkd. CW 1/16 S11 BT.

A white fir, 15 ins. diam., bears N. 18½° W., 63 lks. dist., mkd. CW 1/16 S11 BT.

Ascend over broken SE. slope.

28.45


Ridge, bears N. 45° E. and S. 60° W.; desc. over broken NW. slope.

40.10

Dirt road, 20 lks. wide, bears N. 45° E. and S. 45° W.

41.26

The $\frac{1}{4}$ sec. cor. of secs. 10 and 11, monumented with an iron post, 2½ ins. diam., firmly set, projecting 6 ins. above ground, with brass cap mkd.

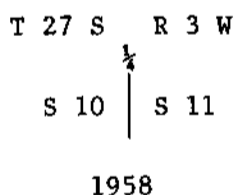

from which the remains of bearing trees mkd. by Corbin

A fir, 15 ins. diam., bears N. 59 3/4° E., 44 lks. dist., with healed blaze.

A fir stump, 13 ins. diam., bears S. 52° W., 66 lks. dist., with healed blaze.

and a new bearing tree

A fir, 9 ins. diam., bears S. 50 3/4° W., 74 lks. dist., mkd. $\frac{1}{4}$ S10 BT.

From the E 1/16 sec. cor. of secs. 11 and 14.

N. 1° 44' E., on the N. and S. center line of the SE $\frac{1}{4}$ of sec. 11.

Ascend over SW. slope.