

County Surveyor's Record, Douglas County, Oregon

Subdivision of Section 7,
T. 28 S., R. 4 W., Willamette Meridian, Oregon

17991

CHAINS

from which

A fir, 16 ins. diam., bears S. $32\frac{1}{4}^{\circ}$ E.,
127 lks. dist., mkd. CE 1/16 S7 BT.

A cedar, 12 ins. diam., bears N. $59\frac{1}{2}^{\circ}$ W.,
169 lks. dist., mkd. CE 1/16 S7 BT.

Descend over SW. slope.

21.55 Ravine, drains N. 55° W.; asc. over broken NE. slope.

34.30 Powerline, 2 wire service line, bears N. 60° E. and
S. 60° W.

39.92 The center $\frac{1}{4}$ sec. cor. of sec. 7.

Ascend over broken NE. slope.

43.10 Spur, slopes S. 55° E. to saddle; desc. over broken
SW. slope.

73.85 Creek, 3 lks. wide, course N. 60° W.; continue along creek
bottom.


77.15 Powerline, 3 wire transmission line, bears N. 20° W.
and S. 20° E.

78.25 Creek, 3 lks. wide, course S. 75° W.; continue along
creek bottom

79.72 True point for the $\frac{1}{4}$ sec. cor. of secs. 7 and 12, on
the W. bdy. of the Tp., reestablished and recorded by
James W. Byron, Deputy County Surveyor, in 1957, and is
accepted as the best available evidence of the position
of the original corner. The corner is located in a
creek, where it is impracticable to establish a
permanent monument.

From the point, the witness cor. to the $\frac{1}{4}$ sec. cor. of
secs. 7 and 12, established by Byron, bears North,
0.152 chs. dist., monumented with an iron post, $1\frac{1}{4}$ ins.
diam., firmly set, projecting 10 ins. above ground,
with brass cap mkd.

COUNTY SURVEYORS OFFICE

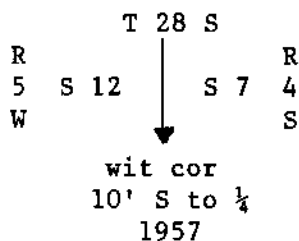

from which bearing trees mkd. by Byron

An oak, 14 ins. diam., bears S. 31° E.,
76 lks. dist., with healed double balze.

A maple, 16 ins. diam., bears N. 67° W.,
48 lks. dist., with healed double blaze.