


County Surveyor's Record, Douglas County, Oregon

18004

Subdivision of Section 10,
T. 20 S., R. 9 W., Willamette Meridian, Oregon

CHAINS

- N. 89° 49' W., on the E. and W. center line of sec. 10.
- Ascend over broken SE. slope, through recently logged area.
- 7.35 Enter timber, edge bears N. and S.
- 9.40 Spur, slopes S. 25° E.; desc. over broken SW. slope, changing to NW. slope.
- 17.50 Gravelled road, 20 lks. wide, bears N. 10° E. and S. 30° W., incurve.
- 39.74 The center 1/4 sec. cor. of sec. 10.
- Continue descent over NW. slope.
- 40.75 Creek, 2 lks. wide, course S. 50° W.; asc. over SE. slope.
- 41.15 Small spur, slopes S. 20° W.; desc. over NW. slope.
- 42.75 Creek, 13 lks. wide, course S. 35° E.; asc. over NE. slope.
- 44.20 Gravelled road, 20 lks. wide, bears N. 40° W. and S. 40° E.
- 50.75 Spur, slopes N. 10° E.; desc. over NW. slope.
- 57.25 Ravine, drains N. 60° E., also leave timber, edge bears W. and SW., enter logged area; asc. over SE. slope, along S. edge of timber.
- 74.05 Spur, slopes N. 35° E.; desc. over broken NW. slope.
- 79.72 The 1/4 sec. cor. of sec. 10 only, perpetuated and recorded by Gary Langlitz, Deputy County Surveyor, in 1974, monumented with an iron post, 1 in. diam., firmly set projecting 8 ins. above ground (alongside of which is the remains of the original iron post, 1 in. diam., firmly set, projecting 4 ins. above ground), with brass cap mkd.

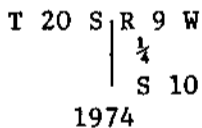

from which the original bearing trees

An alder, 20 ins. diam., bears N. 80° E., 9 lks. dist., with scribe marks BT visible on bark.

An alder, 19 ins. diam., bears S. 19½° W., 38 lks. dist., with illegible scribe marks visible on bark. (Record, S. 22° E.)

Subdivision of Section 22,
T. 20 S., R. 9 W., Willamette Meridian, Oregon

From the 1/4 sec. cor. of secs. 22 and 27, monumented with an iron post, 1 in. diam., firmly set, projecting 8 ins. above ground, with bras cap mkd.