

ORIGINAL

**UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT**

FIELD NOTES
OF THE
DEPENDENT RESURVEY OF PORTIONS OF THE SOUTH BOUNDARY
AND SUBDIVISIONAL LINES,
TOWNSHIP 30 SOUTH, RANGE 8 WEST,
OF THE WILLAMETTE MERIDIAN,
IN THE STATE OF OREGON

EXECUTED BY

Jeffrey O. Covington, Cadastral Surveyor

Under Special Instructions approved April 24, 2020,
which provided for the surveys included under Group No. 2972,
and Assignment Instructions dated April 24, 2020.

Survey commenced May 12, 2020

Survey completed February 25, 2021

T. 30 S., R. 8 W., Willamette Meridian, Oregon

FEET

The following field notes are those of the dependent resurvey of a portion of the west boundary and subdivisional lines, Township 30 South, Range 8 West, Willamette Meridian, Oregon.

The history of the official surveys pertaining to this survey is as follows:

In 1882, William H. Byars, U.S. Deputy Surveyor, surveyed the south boundary and subdivisional lines, as shown on the official plat of survey approved July 28, 1883, and accepted October 20, 1883.

In 1960-62, C. Albert White and Harold D. Corbin, Cadastral Surveyors, resurveyed a portion of the north boundary of T. 31 S., R. 8 W. as shown on the official plat of survey accepted August 18, 1964.

In 1963-64, Donald R. Beck and C. Albert White, Cadastral Surveyors, dependently resurveyed a portion of the subdivisional lines and remonumented certain original corner points, as shown on the official plat of survey accepted August 20, 1965.

In 1972, Charles E. Akin, Jr., Cadastral Surveyor, dependently resurveyed portions of the south boundary and subdivisional lines, as shown on the official plat of survey accepted June 21, 1977.

In 1975, G. Steven Popken and James J. Carlson, Cadastral Surveyors, dependently resurveyed a portion of the subdivisional lines, as shown on the official plat of survey accepted June 26, 1978.

In 1980, James E. Jelley and Wayne L. Rogers, Cadastral Surveyors, dependently resurveyed portions of the west boundary and subdivisional lines, and subdivided section 19, as shown on the official plat of survey accepted May 11, 1984.

In 1989-93, Dale T. Bedell and Bryan S. Seibold, Cadastral Surveyors, dependently resurveyed a portion of the subdivisional lines, as shown on the official plat of survey accepted August 3, 1993.

In 2006-07, A. Bert Skeesick, Cadastral Surveyor, retraced a portion of the subdivisional lines, as shown on the official plat of survey accepted April 22, 2011.

In March of 2008, Kenneth W. Saveland, Cadastral Surveyor, retraced a portion of the subdivisional lines and rehabilitated the 1/4 section corner of sections 15 and 16, as shown on the official plat of survey accepted September 30, 2009.

In June through July of 2008, Kenneth W. Saveland, Cadastral Surveyor, dependently resurveyed a portion of the subdivisional lines, as shown on the official plat of survey accepted May 4, 2010.

In 2013-14, George M. Winter, Cadastral Surveyor, dependently resurveyed a portion of the subdivisional lines, as shown on the official plat of survey accepted November 7, 2014.

T. 30 S., R. 8 W., Willamette Meridian, Oregon

FEET

The following local surveys filed in the Douglas County Surveyor's Office are referred to in subsequent corner descriptions and are referenced by surveyor's last name, Professional Land Surveyor (PLS) No., Professional Engineer (PE) No., or official title, and year.

Date	Name and Registration Number	File Number
8/1958	James W. Byron, Deputy County Surveyor	CS49/108
9/1958	James W. Byron, Deputy County Surveyor	CS49/108
9/16/1964	Douglas County Surveyor's Office	CS53/67-32
9/17/1964	Douglas County Surveyor's Office	CS53/67-34
4/1965	Douglas County Surveyor's Office	CS53/67-40
9/1965	Douglas County Surveyor's Office	CS53/67-10
1967	William C. Stiles, PLS No. 432	M34-19, CS55/44
1968	Douglas County Surveyor's Office	CS53/67-18
9/17/1969	Douglas County Surveyor's Office	CS53/67-3
9/17/1969	Douglas County Surveyor's Office	CS53/67-4
1970	Douglas County Surveyor's Office	CS53/67-5
1973	Ronald E. Stuntzner, PLS No. 3243	M48-29, CS55/287A-C
3/1973	Bruce A. Shaner, PE No. 4906	M49-16
6/1973	Bruce A. Shaner, PE No. 4906	M49-25
1974	Ronald E. Stuntzner, RE No. 6245	M53-9
1981	Douglas County Surveyor's Office	CS61/19-3
1996	Randall W. Smith, PLS No. 2469	CS65/9-31
1997	Wayne L. Rogers, PLS No. 2137	CS65/17-1
2014	David A. Edwards, PLS No. 2339	CS65/82-54
2015	Gerald V. Nygren, PLS No. 1035	M169-26

In an unknown year, person(s) unknown set steel fence posts for certain 1/16 section corner positions along portions of the subdivisional lines and bearing trees were selected and tagged, but not scribed, to reference the positions. Based on the marks found on the bearing tree tags referencing the steel fence posts, the Federal Highway Administration (FHWA) may have conducted an administrative survey in the area. No record of the survey was discovered. The steel fence posts were not used for control during this survey.

The survey was executed in accordance with the specifications set forth in the Manual of Surveying Instructions (2009), and the special instructions approved April 24, 2020, for Group No. 2972, Oregon.

The directions of the lines are based on the true meridian as determined by Global Positioning System (GPS) techniques and carried forward by sustained angulation using conventional survey techniques. All measurements along the lines were derived through the use of electronic measuring equipment. Measured distances and directions have been adjusted by computer software that incorporates a least squares adjustment routine. The adjusted mean bearings and mean horizontal ground elevation distances are reported to the nearest second and 0.01 foot.

Preliminary to the resurvey the lines of the official original surveys and resurveys were retraced and search was made for all corners, lines, other calls of the record, and, where available, collateral evidence of local surveys and corners. Identified corners were perpetuated in their original positions. The

T. 30 S., R. 8 W., Willamette Meridian, Oregon

FEET

retracement data was thoroughly verified and only the true line field notes are given herein.

Each new bearing tree has a 2 1/2 inch x 1/4 inch magnetic nail (Mag Nail) driven at the base on right side center and each monument established or reestablished has a magnet deposited in a white plastic case at the base of the stainless steel post, unless otherwise noted in the corner description. Aluminum angle irons, 5 ft. long, were driven alongside each monument unless a similar marker was already in place.

Only those lines bounding Federal interest land were blazed.

The geographic position in NAD 1983 (2011) of the following corners as determined by ties from temporary GPS control points, established utilizing dual frequency, carrier phase GPS receivers, and processed using the National Geodetic Survey's Online Positioning User Service (OPUS):

The corner of sections 26, 27, 34, and 35:

Latitude: 42° 55' 34.70" N. Longitude: 123° 37' 25.20" W.

The corner of sections 14, 15, 22, and 23:

Latitude: 42° 57' 18.01" N. Longitude: 123° 37' 23.67" W.

The corner of sections 28, 29, 32, and 33:

Latitude: 42° 55' 30.16" N. Longitude: 123° 39' 44.24" W.

The corner of sections 5, 6, 7, and 8:

Latitude: 42° 58' 54.83" N. Longitude: 123° 40' 54.07" W.

**Dependent Resurvey of a Portion of the South Boundary,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

Restoring the 1882 survey by Byars, the 1960-62 resurvey by White and Corbin, and the 1972 resurvey by Akin, Jr.

Beginning at the 1/4 sec. cor. of secs. 4 and 33, reported by Akin in 1972; perpetuated by Nygren, PLS No. 1035, in 2015; monumented with an iron post, 2 1/2 ins. diam., firmly set, projecting 7 ins. above ground, with a brass cap mkd.

T 30 S R 8 W
S 33
1/4 ———
S 4
T 31 S
1962

**Dependent Resurvey of a Portion of the South Boundary,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	
	from which the bearing tree reported by Akin, Jr. A fir, 30 ins. diam., bears N. 12° E., 13.9 ft. dist., with a healed blaze. (Original) and the remains of a bearing tree mkd. by Nygren A fir stump, 10 ins. diam., bears S. 39 1/4° W., 22.1 ft. dist., with scribe marks S4 and other illegible scribe marks visible on partially healed blaze. and a new bearing tree A cedar, 4 ins. diam., bears S. 82° E., 147.2 ft. dist., mkd. X BT. S. 88° 00' 15" W., bet. secs. 4 and 33. Ravine, drains S. 40° E.
60	
1309.56	The W 1/16 sec. cor. of secs. 4 and 33, established by Nygren, PLS No. 1035, in 2015; and is accepted as the cor.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 4 ins. above ground, with an aluminum cap mkd. T 30 S R 8 W S 33 W 1/16 ——— S 4 T 31 S LS 1035 2015 from which the bearing trees mkd. by Nygren A fir, 14 ins. diam., bears N. 53 1/2° E., 47.9 ft. dist., with scribe marks W1/16 S33 visible on partially healed blaze. A fir, 11 ins. diam., bears S. 43° W., 23.3 ft. dist., with illegible scribe marks visible on partially healed blaze. At the corner point Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, directly over iron rod, with brass cap mkd. S 33 W 1/16 ——— S 4 2020 Corner is located on top of large of spur, slopes S. S. 88° 05' 05" W., beginning new measurement.

**Dependent Resurvey of a Portion of the South Boundary,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	
1045	Creek, 2 ft. wide, course S. 35° E.
1308.90	The cor. of secs. 4, 5, 32, and 33, reported by White and Corbin in 1960-62; perpetuated by Nygren, PLS No. 1035, in 2015; monumented with an iron post, 2 1/2 ins. diam., firmly set, projecting 12 ins. above ground, in a mound of stone, 2 ft. base, 8 ins. high, with a brass cap mkd. T 30 S R 8 W S 32 S 33 S 5 S 4 T 31 S 1961 from which the remains of the bearing trees reported by White and Corbin A cedar, 18 ins. diam., bears S. 37 1/2° E., 48.2 ft. dist., with a healed blaze. A sugar pine snag, 10 ins. diam., bears S. 34° W., 8.5 ft. dist., with scribe marks T31S R8W S5 B visible on open blaze. (Original Record, S. 41° W., 5.9 ft. dist.) A cedar, 12 ins. diam., bears S. 77° W., 37.0 ft. dist., with a healed blaze. A decayed sugar pine stump, 60 ins. diam., bears N. 42° W., 26.4 ft. dist., with scribe marks T30S R8W S32 BT visible on open blaze. and the bearing trees mkd. by Nygren A cedar, 17 ins. diam., bears N. 24 3/4° E., 28.8 ft. dist., with scribe marks T30S R8W S33 BT visible on partially healed blaze. A fir, 11 ins. diam., bears N. 46 1/4° W., 59.9 ft. dist., with scribe marks T30S R8W S32 BT visible on partially healed blaze. Dependent Resurvey of a Portion of the Subdivisional Lines, T. 30 S., R. 8 W., Willamette Meridian, Oregon Restoring the 1882 survey by Byars; the 1963-64 resurvey and remonumentation by Beck and White; the 1972 Resurvey by Akin, Jr.; the 1975 resurvey by Popken and Carlson; the 1980 resurvey by Jelley and Rogers; the 1989-93 resurvey by Bedell and Seibold; the 2006-07 retracement by Skeesick; the 2008 retracement by Saveland; the 2008 resurvey by Saveland; and the 2013-14 resurvey by Winter. From the cor. of secs. 26, 27, 34, and 35, reported by Saveland in June through July of 2008, monumented with an iron post, 1 1/4 ins. diam., firmly set, projecting 5 ins. above ground, with a brass cap mkd.

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	COUNTY SURVEYORS OFFICE T 30 S S 27 S 26 — — S 34 S 35 R 8 W 1965 from which the remains of the bearing trees reported by Saveland - A roothole bears N. 42 3/4° E., 6.0 ft. dist., alongside of which is a down fir, size indeterminate, no marks visible. - A broken fir stump, 12 ins. diam., bears N. 70 1/2° E., 24.0 ft. dist., alongside of which is a down fir, 12 ins. diam., with scribe marks S26 BT and other illegible scribe marks visible on partially healed blaze. - A decayed fir stump, 38 ins. diam., bears S. 43 1/4° E., 81.9 ft. dist., no marks visible, and the head of a spike driven flush with top and in the center of the stump, mkd. BO 1. - A fir, 17 ins. diam., bears S. 37 1/2° E., 17.3 ft. dist., with a healed blaze. - A decayed fir stump, size indeterminate, bears S. 19 3/4° W., 20.6 ft. dist., with scribe marks T30S R W S visible on broken fragment lying alongside. - A fir, 21 ins. diam., bears S. 87 3/4° W., 54.6 ft. dist., with a healed blaze. - A fir, 10 ins. diam., bears N. 86 1/2° W., 21.2 ft. dist., with a healed blaze. - A decayed fir snag, 33 ins. diam., bears N. 44 1/2° W., 20.3 ft. dist., with a healed blaze. and a new bearing tree - A fir, 15 ins. diam., bears N. 57 3/4° E., 32.4 ft. dist., mkd. T30S R8W S26 BT. S. 86° 56' 24" W., bet. secs. 27 and 34. 2578.04 The 1/4 sec. cor. of secs. 27 and 34, reported by Saveland in June through July of 2008, monumented with an iron post, 1 1/4 ins. diam., firmly set, projecting 7 ins. above ground, with a brass cap mkd. COUNTY SURVEYORS OFFICE T 30 S S 27 1/4 ——— S 34 R 8 W 1965
------	---

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET

from which the remains of an original bearing tree

A roothole bears N. 24° W., 17.2 ft. dist., downhill of which is a down fir, 23 ins. diam., with a healed blaze.

and the remains of the bearing trees reported by Saveland

A fir, 7 ins. diam., bears N. 47 1/4° E., 12.9 ft. dist., with a healed blaze.

A roothole bears N. 48 1/2° E., 37.1 ft. dist., alongside of which is a down fir, 19 ins. diam., with a healed blaze.

A decayed pine snag, 15 ins. diam., bears S. 57 1/2° E., 10.7 ft. dist., with a healed blaze.

A fir, 7 ins. diam., bears S. 7° E., 4.5 ft. dist., with a healed blaze.

A roothole bears S. 25° W., 16.5 ft. dist., downhill of which is a down cedar, size indeterminate, with scribe marks BT visible on open blaze.
(Original)

From the 1/4 sec. cor. of secs. 27 and 28, reported by Winter in 2013-14, monumented with an iron post, 1 1/4 ins. diam., firmly set, projecting 14 ins. above ground, with a brass cap mkd., when read from N.

COUNTY SURVEYORS OFFICE

T 30 S
1/4 S 28 | S 27
R 8 W
1964

from which the remains of the bearing trees mkd. by Douglas County Surveyor's Office, September 16, 1964

A decayed fir stump, 36 ins. diam., bears S. 12 3/4° E., 43.8 ft. dist., with a healed blaze.

A broken, decayed fir stump, 38 ins. diam., bears N. 66 1/4° W., 32.2 ft. dist., with a healed blaze.

and the bearing trees reported by Winter

A fir, 15 ins. diam., bears N. 58 3/4° E., 21.4 ft. dist., with a healed blaze.
(Record, 23.4 ft. dist.)

A fir, 12 ins. diam., bears N. 42° W., 29.7 ft. dist., with a healed blaze.
(Record, 34.4 ft. dist.)

Corner is located N., 110 ft. dist., of a creek, 1 ft. wide, course N. 35° W.

N. 2° 12' 34" W., bet. secs. 27 and 28.

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	
90	Draw, drains S. 80° W.
1305	Draw, drains N. 60° W.
1316.62	The N 1/16 sec. cor. of secs. 27 and 28, established by Stuntzner, PLS No. 3243, in 1973; and is accepted as the cor.; as determined at record bearing and distance from the witness cor. established by Stuntzner. At the corner point Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with brass cap mkd. N 1/16 S 28 S 27 2020 from which new bearing trees A fir, 9 ins. diam., bears N. 47 1/2° E., 18.3 ft. dist., mkd. N1/16 S27 BT. A fir, 9 ins. diam., bears N. 16° W., 9.4 ft. dist., mkd. N1/16 S28 BT. From this cor., the point established as a witness corner for the N 1/16 sec. cor. of secs. 27 and 28, by Stuntzner, bears E., 1.24 ft. dist.; monumented with an iron post, 1 1/4 ins. diam., firmly set, projecting 18 ins. above ground, with a square steel plate welded to the top, mkd. 1/16. Drove the witness corner flush with the surface of the ground. This point now functions as a reference monument. N. 2° 08' 41" W., beginning new measurement.
210	Spur, slopes N. 60° W.
1317.66	The cor. of secs. 21, 22, 27, and 28, reported by Popken and Carlson in 1975; perpetuated by Smith, PLS No. 2469, in 1996; monumented with an iron post, 1 1/4 ins. diam. (Record, 1 in. diam.), firmly set, projecting 9 ins. above ground, with a brass cap mkd. COUNTY SURVEYORS OFFICE T 30 S S 21 S 22 — — S 28 S 27 R 8 W 1965 from which the remains of the bearing trees reported by Popken and Carlson A roothole bears N. 26° E., 16.5 ft. dist., alongside of which is an uprooted fir stump, 16 ins. diam., with scribe marks S and other illegible scribe marks visible on open blaze.

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET									
	A decayed fir stump, 10 ins. diam., bears N. 33° E., 7.3 ft. dist., no marks visible. (Original) A fir, 26 ins. diam., bears S. 25° W., 18.5 ft. dist., with a healed blaze. (Original) A roothole bears N. 71° W., 11.9 ft. dist., alongside of which is a down decayed fir, size indeterminate, with a healed blaze. (Original) and the bearing trees mkd. by Smith A fir, 18 ins. diam., bears N. 74 1/4° E., 18.7 ft. dist., with a healed blaze. A fir, 14 ins. diam., bears S. 51 1/2° E., 44.2 ft. dist., with a healed double blaze. A cedar, 26 ins. diam., bears N. 62 3/4° W., 24.8 ft. dist., with a healed double blaze.								
	From the cor. of secs. 22, 23, 26, and 27, reported by Saveland in June through July of 2008, monumented with an iron post, 1 1/4 ins. diam., firmly set, projecting 12 ins. above ground, with a brass cap mkd. COUNTY SURVEYORS OFFICE <table border="1"> <tr> <td>S 22</td><td>S 23</td></tr> <tr> <td>S 27</td><td>S 26</td></tr> <tr> <td colspan="2">T 30 S R 8 W</td></tr> <tr> <td colspan="2">1958</td></tr> </table> from which the remains of the bearing trees reported by Saveland A fir, 17 ins. diam., bears N. 29 1/2° E., 81.7 ft. dist., with a healed blaze. A roothole bears N. 63° E., 24.4 ft. dist., alongside of which is a down uprooted, decayed fir stump, size indeterminate, no marks visible. (Original) A fir, 16 ins. diam., bears S. 77 1/4° E., 28.1 ft. dist., with a healed blaze. A broken, decayed fir stump, size indeterminate, bears S. 57° E., 13.9 ft. dist., no marks visible. (Original) A decayed fir stump, 26 ins. diam., bears S. 32 3/4° E., 40.6 ft. dist., with a healed double blaze. A fir, 29 ins. diam., bears S. 34° W., 68.4 ft. dist., with a healed blaze. A decayed fir snag, 18 ins. diam., bears S. 58 1/4° W., 31.7 ft. dist., with scribe marks T30S R8W S27 CS visible on partially healed blaze.	S 22	S 23	S 27	S 26	T 30 S R 8 W		1958	
S 22	S 23								
S 27	S 26								
T 30 S R 8 W									
1958									

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	
	A fir, 14 ins. diam., bears N. $39\frac{1}{4}^{\circ}$ W., 26.3 ft. dist., with a healed blaze. A roothole bears N. 26° W., 16.5 ft. dist., alongside of which is an uprooted, decayed fir stump, 32 ins. diam., with a healed blaze. (Original) S. $87^{\circ} 51' 51''$ W., bet. secs. 22 and 27.
135	Dirt road, 12 ft. wide, bears N. 20° E. and S. 30° W.
2435.75	The $\frac{1}{4}$ sec. cor. of secs. 22 and 27, perpetuated by Byron, Douglas County Deputy Surveyor, in September 1958; subsequently perpetuated by Douglas County Surveyor's Office, on September 17, 1964; monumented with an iron post, $1\frac{1}{4}$ ins. diam., firmly set, projecting 16 ins. above ground, with a brass cap mkd. COUNTY SURVEYORS OFFICE S 22 1/4 ——— S 27 T 30 S R 8 W 1958 from which the original bearing trees A fir, 29 ins. diam., bears N., 29.7 ft. dist., with a healed blaze. A cedar, 20 ins. diam., bears S. 32° E., 5.3 ft. dist., with a healed blaze. and a bearing tree mkd. by Douglas County Surveyor's Office A fir, 28 ins. diam., bears N. $3\frac{1}{4}^{\circ}$ W., 33.6 ft. dist., with a healed blaze. S. $88^{\circ} 17' 39''$ W., beginning new measurement.
130	Dirt road, 12 ft. wide, bears N. 70° E. and S. 75° W.
2828.74	The cor. of secs. 21, 22, 27, and 28.
1295.67	N. $0^{\circ} 31' 55''$ E., bet. secs. 21 and 22. From this point, a point established by person(s) unknown and not utilized for control in this survey, bears W., 0.30 ft. dist.; monumented with a steel fence post, 2 ins. diam., firmly set, projecting 38 ins. above ground, from which bearing trees mkd. by person(s) unknown A cedar, 16 ins. diam., bears S. $67\frac{1}{4}^{\circ}$ W., 38.1 ft. dist., with no marks visible on open blaze and an aluminum tag mkd. FHWA.

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	
2591.87	A fir, 36 ins. diam., bears N. 50 3/4° W., 23.8 ft. dist., with a healed blaze and axe marks visible on bark. The 1/4 sec. cor. of secs. 21 and 22, reported by Popken and Carlson in 1975, monumented with an iron post, 2 1/2 ins. diam., firmly set, projecting 7 ins. above ground, with a brass cap mkd. T 30 S R 8 W 1/4 S 21 S 22 1975 from which the remains of the bearing trees reported by Popken and Carlson A fir, 26 ins. diam., bears S. 89° E., 25.7 ft. dist., with a healed double blaze. A fir, 29 ins. diam., bears N. 64° W., 43.3 ft. dist., with a healed blaze. (Record, 44.2 ft. dist.) A decayed fir stump, 8 ins. diam., bears N. 36° W., 5.9 ft. dist., no marks visible. (Original) and a bearing tree mkd. by person(s) unknown A fir, 26 ins. diam., bears S. 23 3/4° W., 8.4 ft. dist., with a healed blaze. N. 0° 53' 04" E., beginning new measurement.
275	Spur, slopes W.
1301.82	From this point, a point established by person(s) unknown and not utilized for control in this survey, bears E., 0.35 ft. dist.; monumented with a steel fence post, 2 ins. diam., firmly set, projecting 26 ins. above ground, from which a bearing tree mkd. by person(s) unknown A fir, 15 ins. diam., bears N. 69 3/4° W., 5.8 ft. dist., with a healed blaze and an aluminum tag mkd. FHWA.
2600.16	The cor. of secs. 15, 16, 21, and 22, reported by Saveland in March 2008, monumented with an iron post, 1 1/4 ins. diam., firmly set, projecting 8 ins. above ground, with a brass cap mkd. COUNTY SURVEYORS OFFICE T 30 S S 16 S 15 S 21 S 22 R 8 W 1965


**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET

from which the remains of the bearing trees reported by Saveland

- A pine, 48 ins. diam., bears N. 50° E., 8.0 ft. dist., with a healed blaze and axe marks visible on bark. (Original)
- A decayed pine snag, 11 ins. diam., bears S. 72° E., 7.9 ft. dist., with illegible scribe marks visible on partially healed blaze. (Original)
- A fir, 20 ins. diam., bears S. 44° E., 20.8 ft. dist., with a healed blaze.
- A madrone, 16 ins. diam., bears S. 64° W., 20.5 ft. dist., no marks visible on a hollowed decayed blaze. (Original)
- A pine, 27 ins. diam., bears N. 24° W., 27.7 ft. dist., with a healed blaze and axe marks visible on bark. (Original)

From the cor. of secs. 14, 15, 22, and 23, reported by Beck and White in 1963-64; perpetuated by Douglas County Surveyor's Office, in 1981; subsequently perpetuated by Edwards, PLS No. 2339, in 2014; monumented with an iron post, 2 1/2 ins. diam., firmly set, projecting 8 ins. above ground, with a brass cap mkd.

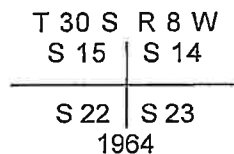

from which the remains of the bearing trees reported by Beck and White

- A tin-capped fir stump, 38 ins. diam., bears N. 44° E., 29.0 ft. dist., no marks visible. (Original)
- A tin-capped fir stump, 45 ins. diam., bears S. 35° E., 15.2 ft. dist., no marks visible. (Original)
- A fir stump, 22 ins. diam., bears S. 26° W., 54.8 ft. dist., with a healed blaze.

and the remains of the bearing trees mkd. by Douglas County Surveyor's Office

- A tin-capped, decayed fir stump, 16 ins. diam., bears N. 81 1/4° E., 148.6 ft. dist., with scribe marks T30S R8W S14 CS visible on open blaze.
- A tin-capped fir stump, 34 ins. diam., bears S. 57° E., 100.9 ft. dist., with scribe marks T30S R8W S23 CS BT visible on bark.
- A decayed fir stump, 18 ins. diam., bears S. 48° W., 42.8 ft. dist., no marks visible.

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	A decayed fir stump, 34 ins. diam., bears N. 25 1/4° W., 59.0 ft. dist., no marks visible. and a bearing tree mkd. by Edwards A fir, 7 ins. diam., bears N. 19° E., 8.7 ft. dist., with a healed blaze. and new bearing trees A fir, 7 ins. diam., bears S. 55 1/2° E., 23.5 ft. dist., mkd. T30S R8W S23 BT. A fir, 14 ins. diam., bears S. 55 1/2° W., 20.5 ft. dist., mkd. T30S R8W S22 BT. A fir, 7 ins. diam., bears N. 24° W., 23.4 ft. dist., mkd. T30S R8W S15 BT. Corner is located W., 110 ft. dist., of dirt road, 10 ft. wide, bears N. 45° E. and S. 45° W. S. 86° 04' 46" W., bet. secs. 15 and 22. 2420 Ollala Creek, 4 ft. wide, course N. 40° E. 2641.19 The 1/4 sec. cor. of secs. 15 and 22, perpetuated by Byron, Douglas County Deputy Surveyor, in August 1958; monumented with an iron post, 1 1/4 ins. diam., firmly set, projecting 15 ins. above ground, with a brass cap mkd. COUNTY SURVEYORS OFFICE 1/4 S 15 S 22 T 30 S R 8 W 1958 from which the remains of an original bearing tree A decayed fir snag, 38 ins. diam., bears N. 44° E., 26.4 ft. dist., no marks visible. and the remains of the bearing trees mkd. by Byron A decayed fir snag, 13 ins. diam., bears N. 22 3/4° E., 31.4 ft. dist., with a healed double blaze. A fir, 27 ins. diam., bears S. 66° E., 27.3 ft. dist., with a healed blaze. and a new bearing tree A fir, 11 ins. diam., bears N. 57 1/4° E., 22.4 ft. dist., mkd. 1/4 S15 BT.
-------------	--

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	S. 87° 38' 13" W., beginning new measurement.
2581.24	The cor. of secs. 15, 16, 21, and 22.
	From the cor. of secs. 4, 5, 32, and 33, on the S. bdy. of the Tp.
	N. 0° 10' 20" W., bet. secs. 32 and 33.
990	Graveled road, 10 ft. wide, bears S. 65° E. and S. 70° W.
1308.55	The S 1/16 sec. cor. of secs. 32 and 33, established by Stuntzner, RE No. 6245, in 1974; and is accepted as the cor.; monumented with an iron rod, 5/8 in. diam., firmly set, with top 1 in. below the surface of the ground; from which the remains of a bearing tree mkd. by Stuntzner
	A fir stump, 23 ins. diam., bears N. 83° E., 45.0 ft. dist., with illegible scribe marks visible on partially healed blaze.
	At the corner point
	Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 34 ins. in the ground, directly over iron rod, with brass cap mkd.
	S 1/16 S 32 S 33 2020
	from which new accessories
	A fir, 6 ins. diam., bears S. 44 1/2° E., 17.6 ft. dist., mkd. S1/16 S33 BT.
	A fir, 14 ins. diam., bears S. 32 1/4° W., 51.1 ft. dist., mkd. S1/16 S32 BT.
	An iron rod, 30 ins. long, 5/8 in. diam., set 25 ins. in the ground, for a reference monument, bears N. 7° 07' 19" W., 60.10 ft. dist., with aluminum cap mkd. RM S1/16 S32 60.10 FT TO COR 2020 and an arrow pointing to the cor.
	Corner is located on the S. edge, of Buck Springs Rd., graveled surface, 20 ft. wide, bears N. 40° E. and S. 60° W.
	N. 0° 08' 24" W., beginning new measurement.
160	Ridge, bears N. 70° E. and S. 70° W.
1310.02	The 1/4 sec. cor. of secs. 32 and 33, reported by Beck and White in 1963-64, monumented with an iron post, 2 1/2 ins. diam., projecting 5 ins. above ground, with a brass cap mkd.

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	
	$\frac{1}{4}$ S 32 S 33 T 30 S R 8 W 1963 from which the remains of the bearing trees reported by Beck and White A cedar, 14 ins. diam., bears N. 81° E., 27.5 ft. dist., with a healed blaze. (Record, 28.4 ft. dist.) A decayed fir stump, 16 ins. diam., bears S. 62° W., 20.5 ft. dist., with scribe marks 2 BT visible on partially healed blaze. and a new bearing tree A fir, 6 ins. diam., bears S. 72 3/4° W., 6.6 ft. dist., mkd. 1/4 S32 BT. N. 0° 14' 15" E., beginning new measurement.
1291.76	The N 1/16 sec. cor. of secs. 32 and 33, established by Stuntzner, RE No. 6245, in 1974; and is accepted as the cor.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 6 ins. above ground; from which the remains of a bearing tree mkd. by Stuntzner A madrone, 24 ins. diam., bears S. 57 1/4° E., 11.1 ft. dist., with a healed blaze. At the corner point Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 23 ins. in the ground, directly over iron rod, with brass cap mkd. N 1/16 S 32 S 33 2020 from which a new bearing tree A hemlock, 10 ins. diam., bears N. 42° W., 7.6 ft. dist., mkd. N1/16 S32 BT. N. 0° 14' 47" E., beginning new measurement.
1291.89	The cor. of secs. 28, 29, 32, and 33, reported by Popken and Carlson in 1975, monumented with an iron post, 2 1/2 ins. diam., firmly set, projecting 10 ins. above ground, with a brass cap mkd.

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET

T 30 S	R 8 W
S 29	S 28
S 32	S 33
1963	

from which the bearing trees reported by Popken and Carlson

A fir, 32 ins. diam., bears N. $3\frac{1}{2}^{\circ}$ E., 44.9 ft. dist., with a healed blaze.

A madrone, 24 ins. diam., bears N. 13° E., 9.9 ft. dist., with axe marks visible on decayed open blaze. (Original)

A fir, 23 ins. diam., bears S. 68° E., 26.4 ft. dist., with a healed blaze.

A fir, 30 ins. diam., bears S. $32\frac{1}{2}^{\circ}$ W., 30.2 ft. dist., with a healed blaze. (Record, 29.0 ft. dist.)

A fir, 24 ins. diam., bears N. 35° W., 7.9 ft. dist., with a healed blaze.

Corner is located E., 30 ft. dist., of a creek, 1 ft. wide, course N. 15° W.

From the $\frac{1}{4}$ sec. cor. of secs. 28 and 33, reported by Skeesick in 2006-07, monumented with an iron post, 2 $\frac{1}{2}$ ins. diam., firmly set, with top flush with the surface of the ground, with a brass cap mkd.

T 30 S	R 8 W
S 28	
$\frac{1}{4}$	—
S 33	
2006	

from which the remains of the bearing trees reported by Skeesick

A decayed fir stump, 17 ins. diam., bears S. $75\frac{1}{4}^{\circ}$ E., 68.6 ft. dist., no marks visible.

A fir, 14 ins. diam., bears S. 81° W., 37.3 ft. dist., with a healed blaze.

A decayed fir stump, 40 ins. diam., bears N. $56\frac{1}{2}^{\circ}$ W., 70.6 ft. dist., no marks visible.

A fir, 11 ins. diam., bears N. $4\frac{3}{4}^{\circ}$ W., 26.0 ft. dist., with a healed blaze.

From this cor., a point established by Douglas County Surveyor's Office, in 1968, reported by Skeesick in 2006-07, bears N. $89^{\circ} 25' 03''$ W., 56.89 ft. dist., monumented with an iron post, 1 $\frac{1}{4}$ ins. diam., firmly set, projecting 12 ins. above ground, with brass cap mkd. COUNTY SURVEYORS OFFICE T30S R8W WC 60' EAST TO S28 $\frac{1}{4}$ S33 1968, from which the remains of the bearing tree mkd. by Douglas County Surveyor's office, reported by Skeesick

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	A tin-capped decayed fir stump, 16 ins. diam., bears S. $27\frac{3}{4}^{\circ}$ W., 25.3 ft. dist., with scribe marks C1/4 S33 visible on open blaze. Corner is located W., 15 ft. dist., of Union Creek Access Rd., graveled surface, 10 ft. wide, bears N. 10° E. and S. 10° W. S. $88^{\circ} 40' 30''$ W., bet. secs. 28 and 33.										
2552.44	The cor. of secs. 28, 29, 32, and 33. From the cor. of secs. 20, 21, 28, and 29, reported by Beck and White in 1963-64, monumented with an iron pipe, 1 in. diam., firmly set, with top flush with the surface of an exposed sandstone boulder, 4 x 6 x 4 ft. high, with a brass tablet, 3 1/4 ins. diam., seated firmly in the iron pipe, with top mkd. <table> <tr><td>T 30 S</td><td>R 8 W</td></tr> <tr><td>S 20</td><td>S 21</td></tr> <tr><td colspan="2"> </td></tr> <tr><td>S 29</td><td>S 28</td></tr> <tr><td colspan="2">1963</td></tr> </table> from which the remains of the original bearing trees reported by Beck and White A fir, 24 ins. diam., bears N. 80° E., 29.0 ft. dist., with a healed blaze. A broken, hollowed fir snag, 19 ins. diam., bears S. 78° E., 23.1 ft. dist., with a healed blaze. (Record, S. 74° E.) A fir snag, 29 ins. diam., bears S. $66\frac{1}{4}^{\circ}$ W., 33.8 ft. dist., with a healed blaze. (Record, S. 58° W., 35.6 ft. dist.) An oak, 14 ins. diam., bears N. 86° W., 26.4 ft. dist., with a hollowed blaze. and new bearing trees An oak, 11 ins. diam., bears S. $52\frac{1}{2}^{\circ}$ E., 15.5 ft. dist., mkd. T30S R8W S28 BT. An oak, 5 ins. diam., bears S. $58\frac{1}{4}^{\circ}$ W., 6.2 ft. dist., mkd. X BT. N. $1^{\circ} 46' 01''$ W., bet. secs. 20 and 21.	T 30 S	R 8 W	S 20	S 21			S 29	S 28	1963	
T 30 S	R 8 W										
S 20	S 21										
S 29	S 28										
1963											
315	Spur, slopes W.										
2634.22	The 1/4 sec. cor. of secs. 20 and 21, perpetuated by Douglas County Surveyor's Office, on September 17, 1969, filed under County Survey File No. CS53/67-4; from original evidence no longer in existence; monumented with an iron post, 1 1/4 ins. diam., firmly set, projecting 18 ins. above ground, with a brass cap mkd.										

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	
	COUNTY SURVEYORS OFFICE T 30 S R 8 W 1/4 S 20 S 21 1969 from which a bearing tree mkd. by Douglas County Surveyor's Office A fir, 22 ins. diam., bears S. 72 1/2° E., 23.3 ft. dist., with a healed blaze. and a new bearing tree A pine, 8 ins. diam., bears S. 55° W., 21.7 ft. dist., mkd. 1/4 S20 BT. N. 0° 23' 43" E., beginning new measurement.
1308.00	From this point, a point established by person(s) unknown and not utilized for control in this survey, bears W., 0.38 ft. dist.; monumented with a steel fence post, 2 ins. diam., firmly set, projecting 36 ins. above ground, from which the bearing trees mkd. by person(s) unknown A fir, 17 ins. diam., bears N. 75 3/4° W., 7.0 ft. dist., with a healed blaze and an aluminum tag mkd. FHWA.
2360	Creek, 4 ft. wide, course S. 50° W.
2575	Graveled road, 12 ft. wide, bears E. and S. 85° W.
2614.79	The cor. of secs. 16, 17, 20, and 21, reported by Bedell and Seibold in 1989-93, monumented with an iron post, 1 1/4 ins. diam., firmly set, projecting 8 ins. above ground, with a brass cap mkd. COUNTY SURVEYORS OFFICE T 30 S S 17 S 16 S 20 S 21 R 8 W 1965 from which the remains of the bearing trees reported by Bedell and Seibold A madrone, 24 ins. diam., bears N. 14° E., 61.4 ft. dist., no marks visible on a hollowed double blaze. (Original) A fir snag, 11 ins. diam., bears N. 61 1/2° E., 22.4 ft. dist., with scribe marks T30S R8W S16 BT visible on partially healed blaze and healed upper blaze. A roothole bears N. 71° E., 13.9 ft. dist., alongside of which is a fir wood fragment, with scribe marks 8W S16 CS and axe work.

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	A fir snag, 12 ins. diam., bears S. 78° E., 29.0 ft. dist., with a healed double blaze. A decayed pine snag, 15 ins. diam., bears S. 52 1/2° W., 13.5 ft. dist., with scribe marks T30S R8W S20 CS visible on open blaze. A cedar, 14 ins. diam., bears N. 21° W., 35.2 ft. dist., with a healed double blaze. (Record, 36.3 ft. dist.) and new bearing trees A fir, 8 ins. diam., bears S. 66 3/4° E., 27.1 ft. dist., mkd. T30S R8W S21 BT. A cedar, 6 ins. diam., bears S. 42 1/2° W., 15.9 ft. dist., mkd. T30S R8W S20 BT. From the cor. of secs. 15, 16, 21, and 22. S. 87° 57' 26" W., bet. secs. 16 and 21. 235 Bottom of descent, drains S. 30° W. 1324.04 From this point, a point established by person(s) unknown and not utilized for control in this survey, bears S., 0.13 ft. dist.; monumented with a steel fence post, 2 ins. diam., firmly set, projecting 34 ins. above ground, from which bearing trees mkd. by person(s) unknown A fir, 18 ins. diam., bears N. 25 1/4° E., 24.3 ft. dist., with a healed blaze. A fir, 39 ins. diam., bears S. 33 3/4° E., 13.2 ft. dist., with a healed blaze and an aluminum tag mkd. FHWA. 2647.75 The 1/4 sec. cor. of secs. 16 and 21, reported by Popken and Carlson in 1975, monumented with an iron post, 2 1/2 ins. diam., firmly set, with top flush with the surface of the ground, with a brass cap mkd. T 30 S R 8 W S 16 1/4 ——— S 21 1975 from which the bearing tree reported by Popken and Carlson A fir, 26 ins. diam., bears S. 11 1/2° W., 19.8 ft. dist., with a healed blaze. and a new bearing tree A fir, 9 ins. diam., bears N. 46 1/2° W., 11.5 ft. dist., mkd. 1/4 S16 BT.
------	---

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	
	S. 88° 20' 11" W., beginning new measurement.
2647.25	The cor. of secs. 16, 17, 20, and 21.
	N. 0° 30' 33" E., bet. secs. 16 and 17.
2300	Dirt road, 16 ft. wide, bears S. 70° E. and N. 80° W.
2325	Boulder Ridge, bears S. 70° E. and N. 80° W.
2620.07	The 1/4 sec. cor. of secs. 16 and 17, reported by Bedell and Seibold in 1989-93, monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 6 ins. above ground, with a brass cap mkd.
	T 30 S R 8 W 1/4 S 17 S 16 1989
	from which the remains of the bearing trees reported by Bedell and Seibold
	A fir, 16 ins. diam., bears S. 66 1/2° E., 9.9 ft. dist., with a healed blaze. (Record, S. 73° E.)
	A pine stump, 17 ins. diam., bears N. 62° W., 14.2 ft. dist., no marks visible.
	and a new bearing tree
	A fir, 12 ins. diam., bears S. 14 3/4° W., 27.4 ft. dist., mkd. 1/4 S17 BT.
	N. 0° 29' 20" E., beginning new measurement.
2620.20	The cor. of secs. 8, 9, 16, and 17, reported by Winter in 2013-14, monumented with an iron post, 1 1/4 ins. diam., firmly set, projecting 9 ins. above ground, with a brass cap mkd.
	COUNTY SURVEYORS OFFICE T 30 S S 8 S 9 ----- S 17 S 16 R 8 W 1965
	from which the remains of the bearing trees reported by Winter
	A fir, 19 ins. diam., bears N. 35° E., 14.5 ft. dist., with a healed blaze.

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	A decayed fir stump, size indeterminate, bears N. 55° E., 38.3 ft. dist., no marks visible. (Original) A cedar snag, 13 ins. diam., bears S. 48 1/4° E., 19.2 ft. dist., with illegible scribe marks visible on open blaze. (Original) A fir, 29 ins. diam., bears S. 25° E., 34.3 ft. dist., with a healed blaze. A roothole bears S. 15° W., 17.8 ft. dist., alongside of which is an uprooted decayed fir stump, 24 ins. diam., no marks visible. (Original) A fir, 16 ins. diam., bears S. 67° W., 66.0 ft. dist., with a healed double blaze. A decayed fir stump, 40 ins. diam., bears N. 55° W., 32.3 ft. dist., with illegible scribe marks visible on open blaze. (Original) A fir, 5 ins. diam., bears N. 47° W., 7.9 ft. dist., with illegible scribe marks visible on partially healed blaze. Corner is located S., 75 ft. dist., of Bridge Creek Road, graveled surface, 20 ft. wide, bears N. 60° E. and S. 60° W. From the 1/4 sec. cor. of secs. 19 and 20, reported by Jelley and Rogers in 1980, monumented with an iron post, 2 1/2 ins. diam., firmly set, projecting 6 ins. above ground, with a brass cap mkd. T 30 S R 8 W 1/4 S 19 S 20 1972 from which the remains of the bearing trees reported by Jelley and Rogers A fir stump, 20 ins. diam., bears S. 75° E., 32.3 ft. dist., with a healed blaze. A fir, 23 ins. diam., bears S. 88 1/2° W., 27.7 ft. dist., with a healed double blaze. (Record, W., 29.7 ft. dist.) and a new bearing tree A cedar, 7 ins. diam., bears N. 64 3/4° E., 27.3 ft. dist., mkd. 1/4 S20 BT. N. 0° 06' 50" E., bet. secs. 19 and 20. 2639.41 The cor. of secs. 17, 18, 19, and 20, reported by Winter in 2013-14, monumented with an iron post, 1 1/4 ins. diam., firmly set, projecting 10 ins. above ground, with a brass cap mkd.
------	---

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	COUNTY SURVEYORS OFFICE T 30 S S 18 S 17 S 19 S 20 R 8 W 1965 from which the remains of the accessories reported by Winter - A fir, 8 ins. diam., bears N. 21 3/4° E., 5.1 ft. dist., with illegible scribe marks visible on partially healed blaze. - A cedar, 16 ins. diam., bears S. 61 1/2° E., 13.3 ft. dist., with scribe marks T30S R8W S20 BT visible on partially healed blaze. - A 60d steel spike, mkd. BO, driven into the top of a fir stump, 48 ins. diam., bears S. 58 3/4° E., 92.6 ft. dist. - A broken, decayed madrone stump, 18 ins. diam., bears S. 11° E., 38.9 ft. dist., with a hollowed blaze. (Original) - A fir, 21 ins. diam., bears S. 64 1/2° W., 31.9 ft. dist., with a healed double blaze. - A fir, 7 ins. diam., bears N. 89 3/4° W., 14.1 ft. dist., with illegible scribe marks visible on partially healed blaze. - A decayed fir stump, 13 ins. diam., bears N. 14 1/2° W., 63.6 ft. dist., with axe marks visible on bark. Corner is located E., 155 ft. dist., of Battle Creek Road, graveled surface, 18 ft. wide, bears N. 10° E. and S. 5° W. From the cor. of secs. 16, 17, 20, and 21. S. 87° 16' 02" W., bet. secs. 17 and 20. 2575.94 The 1/4 sec. cor. of secs. 17 and 20, perpetuated by Douglas County Surveyor's Office, on September 17, 1969, filed under County Survey File No. CS 53/67-3; monumented with an iron post, 1 1/4 ins. diam., firmly set, projecting 8 ins. above ground, with a brass cap mkd. COUNTY SURVEYORS OFFICE T 30 S R 8 W S 17 1/4 ——— S 20 1969 from which the remains of an original bearing tree
------	--

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	
	A pine snag, 36 ins. diam., bears N. 35° W., 31.0 ft. dist., with no marks visible on open blaze. (Original) and new bearing trees A fir, 15 ins. diam., bears S. 3° W., 21.0 ft. dist., mkd. 1/4 S20 BT. A fir, 18 ins. diam., bears N. 74 3/4° W., 15.2 ft. dist., mkd. 1/4 S17 BT. S. 87° 33' 20" W., beginning new measurement.
1220	Dirt road, 8 ft. wide, bears S. 45° E. and N. 5° W.
1333.38	The W 1/16 sec. cor. of secs. 17 and 20, established by Shaner, PE No. 4906, in June 1973; and is accepted as the cor.; monumented with an iron post, 1 1/4 ins. diam., firmly set, projecting 8 ins. above ground, with a brass cap mkd. W 1/16 S 17 S 20 1973 from which the remains of a bearing tree mkd. by Shaner A decayed fir stump, 15 ins. diam., bears N. 31 1/4° W., 13.7 ft. dist., with axe marks visible on bark. and new bearing trees A fir, 6 ins. diam., bears N. 26 1/2° E., 5.0 ft. dist., mkd. W1/16 S17 BT. A cedar, 10 ins. diam., bears S. 10 1/2° W., 5.9 ft. dist., mkd. W1/16 S20 BT. S. 87° 31' 35" W., beginning new measurement.
1005	Creek, 2 ft. wide, course S. 20° E.
1333.26	The cor. of secs. 17, 18, 19, and 20. N. 0° 34' 15" E., bet. secs. 17 and 18.
160	Ravine, drains S. 65° E.
580	Graveled road, 12 ft. wide, bears N. 5° E. and S. 10° W.

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	
2653.73	The 1/4 sec. cor. of secs. 17 and 18, reestablished by proportionate measurement by Shaner, PE No. 4906, in March 1973. There is no remaining evidence of the original cor., therefore this point is accepted as a careful and faithful reestablishment of the cor.; monumented with an iron post, 1 1/4 ins. diam., firmly set, projecting 11 ins. above ground, with a brass cap mkd. T 30 S R 8 W W.M. 1/4 S 18 S 17 1973 from which the remains of the bearing trees mkd. by Shaner A broken, decayed fir snag, 25 ins. diam., bears N. 13° E., 8.8 ft. dist., with illegible scribe marks visible on partially healed blaze. A fir snag, 17 ins. diam., bears N. 32 1/4° W., 5.8 ft. dist., with a healed blaze. and new bearing trees A fir, 20 ins. diam., bears N. 37° E., 22.2 ft. dist., mkd. 1/4 S17 BT. A fir, 5 ins. diam., bears N. 66 3/4° W., 23.1 ft. dist., mkd. 1/4 S18 BT. N. 0° 33' 27" E., beginning new measurement.
1090	Ridge, bears N. 20° E. and N. 40° W., with a graveled road on top of ridge, 12 ft. wide, bears S. 70° E. and N. 75° W.
2120	Ravine, drains E.
2450	Spur, slopes N. 80° E.
2652.38	The cor. of secs. 7, 8, 17, and 18, perpetuated by Douglas County Surveyor's Office, in September 1965; and in 1970; monumented with an iron post, 1 1/4 ins. diam., firmly set, projecting 3 ins. above ground, with a brass cap mkd. COUNTY SURVEYORS OFFICE T 30 S S 7 S 8 S 18 S 17 R 8 W 1965 from which the remains of the original bearing trees A fir, 42 ins. diam., bears N. 15° E., 14.5 ft. dist., no marks visible.

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	
	A roothole bears S. 58° E., 48.2 ft. dist., downhill of which is a down fir, 17 ins. diam., no marks visible. A decayed fir snag, 38 ins. diam., bears N. 50° W., 25.1 ft. dist., with axe marks visible on bark. and the bearing trees mkd. by Douglas County Surveyor's Office in 1965 A fir, 20 ins. diam., bears N. 69 1/2° E., 40.5 ft. dist., with a healed blaze. A hemlock, 20 ins. diam., bears S. 79 3/4° E., 36.9 ft. dist., with a healed blaze. A chinquapin, 14 ins. diam., bears N. 2 1/2° W., 31.3 ft. dist., with a hollowed blaze. and a bearing tree mkd. by Douglas County Surveyor's Office in 1970 A hemlock, 30 ins. diam., bears S. 71 1/2° W., 23.4 ft. dist., with a healed blaze.
	N. 0° 34' 31" E., bet. secs. 7 and 8.
230	Graveled road, 16 ft. wide, bears S. 60° E. and N. 60° W.
270	Graveled road, 16 ft. wide, bears S. 60° E. and N. 60° W.
940	Creek, 4 ft. wide, course N. 75° W.
1580	Spur, slopes W.
1695	Bottom of descent, drains S. 40° W.
1930	Graveled road, 12 ft. wide, bears N. 75° E. and S. 80° W.
2050	Ridge, bears S. 65° E. and N. 55° W.
2597.80	The 1/4 sec. cor. of secs. 7 and 8, reestablished by proportionate measurement by Stiles, PLS No. 432, in 1967. There is no remaining evidence of the original cor., therefore this point is accepted as a careful and faithful reestablishment of the cor.; monumented with an iron pipe, 1 1/4 ins. diam., firmly set, projecting 5 ins. above ground, from which a bearing tree mkd. by Stiles A fir, 27 ins. diam., bears N. 34 1/4° W., 8.9 ft. dist., with a healed blaze. At the corner point Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, directly over iron pipe, with brass cap mkd.

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon**

FEET	
	T 30 S R 8 W 1/4 S 7 S 8 2021 and a new bearing tree A chinquapin, 7 ins. diam., bears N. 7 3/4° E., 47.2 ft. dist., mkd. 1/4 S8 BT. N. 0° 21' 28" E., beginning new measurement.
825	Graveled road, 12 ft. wide, bears N. 65° E. and S. 70° W.
1420	Creek, 8 ft. wide, course N. 80° W.
2565	Graveled road, 16 ft. wide, bears S. 70° E. and N. 60° W.
2595.26	The cor. of secs. 5, 6, 7, and 8, perpetuated by Douglas County Surveyor's Office, in April 1965; subsequently perpetuated by Rogers, PLS No. 2137, in 1997; monumented with an iron post, 1 1/4 ins. diam., firmly set, projecting 4 ins. above ground, with a brass cap mkd. COUNTY SURVEYORS OFFICE T 30 S S 6 S 5 S 7 S 8 R 8 W 1965 from which the remains of an original bearing tree A decayed fir stump, size indeterminate, bears S. 56° E., 5.3 ft. dist., no marks visible. and the remains of the bearing trees mkd. by Douglas County Surveyor's Office A roothole bears N. 53 1/2° E., 8.7 ft. dist., alongside of which is a down chinquapin, size indeterminate, no marks visible. A fir stump, 10 ins. diam., bears S. 18 1/4° E., 12.8 ft. dist., with a healed blaze. A fir stump, 12 ins. diam., bears S. 80° W., 5.6 ft. dist., with a healed blaze. and the remains of a bearing tree mkd. by Rogers

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 30 S., R. 8 W., Willamette Meridian, Oregon

FEET	A fir stump, 15 ins. diam., bears N. 42° W., 4.0 ft. dist., with a healed blaze. and new accessories A chinquapin, 13 ins. diam., bears N. 9 1/4° E., 88.7 ft. dist., mkd. T30S R8W S5 BT. An iron rod, 30 ins. long, 5/8 in. diam., set 26 ins. in the ground, for a reference monument, bears S. 37° 29' 20" E., 19.27 ft. dist., with aluminum cap mkd. RM T30S R8W S8 19.27 FT TO COR 2021 and an arrow pointing to the cor. A fir, 5 ins. diam., bears S. 24 1/4° W., 59.1 ft. dist., mkd. X BT. A fir, 5 ins. diam., bears N. 18 3/4° W., 75.4 ft. dist., mkd. T30S R8W S6 BT.
------	--