

ORIGINAL

**UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT**

FIELD NOTES

OF THE

DEPENDENT RESURVEY OF PORTIONS OF THE EAST BOUNDARY, SUBDIVISIONAL
LINES, AND SUBDIVISION OF SECTION LINES OF SECTIONS 21 AND 27,
AND THE SUBDIVISION OF SECTIONS 22, 23, AND 25,
TOWNSHIP 29 SOUTH, RANGE 6 WEST,
OF THE WILLAMETTE MERIDIAN,
IN THE STATE OF OREGON

EXECUTED BY

Jeffrey O. Covington, Cadastral Surveyor

Under Special Instructions approved May 16, 2019,
which provided for the surveys included under Group No. 2940,
and Assignment Instructions dated May 16, 2019.

Survey commenced June 11, 2019

Survey completed September 24, 2019

T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET

The following field notes are those of the dependent resurvey of portions of the east boundary, subdivisional lines, and subdivision of section lines of sections 21 and 27, and the subdivision of sections 22, 23, and 25, Township 29 South, Range 6 West, Willamette Meridian, Oregon.

The history of the official surveys pertaining to this survey is as follows:

In 1855, Nathaniel Ford, U.S. Deputy Surveyor, surveyed the east boundary and a portion of the subdivisional lines, as shown on the official plat of survey approved March 9, 1855.

In 1872, William H. Byars, U.S. Deputy Surveyor, surveyed a portion of the subdivisional lines, as shown on the official plat of survey approved October 1, 1872.

In 1958-59, Hans W. Thielson and C. Albert White, Cadastral Surveyors, dependently resurveyed a portion of the subdivisional lines, as shown on the official plat of survey accepted March 1, 1961, suspended August 14, 1980, suspension lifted August 23, 1982, suspended November 8, 1989, suspension lifted March 21, 1994.

In 1971, Peter A. Peterson and Daniel L. Berry, Cadastral Surveyors, dependently resurveyed a portion of the subdivisional lines and subdivided section 15, as shown on the official plat of survey accepted April 5, 1974.

In 1990, Wayne L. Rogers and Bryan S. Seibold, Cadastral Surveyors, dependently resurveyed a portion of the subdivisional lines and subdivided sections 21 and 27, as shown on the official plat of survey accepted March 21, 1994.

In 2002, Timothy J. Moore, Cadastral Surveyor, and Robert H. Browning, Surveying Technician, rehabilitated certain corner points as described in the official field notes approved November 3, 2004.

The following local surveys (M) and county surveyor files (CS), filed in the Douglas County Surveyor's Office are referred to in subsequent corner descriptions and are referenced by surveyor's last name; official title, Professional Land Surveyor (PLS) No., or Professional Engineer (PE) No.; and year.

<u>Date</u>	<u>Name and Registration Number</u>	<u>File Number</u>
1913	Frank Cain, Deputy County Surveyor	FB33, pgs. 17-20 Old Cor. Bk. 193-194
1915	Floyd J. Cole, Deputy County Surveyor	V2P251
1919	F. C. Frear, Deputy County Surveyor	FB46, pgs. 47-57 V3P62-64 Old Cor. Bk. 129-130
1920	J. W. Cole, Deputy County Surveyor	FB49, pgs. 7-8
1929	Ben B. Irving, Deputy County Surveyor	M1-61
1942	Baker, Oregon State Highway Engineer	CS36/27A
12/22/1950	John H. Markham Jr., PE No. 2880	CS40/294

T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	Date	Name and Registration Number	File Number
	2/16/1951	John H. Markham Jr., PE No. 2880	CS40/294
	6/24/1957	James W. Byron, Deputy County Surveyor	CS47/195, M5-33
	1/23/1958	John H. Markham Jr., PE No. 2880	CS42/325
	4/19/1962	James W. Byron, Deputy County Surveyor	CS49/139
	4/23/1962	James W. Byron, Deputy County Surveyor	CS49/139
	4/25/1962	James W. Byron, Deputy County Surveyor	CS49/139
	1964	Douglas County Surveyor's Office	CS49/139
	1969	James W. Byron, PLS No. 303	M37-20, CS54/79
	06/1971	Victor M. McLind, PLS No. 934	M41-68
	04/1971	Victor M. McLind, PLS No. 934	M42/22
	1974	William S. Barnes, PE 2138	CS55/341-1
	06/1977	Douglas County Surveyor's Office	CS59/34-38
	08/1977	Douglas County Surveyor's Office	CS59/38-16
	1977	Victor M. McLind, PLS No. 934	M64-6
	1977	Francis L. Ingram, PLS No. 902	M68-47, CS59/49
	12/08/1977	Francis L. Ingram, PLS No. 902	CS59/42-22
	12/08/1977	Francis L. Ingram, PLS No. 902	CS59/42-23
	12/12/1977	Francis L. Ingram, PLS No. 902	CS59/42-28
	12/12/1977	Francis L. Ingram, PLS No. 902	CS59/42-29
	1978	Howard W. Johnstone, PLS No. 498	RM3-12
	1979	Howard W. Johnstone, PLS No. 498	V16P37
	1980	Howard W. Johnstone, PLS No. 498	M83-75
	1982	Robert L. Dolan, PLS No. 1076	M91-25
	1984	Donald A. Bentz, PLS No. 839	M97-42
	1985	Burton W. Holt, PLS No. 418	CS63/8-20
	1988	Donald A. Bentz, PLS No. 839	M106-40
	2005	Gregory D. Lang, PLS No. 2295	M147-40
			CS65/54-16A-C
	03/2011	Randall W. Smith, PLS No. 2469	CS67/33-17
	04/06/2011	Randall W. Smith, PLS No. 2469	CS67/33-18
	04/06/2011	Randall W. Smith, PLS No. 2469	CS67/33-20
	<p>In 1977, the Bureau of Land Management (BLM) conducted an administrative survey of the subdivision of section 25, filed in the Roseburg District Office in Roseburg, Oregon.</p>		
	<p>The survey was executed in accordance with the specification set forth in the <u>Manual of Surveying Instructions</u> (2009), and the special instructions approved May 16, 2019, for Group No. 2940, Oregon.</p>		
	<p>The directions of the lines are based on the true meridian as determined by Global Positioning System (GPS) techniques and direct solar observations and carried forward by sustained angulation using conventional survey techniques. All measurements along the lines were derived through the use of electronic measuring equipment. Measured distances and directions have been adjusted by computer software that incorporates a least squares adjustment routine. The adjusted mean bearings and mean horizontal ground elevation distances are reported to the nearest second and 0.01 foot.</p>		

T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET

Preliminary to the resurvey the lines of the official original surveys and resurveys were retraced and search was made for all corners, lines, other calls of the record, and, where available, collateral evidence of local surveys and corners. Identified corners were perpetuated in their original positions. The retracement data was thoroughly verified and only the true line field notes are given herein.

Each new bearing tree has a 2 1/2 inch x 1/4 inch magnetic nail (Mag Nail) driven at the base on right side center and each monument established or reestablished has a magnet deposited in a white plastic case at the base of the stainless steel post, unless otherwise noted in the corner description. Aluminum angle irons were driven alongside each monument unless a similar marker was already in place.

Only those lines bounding Federal interest land were blazed.

The geographic position in NAD 1983 (2011) of the following corners as determined by ties from temporary GPS control points, established utilizing dual frequency, carrier phase GPS receivers, and processed using the National Geodetic Survey's Online Positioning User Service (OPUS):

The corner of sections 13, 14, 23, and 24:

Latitude: 43° 02' 27.34" N. Longitude: 123° 21' 57.70" W.

The corner of sections 26, 27, 34, and 35:

Latitude: 43° 00' 48.24" N. Longitude: 123° 23' 08.12" W.

The 1/4 section corner of sections 21 and 28:


Latitude: 43° 01' 40.14" N. Longitude: 123° 24' 52.02" W.

**Dependent Resurvey of a Portion of the East Boundary,
T. 29 S., R. 6 W., Willamette Meridian, Oregon**

Restoring the survey by Ford in 1855

Beginning at the cor. of secs. 25, 30, 31, and 36, perpetuated by Irving, Deputy County Surveyor, in 1929; subsequently perpetuated by Ingram, PLS No. 902, in December of 1977, per CS59/42-29; further perpetuated by Holt, PLS No. 418, in 1985; monumented with an iron post, 1 in. diam., firmly set, projecting 1 in. above ground, with a brass cap mkd.

DOUGLAS COUNTY SURVEYORS OFFICE

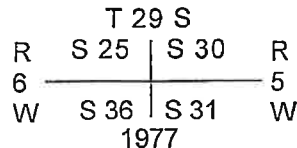

Dependent Resurvey of a Portion of the East Boundary,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET																
	<p>from which the remains of an original bearing tree</p> <p>A tin-capped, decayed fir stump, size indeterminate, bears S. 60° W., 11.2 ft. dist., no marks visible.</p> <p>and the remains of the bearing trees mkd. by Irving</p> <p>A fir stump, 42 ins. diam., bears N. 15° E., 79.3 ft. dist., no marks visible.</p> <p>A tin-capped fir stump, 40 ins. diam., bears S. 72 3/4° E., 53.6 ft. dist., with a healed blaze.</p> <p>A fir stump, 24 ins. diam., bears N. 67° W., 42.8 ft. dist., no marks visible.</p> <p>and the remains of the bearing tree mkd. by Holt</p> <p>A decayed fir stump, size indeterminate, bears N. 62 3/4° E., 38.9 ft. dist., no marks visible.</p> <p>and new bearing trees</p> <p>A cedar, 6 ins. diam., bears N. 73 1/4° E., 12.7 ft. dist., mkd. T29S R5W S30 BT.</p> <p>A fir, 7 ins. diam., bears S. 71 1/2° E., 10.6 ft. dist., mkd. T29S R5W S31 BT.</p> <p>A cedar, 4 ins. diam., bears S. 58° W., 31.4 ft. dist., mkd. X BT.</p> <p>A fir, 7 ins. diam., bears N. 79 3/4° W., 19.5 ft. dist., mkd. T29S R6W S25 BT.</p> <p>Corner is located alongside a fence cor., with wire fences extending N., S., E., and W.</p> <p>N. 1° 31' 10" E., bet. secs. 25 and 30.</p>															
380	Creek, 2 ft. wide, course N. 15° W.															
630	Dirt road, 15 ft. wide, bears N. 85° E. and N. 75° W.															
1283.68	<p>The S 1/16 sec. cor. of secs. 25 and 30, established by Ingram, PLS No. 902, in December of 1977, per CS59/42-23; and is accepted as the cor.; monumented with an iron post, 1 in. diam., firmly set, projecting 6 ins. above ground, with a brass cap mkd.</p>															
	<p style="text-align: center;">COUNTY SURVEYORS OFFICE</p> <p style="text-align: center;">T 29 S</p> <p style="text-align: center;">S 1/16</p> <table style="margin-left: auto; margin-right: auto;"> <tr> <td>R</td> <td>S 25</td> <td> </td> <td>S 30</td> <td>R</td> </tr> <tr> <td>6</td> <td colspan="3" style="text-align: center;">RESET 1977</td> <td>5</td> </tr> <tr> <td>W</td> <td colspan="3" style="text-align: center;">1969</td> <td>W</td> </tr> </table>	R	S 25		S 30	R	6	RESET 1977			5	W	1969			W
R	S 25		S 30	R												
6	RESET 1977			5												
W	1969			W												

**Dependent Resurvey of a Portion of the East Boundary,
T. 29 S., R. 6 W., Willamette Meridian, Oregon**

FEET	
	<p>from which the remains of the bearing trees mkd. by Byron, PLS No. 303, in 1969, and reused by Ingram</p> <p style="padding-left: 40px;">A decayed fir stump, size indeterminate, bears S. 84 1/2° E., 40.9 ft. dist., no marks visible.</p> <p style="padding-left: 40px;">A decayed fir stump, size indeterminate, bears N. 16 1/2° W., 9.9 ft. dist., no marks visible.</p> <p>and new bearing trees</p> <p style="padding-left: 40px;">A cedar, 17 ins. diam., bears S. 52 1/2° E., 41.3 ft. dist., mkd. S1/16 S30 BT.</p> <p style="padding-left: 40px;">A cedar, 8 ins. diam., bears N. 21 3/4° W., 51.1 ft. dist., mkd. S1/16 S25 BT.</p> <p>Corner is located alongside a fence cor., with wire fences extending N., S., and W.</p> <p>From this cor., a point erroneously established as the S 1/16 sec. cor. of secs. 25 and 30, by Byron, PLS No. 303, in January of 1969; perpetuated by Ingram, PLS No. 902, in 1977. This point was established using improper control and was not utilized for control in this survey, bears N. 74° 07' 17" E., 4.16 ft. dist.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 2 ins. above ground, with an aluminum cap mkd. DOUGLAS CO. SURVEYOR 1977; from which the remains of the bearing trees mkd. by Byron</p> <p style="padding-left: 40px;">A decayed fir stump, size indeterminate, bears S. 82° E., 37.0 ft. dist., no marks visible.</p> <p style="padding-left: 40px;">A decayed fir stump, size indeterminate, bears N. 39 1/4° W., 10.8 ft. dist., no marks visible.</p> <p>The 1969 iron post was reset by Ingram in its true position and the erroneously established position was perpetuated with an iron rod.</p> <hr style="width: 20%; margin: 10px auto;"/> <p>N. 1° 31' 55" E., beginning new measurement.</p>
1250	Creek, 3 ft. wide, course N. 40° E.
1282.78	The 1/4 sec. cor. of secs. 25 and 30, reestablished by proportionate measurement by Ingram, PLS No. 902, in 1977, per CS 59/42-22; there is no remaining evidence of the original cor. and this position is accepted as a careful and faithful reestablishment of the cor.; monumented with an iron post, 1 in. diam., firmly set, projecting 7 ins. above ground, with a brass cap mkd.

Dependent Resurvey of a Portion of the East Boundary,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
	<p style="text-align: center;">COUNTY SURVEYORS OFFICE RESET 1977 T 29 S 1/4 S 25 S 30 R R 6 5 W W 1969</p> <p>from which the bearing trees mkd. by Byron, PLS No. 303, in 1969, and reused by Ingram</p> <p style="padding-left: 40px;">A fir, 32 ins. diam., bears N. 84 1/4° E., 12.6 ft. dist., with a healed blaze.</p> <p style="padding-left: 40px;">A fir, 26 ins. diam., bears N. 76° W., 26.0 ft. dist., with a healed blaze.</p> <p>Corner is located W., 22 ft. dist., of wire fence, extends N. and S.</p> <p>From this cor., a point erroneously established as the 1/4 sec. cor. of secs. 25 and 30, by Byron, PLS No. 303, in January of 1969; perpetuated by Ingram, PLS No. 902, in 1977. This point was established using improper control and was not utilized for control in this survey, bears N. 74° 12' 52" E., 7.20 ft. dist.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 3 ins. above ground, with an aluminum cap mkd. DOUGLAS CO. SURVEYOR 1977; from which the bearing trees mkd. by Byron</p> <p style="padding-left: 40px;">A fir, 32 ins. diam., bears S. 82 3/4° E., 5.7 ft. dist., with a healed blaze.</p> <p style="padding-left: 40px;">A fir, 26 ins. diam., bears N. 82 1/4° W., 32.5 ft. dist., with a healed blaze.</p> <p>The 1969 iron post was reset by Ingram in its true position and the erroneously established position was perpetuated with an iron rod.</p> <hr style="width: 20%; margin: 10px auto;"/> <p>N. 1° 29' 42" E., beginning new measurement.</p>
1283.62	<p>The N 1/16 sec. cor. of secs. 25 and 30, established by Ingram, PLS No. 902, in December of 1977, per CS59/42-28; and is accepted as the cor.; monumented with an iron post, 1 in. diam., firmly set, projecting 15 ins. above ground, in a mound of stone, 1 1/2 ft. base, 12 ins. high, with a brass cap mkd.</p> <p style="text-align: center;">COUNTY SURVEYORS OFFICE T 29 S R N 1/16 R 6 S 25 S 30 5 W RESET 1977 W 1969</p> <p>from which the bearing trees mkd. by Byron, PLS No. 303, in 1969, and reused by Ingram</p>

Dependent Resurvey of a Portion of the East Boundary,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	<p>An ash, 32 ins. diam., bears N. 18° E., 59.0 ft. dist., with illegible scribe marks visible on partially healed blaze.</p> <p>A cedar, 28 ins. diam., bears N. 61 1/4° E., 64.2 ft. dist., with a healed blaze.</p> <p>Corner is located W., 25 ft. dist., of fence cor., with wire fences extending S. and W.</p> <p>From this cor., a point erroneously established as the N 1/16 sec. cor. of secs. 25 and 30, by Byron, PLS No. 303, in January of 1969; perpetuated by Ingram, PLS No. 902, in 1977. This point was established using improper control and was not utilized for control in this survey, bears N. 70° 04' 17" E., 12.98 ft. dist.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 2 ins. above ground, in a collar of stone, with an aluminum cap mkd. DOUGLAS CO. SURVEYOR 1977; from which the bearing trees mkd. by Byron</p> <p>An ash, 32 ins. diam., bears N. 6 1/2° E., 52.0 ft. dist., with illegible scribe marks visible on partially healed blaze.</p> <p>A cedar, 28 ins. diam., bears N. 59° E., 51.4 ft. dist., with a healed blaze.</p> <p>The 1969 iron post was reset by Ingram in its true position and the erroneously established position was perpetuated with an iron rod.</p> <hr style="width: 20%; margin: 10px auto;"/> <p>N. 1° 30' 28" E., beginning new measurement.</p>																												
635	<p>Spur, slopes N. 45° E.</p>																												
1283.85	<p>The cor. of secs. 19, 24, 25, and 30, perpetuated by Douglas County Surveyor's Office, in June of 1977; monumented with an iron post, 1 in. diam., firmly set, projecting 6 ins. above ground, with a brass cap mkd.</p> <p style="text-align: center;">DOUGLAS COUNTY SURVEYORS OFFICE</p> <table style="margin: auto; border-collapse: collapse;"> <tr> <td></td> <td colspan="2" style="text-align: center;">T 29 S</td> <td></td> </tr> <tr> <td></td> <td style="text-align: center;">S 24</td> <td style="text-align: center;"> S 19</td> <td></td> </tr> <tr> <td style="text-align: center;">R</td> <td colspan="2" style="text-align: center;">-----</td> <td style="text-align: center;">R</td> </tr> <tr> <td style="text-align: center;">6</td> <td style="text-align: center;">S 25</td> <td style="text-align: center;"> S 30</td> <td style="text-align: center;">5</td> </tr> <tr> <td style="text-align: center;">W</td> <td colspan="2" style="text-align: center;">RESET</td> <td style="text-align: center;">W</td> </tr> <tr> <td></td> <td colspan="2" style="text-align: center;">1977</td> <td></td> </tr> <tr> <td></td> <td colspan="2" style="text-align: center;">1969</td> <td></td> </tr> </table> <p>from which the remains of an original bearing tree</p> <p>A decayed fir stump, 40 ins. diam., bears S. 2° E., 137.3 ft. dist., with scribe marks 2 30 BT visible on open blaze.</p> <p>and the bearing trees mkd. by Byron, PLS No. 303, in 1969, and reused by Douglas County Surveyor's Office</p> <p>A fir, 22 ins. diam., bears S. 73 1/4° E., 48.6 ft. dist., with a healed blaze.</p>		T 29 S				S 24	S 19		R	-----		R	6	S 25	S 30	5	W	RESET		W		1977				1969		
	T 29 S																												
	S 24	S 19																											
R	-----		R																										
6	S 25	S 30	5																										
W	RESET		W																										
	1977																												
	1969																												

**Dependent Resurvey of a Portion of the East Boundary,
T. 29 S., R. 6 W., Willamette Meridian, Oregon**

FEET	
	<p>A fir, 27 ins. diam., bears S. 5° W., 14.2 ft. dist., with a healed blaze.</p> <p>A fir, 34 ins. diam., bears N. 4° W., 27.1 ft. dist., with a healed blaze.</p> <p>and a new bearing tree</p> <p>A cedar, 13 ins. diam., bears N. 35° E., 41.9 ft. dist., mkd. T29S R5W S19 BT.</p> <p>From this cor., a point erroneously established as the cor. of secs. 19, 24, 25, and 30, by Byron, PLS No. 303, in January of 1969; perpetuated by Douglas County Surveyor's Office, in June of 1977. This point was established using improper control and was not utilized for control in this survey, bears N. 70° 21' 56" E., 17.74 ft. dist.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 4 ins. above ground, in a collar of stone, with an aluminum cap mkd. DOUGLAS CO. SURVEYOR CS 1977; from which the bearing trees mkd. by Byron</p> <p>A fir, 22 ins. diam., bears S. 56 1/4° E., 35.9 ft. dist., with a healed blaze.</p> <p>A fir, 27 ins. diam., bears S. 37 1/2° W., 25.4 ft. dist., with a healed blaze.</p> <p>A fir, 34 ins. diam., bears N. 41 1/4° W., 28.1 ft. dist., with a healed blaze.</p> <p>The 1969 iron post was reset by Douglas County Surveyor's Office in its original position and the erroneously established position was perpetuated with an iron rod.</p>
	<hr/> <p>Dependent Resurvey of a Portion of the Subdivisional Lines, T. 29 S., R. 6 W., Willamette Meridian, Oregon</p> <hr/>
	<p>Restoring the survey by Ford in 1855, the survey by Byars in 1872, the resurvey by Thielsen and White in 1958-59, the resurvey by Rogers and Seibold in 1990, and the rehabilitation by Moore and Browning in 2002</p>
	<p>From the cor. of secs. 25, 30, 31, and 36, on the E. bdy. of the Tp. N. 88° 07' 16" W., bet. secs. 25 and 36.</p>
125	Spur, slopes N.
270	Creek, dry, 2 ft. wide, course N.
340	Dirt road, 13 ft. wide, bears S. 20° E. and N. 30° W.
630	Spur, slopes N. 10° W.
1362.15	The E 1/16 sec. cor. of secs. 25 and 36, established by an Administrative Survey conducted by the BLM in 1977; subsequently utilized by Johnstone, PLS No. 489, in 1978; and is accepted as the cor.; monumented with an iron

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	<p>pipe, 1 1/4 ins. diam., firmly set, projecting 1 in. above ground, from which the bearing trees mkd. by the Administrative Survey</p> <p>A decayed fir stump, size indeterminate, bears N. 82 1/4° E., 9.7 ft. dist., no marks visible.</p> <p>A decayed fir stump, 12 ins. diam., bears S. 8° E., 6.5 ft. dist., with illegible scribe marks visible on partially healed blaze.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 22 ins. in the ground, directly over the iron pipe, with brass cap mkd.</p> <div style="text-align: center; margin: 10px 0;"> <p>S 25</p> <p>E 1/16 ———</p> <p>S 36</p> <p>2019</p> </div> <p>and new bearing trees</p> <p>A fir, 15 ins. diam., bears N. 80° E., 18.8 ft. dist., mkd. E1/16 S25 BT.</p> <p>A fir, 20 ins. diam., bears S. 40 1/2° E., 21.5 ft. dist., mkd. E1/16 S36 BT on bark.</p> <p>Corner is located alongside a fence cor., with wire fences extending N. and E.</p> <hr style="width: 20%; margin: 10px auto;"/> <p>N. 88° 09' 15" W., beginning new measurement.</p>
5	<p>Creek, 3 ft. wide, course N. 15° E.</p>
1362.81	<p>The 1/4 sec. cor. of secs. 25 and 36, reestablished by proportionate measurement by Johnstone, PLS No. 498, in 1978; there is no remaining evidence of the original cor. and this position is accepted as a careful and faithful reestablishment of the cor.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 9 ins. above ground, with an aluminum cap mkd. T29S R6W 25 1/4 36 LS 498 1978, from which the bearing trees mkd. by Johnstone</p> <p>A fir, 16 ins. diam., bears S. 87° E., 5.1 ft. dist., with a healed blaze.</p> <p>A fir, 17 ins. diam., bears N. 9° W., 27.2 ft. dist., with a healed blaze.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, directly over the iron rod, with brass cap mkd.</p>

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
	<p style="text-align: center;">T 29 S R 6 W S 25 1/4 _____ S 36 2019</p> <hr style="width: 20%; margin: auto;"/>
<p>1362.98</p>	<p>N. 88° 08' 08" W., beginning new measurement.</p> <p>The W 1/16 sec. cor. of secs. 25 and 36, established by Johnstone, PLS No. 498, in 1978; and is accepted as the cor.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 11 ins. above ground, with an aluminum cap mkd. T29S R6W 25 W1/16 36 LS498 1978, from which the remains of the bearing trees mkd. by Johnstone</p> <p style="padding-left: 40px;">A fir stump, 35 ins. diam., bears S. 24 1/2° E., 14.2 ft. dist., with a healed blaze.</p> <p style="padding-left: 40px;">A fir stump, 22 ins. diam., bears N. 10 1/2° W., 10.5 ft. dist., with axe marks visible on bark.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, directly over the iron rod, with brass cap mkd.</p>
	<p style="text-align: center;">S 25 W 1/16 _____ S 36 2019</p> <p>and new bearing trees</p> <p style="padding-left: 40px;">A fir, 3 ins. diam., bears N. 66 1/4° E., 15.0 ft. dist., mkd. X BT.</p> <p style="padding-left: 40px;">A fir, 4 ins. diam., bears S. 73° W., 11.4 ft. dist., mkd. W1/16 S36 BT.</p> <hr style="width: 20%; margin: auto;"/>
<p>190</p>	<p>N. 88° 08' 24" W., beginning new measurement.</p> <p>Ridge, bears N. 50° E. and S. 60° W.</p>
<p>681.41</p>	<p>The W-W 1/64 sec. cor. of secs. 25 and 36, established by Johnstone, PLS No. 498, in 1978; and is accepted as the cor.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 14 ins. above ground, from which the remains of the bearing trees mkd. by Johnstone</p> <p style="padding-left: 40px;">A fir stump, 24 ins. diam., bears N. 85 1/4° E., 22.6 ft. dist., with a healed blaze.</p> <p style="padding-left: 40px;">A fir stump, 26 ins. diam., bears N. 27 1/4° W., 17.7 ft. dist., with a healed blaze.</p>

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon**

FEET	
	<p>At the corner point</p> <p>Affix an aluminum cap on top of the iron rod mkd.</p> <p style="text-align: center;">S 25 W-W 1/64 S 36 2019</p> <p>and new bearing trees</p> <p style="padding-left: 40px;">A fir, 4 ins. diam., bears N. 46 1/2° E., 5.2 ft. dist., mkd. X BT.</p> <p style="padding-left: 40px;">A fir, 4 ins. diam., bears S. 64 1/4° E., 24.2 ft. dist., mkd. WW1/64 S36 BT.</p> <hr style="width: 20%; margin: 10px auto;"/> <p>N. 88° 05' 57" W., beginning new measurement.</p>
681.24	<p>Point for the cor. of secs. 25, 26, 35, and 36, perpetuated by Cain, Douglas County Deputy Surveyor, in 1913; subsequently perpetuated by Baker, Oregon State Highway Engineer, in 1942; further perpetuated by Byron, Douglas County Deputy Surveyor, on April 25, 1962; from original evidence no longer in existence; as determined at the center of an embedded mound of stone; from which the remains of a bearing tree mkd. by Cain</p> <p style="padding-left: 40px;">A decayed fir stump, 60 ins. diam., bears S. 59 1/4° E., 380.2 ft. dist., with scribe marks T 6W S visible on open blaze.</p> <p>and the remains of a bearing tree mkd. by Baker</p> <p style="padding-left: 40px;">A decayed fir stump, 24 ins. diam., bears S. 3° W., 333.2 ft. dist., no marks visible.</p> <p>and the remains of the bearing trees mkd. by Byron</p> <p style="padding-left: 40px;">An oak, 22 ins. diam., bears N. 14 3/4° E., 449.3 ft. dist., with a healed blaze.</p> <p style="padding-left: 40px;">An oak, 13 ins. diam., bears S. 44 1/2° E., 223.3 ft. dist., with a healed blaze.</p> <p style="padding-left: 40px;">An oak, 23 ins. diam., bears N. 30 1/2° W., 301.2 ft. dist., with a healed blaze.</p> <p>and the private property cors. set by Johnstone, PLS No. 498, in 1979</p> <p style="padding-left: 40px;">An iron rod, 5/8 in. diam., firmly set, projecting 10 ins. above ground, bears S. 88° 00' 17" E., 324.97 ft. dist.</p> <p style="padding-left: 40px;">An iron rod, 5/8 in. diam., firmly set, projecting 6 ins. above ground, bears S. 1° 30' 26" W., 316.78 ft. dist.</p>

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET									
	<p>and a reference monument set by person(s) unknown</p> <p>An iron pipe, 1 1/2 ins. diam., firmly set, with top 3 ins. below the surface of the ground, bears S. 30° 09' 10" E., 6.25 ft. dist.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 27 ins. in the ground, in a collar of stone, with brass cap mkd.</p> <div style="text-align: center;"> <table border="1"> <tr><td>T 29 S</td><td>R 6 W</td></tr> <tr><td>S 26</td><td>S 25</td></tr> <tr><td>S 35</td><td>S 36</td></tr> <tr><td colspan="2">2019</td></tr> </table> </div> <p>Corner located in a large open pasture, gently sloping N. 45 W.</p>	T 29 S	R 6 W	S 26	S 25	S 35	S 36	2019	
T 29 S	R 6 W								
S 26	S 25								
S 35	S 36								
2019									
639.74	<p>N. 2° 04' 19" E., bet. secs. 25 and 26.</p> <p>The S-S 1/64 sec. cor. of secs. 25 and 26, established by Johnstone, PLS No. 498, in 1978; and is accepted as the cor.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 10 ins. above ground, with an aluminum cap mkd.</p> <div style="text-align: center;"> <table border="1"> <tr><td>T 29 S</td><td>R 6 W</td></tr> <tr><td>SS 1/64</td><td></td></tr> <tr><td>26</td><td>25</td></tr> <tr><td>LS 498</td><td>1977</td></tr> </table> </div> <p>from which the bearing trees mkd. by Johnstone</p> <p>An oak, 33 ins. diam., bears N. 75 1/2° E., 18.1 ft. dist., with a healed blaze.</p> <p>An oak, 12 ins. diam., bears S. 3 1/4° E., 45.2 ft. dist., with a healed blaze.</p> <p>Corner is located W., 15 ft. dist., of fence cor., with wire fences extending E., S., and W.</p>	T 29 S	R 6 W	SS 1/64		26	25	LS 498	1977
T 29 S	R 6 W								
SS 1/64									
26	25								
LS 498	1977								
640.50	<p>N. 2° 06' 23" E., beginning new measurement.</p> <p>The S 1/16 sec. cor. of secs. 25 and 26, established by Johnstone, PLS No. 498, in 1978; and is accepted as the cor.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 8 ins. above ground, in a collar of stone, with an aluminum cap mkd. T29S R6W S26 S25 S1/16 LS498 1977, from which the bearing trees mkd. by Johnstone</p> <p>An oak, 13 ins. diam., bears S. 38 3/4° W., 17.0 ft. dist., with a healed blaze.</p>								

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon**

FEET	
	<p>An oak, 20 ins. diam., bears N. 62 1/4° W., 27.8 ft. dist., with a healed blaze.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, directly over the iron rod, in a collar of stone, with brass cap mkd.</p> <p style="text-align: center;">S 1/16 S 26 S 25 2019</p> <p>No suitable bearing trees available in sec. 25.</p> <hr style="width: 20%; margin: 10px auto;"/> <p>N. 2° 07' 17" E., beginning new measurement.</p>
1282.08	<p>The 1/4 sec. cor. of secs. 25 and 26, reestablished by proportionate measurement by Cain, Douglas County Deputy Surveyor, in 1913; perpetuated by Markham Jr., PE No. 2880, in 1958; subsequently perpetuated by the Douglas County Surveyor's Office, in August of 1977; further perpetuated by Smith, PLS No. 2469, in April of 2011, under CS67/33-20. There is no remaining evidence of the original cor. and this position is accepted as a careful and faithful reestablishment of the cor.; the cor. point is occupied by a maple, 24 ins. diam., with a healed blaze on the west face, from which the remains of the bearing tree mkd. by Cain</p> <p style="padding-left: 40px;">A tin-capped fir stump, 34 ins. diam., bears N. 62° E., 9.3 ft. dist., with a healed blaze.</p> <p>and the remains of the bearing trees mkd. by Markham Jr.</p> <p style="padding-left: 40px;">A decayed fir stump, 16 ins. diam., bears N. 71° E., 80.8 ft. dist., with a hollowed blaze.</p> <p style="padding-left: 40px;">A maple, 18 ins. diam., bears N. 73° E., 107.1 ft. dist., with a healed blaze.</p> <p>and a reference monument set by Douglas County Surveyor's Office</p> <p style="padding-left: 40px;">An iron post, 1 1/4 ins. diam., firmly set, projecting 10 ins. above ground, bears S. 32° 47' 36" E., 1.00 ft. dist., with a brass cap mkd. COUNTY SURVEYORS OFFICE T29S R6W S26 S25 1/4 COR 1977. At the request of the county surveyor, removed the marks on the brass cap and remarked the brass cap RM T29S R6W 1/4 S25 1.00 FT TO COR BLM 2019 1977 and an arrow pointing to the cor.</p> <p>and the bearing trees mkd. by Smith</p> <p style="padding-left: 40px;">A fir, 27 ins. diam., bears S. 11 1/2° E., 23.6 ft. dist., with a healed blaze.</p> <p style="padding-left: 40px;">A fir, 17 ins. diam., bears S. 85 1/4° W., 35.6 ft. dist., with a healed blaze.</p>

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon**

FEET	
	and new reference monuments
	An iron rod, 30 ins. long, 5/8 in. diam., driven 26 ins. in the ground, for a reference monument, bears S. 39° 57' 13" E., 14.89 ft. dist., with aluminum cap mkd. RM1 T29S R6W 1/4 S25 14.89 FT TO COR 2019 and an arrow pointing to the cor.
	An iron rod, 30 ins. long, 5/8 in. diam., driven 22 ins. in the ground, for a reference monument, bears S. 34° 25' 28" EW., 15.89 ft. dist., with aluminum cap mkd. RM2 T29S R6W 1/4 S26 15.89 FT TO COR 2019 and an arrow pointing to the cor.
	Add the marks S25 on the east face and 1/4 S26 on the west face of the cor. tree, on the bark.
	Corner is located alongside a fence cor., with wire fences extending N., E., and W.

	N. 1° 46' 34" E., beginning new measurement.
115	Van Dine Creek, 4 ft. wide, course N. 20° E.
295	Same creek, 5 ft. wide, course N. 15° W.
815	Spur, slopes N. 60° W.
1085	Van Dine Creek, 4 ft. wide, course N. 15° E.
1860	Boomer Hill Road, asphalt surface, 20 ft. wide, bears S. 60and N. 50° W.
1934.58	A point established as a property cor. by Barnes, PE 2138, in 1974; monumented with an iron pipe, 1 1/4 ins. diam., firmly set, projecting 6 ins. above ground.
2013	South side of a wood frame building, 10 x 30 ft. the SE cor. bears N. 85° E., 3 ft. dist., the long side bears N. 3° W.
2044	North side of same wood frame building, 10 x 30 ft. the NE cor. bears N. 85° E., 1 ft. dist.
2230	Draw, course N. 65° E.
2390	Spur, slopes N. 70° E.
2548.72	The cor. of secs. 23, 24, 25, and 26, perpetuated by Markham Jr., PE No. 2880, in 1951; subsequently perpetuated by Byron, Douglas County Deputy Surveyor, on April 23, 1962; further perpetuated by Byron in 1969, under CS49/139; further perpetuated by Lang, PLS No. 2295, in 2005; monumented with an iron post, 1 in. diam., projecting 14 ins. above ground, with a brass cap mkd.

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	<p style="text-align: center;">COUNTY SURVEYORS OFFICE T 29 S R 6 W S 23 S 24 ----- S 26 S 25 1962</p> <p>from which the remains of an original bearing tree</p> <p style="padding-left: 40px;">A decayed fir stump, 50 ins. diam., bears N. 85 1/2° E., 38.3 ft. dist., no marks visible.</p> <p>and the remains of a bearing tree mkd. by Markham Jr.</p> <p style="padding-left: 40px;">A decayed fir stump, 24 ins. diam., bears S. 33 1/2° W., 38.3 ft. dist., with scribe marks S26 visible on bark.</p> <p>and the remains of a bearing tree mkd. by Byron in 1962</p> <p style="padding-left: 40px;">A decayed fir snag, 12 ins. diam., bears S. 55 3/4° E., 31.4 ft. dist., with a healed blaze.</p> <p>and the bearing trees mkd. by Byron in 1969</p> <p style="padding-left: 40px;">An oak, 16 ins. diam., bears N. 44° E., 23.8 ft. dist., with a healed blaze.</p> <p style="padding-left: 40px;">A fir, 24 ins. diam., bears S. 13 1/2° W., 143.6 ft. dist., with a healed blaze.</p> <p>and the remains of the bearing trees mkd. by Lang</p> <p style="padding-left: 40px;">A fir, 14 ins. diam., bears S. 77 1/4° E., 23.6 ft. dist., with a healed blaze.</p> <p style="padding-left: 40px;">A roothole bears N. 71 1/4° W., 68.5 ft. dist., alongside of which is a down fir, 22 ins. diam., with a healed blaze.</p> <p>and a new bearing tree</p> <p style="padding-left: 40px;">A fir, 7 ins. diam., bears N. 50 1/4° W., 29.3 ft. dist., mkd. T29S R6W S23 BT.</p> <p>Corner is located alongside a dilapidated fence cor., with wire fences extending E. and S.</p> <hr/> <p>From the cor. of secs. 19, 24, 25, and 30, on the E. bdy. of the Tp.</p> <p>N. 87° 25' 11" W., bet. secs. 24 and 25.</p> <p>1433.68 The E 1/16 sec. cor. of secs. 24 and 25, established by an Administrative Survey conducted by the BLM in 1977; utilized for the subdivision of section 25 by Johnstone, PLS No. 489, in 1978, and is accepted as the cor.; monumented with an iron pipe, 1 1/4 ins. diam., firmly set, projecting 7 ins. above ground, from which the remains of the bearing trees mkd. by the Administrative Survey</p>
------	--

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	<p>A fir, 16 ins. diam., bears S. 19 1/2° W., 8.2 ft. dist., with a healed blaze.</p> <p>A roothole bears S. 88 1/4° W., 17.4 ft. dist., alongside of which is a down fir, 18 ins. diam., with a healed blaze.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 26 ins. in the ground, directly over the iron pipe, with brass cap mkd.</p> <div style="text-align: center; margin: 10px 0;"> <p>S 24 E 1/16 ——— S 25 2019</p> </div> <p>and a new bearing tree</p> <p>A fir, 14 ins. diam., bears N. 69 3/4° W., 35.6 ft. dist., mkd. E1/16 S24 BT.</p> <hr style="width: 20%; margin: 10px auto;"/> <p>N. 87° 28' 44" W., beginning new measurement.</p>
1433.69	<p>The 1/4 sec. cor. of secs. 24 and 25, perpetuated by Markham Jr., PE No. 2880, in 1950; subsequently perpetuated by Byron, Douglas County Deputy Surveyor, in 1957; further perpetuated by Douglas County Surveyor's Office, in 1964; further perpetuated by Smith, PLS No. 2469, in April of 2011, under CS67/33-18; monumented with an iron post, 1 in. diam., firmly set, projecting 17 ins. above ground, with a brass cap mkd.</p> <div style="text-align: center; margin: 10px 0;"> <p>COUNTY SURVEYORS OFFICE T 29 S R 6 W 24 1/4 ——— 25 1957</p> </div> <p>from which an original bearing tree</p> <p>A madrone, 32 ins. diam., bears S. 30° E., 6.6 ft. dist., with a healed blaze.</p> <p>and a bearing tree mkd. by Markham Jr.</p> <p>A madrone, 31 ins. diam., bears N. 42 1/4° W., 11.7 ft. dist., with a healed blaze.</p> <p>and the remains of the bearing trees mkd. by Byron</p> <p>A decayed fir snag, 12 ins. diam., bears N. 55 1/2° E., 33.3 ft. dist., with a healed blaze.</p> <p>A decayed fir stump, size indeterminate, bears S. 17 3/4° W., 26.0 ft. dist., with a healed blaze.</p>

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon**

FEET	
	and the remains of a bearing tree mkd. by Douglas County Surveyor's Office
	A hollowed, decayed fir stump, 12 ins. diam., bears S. 52 1/2° W., 39.5 ft. dist., with axe marks visible on bark.
	and the bearing trees mkd. by Smith
	An oak, 11 ins. diam., bears N. 69 1/4° E., 47.9 ft. dist., with illegible scribe marks visible on partially healed double blaze.
	A fir, 14 ins. diam., bears S. 29 1/4° W., 57.2 ft. dist., with a healed blaze.
	Corner is located W., 28 ft. dist., of fence cor., with wire fences extending N. 45° E., E., and W.

	N. 89° 24' 57" W., beginning new measurement.
2216	From this point S., 80 ft. dist. to a spring box water well, 5 x 9 ft.
2232	The E. side of a manufactured home, 14 x 61 ft., the SE cor. bears S. 5° E., 5 ft. dist., the long side bears N. 5° W.
2245	The W. side of the same manufactured home, 14 x 61 ft., the SW cor. bears S. 5° E., 6 ft. dist.
2285	From this point S., 18 ft. dist., to a polyethylene plastic water tank, 8 ft. diam. X 7 ft. high
2335	Boomer Hill Road, asphalt surface, 24 ft. wide, bears S. 10° E. and N. 30° W.
2365	Spur, slopes N. 50° E.
2544.55	The cor. of secs. 23, 24, 25, and 26.

	N. 1° 08' 36" E., bet. secs. 23 and 24.
840	Graveled road, 16 ft. wide, bears S. 40° E. and N. 50° W.
1205	Creek, 2 ft. wide, course N. 45° W.
1258.03	Point for the S 1/16 sec. cor. of secs. 23 and 24. Not monumented.
2516.06	The 1/4 sec. cor. of secs. 23 and 24, reestablished by proportionate measurement by Markham Jr., PE No. 2880, in 1951; perpetuated by Byron, Douglas County Surveyor, on April 23, 1962. There is no remaining evidence of the original cor. and this point is accepted as a careful and faithful reestablishment of the cor.; monumented with an iron pipe, 1 in. diam., firmly set, projecting 6 ins. above ground.
	At the corner point

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
	<p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, directly over the iron pipe, with brass cap mkd.</p> <p style="text-align: center;">T 29 S R 6 W 1/4 S 23 S 24 2019</p> <p>and new bearing trees</p> <p style="padding-left: 40px;">A fir, 6 ins. diam., bears N. 51 1/2° E., 23.1 ft. dist., mkd. 1/4 S24 BT.</p> <p style="padding-left: 40px;">A fir, 21 ins. diam., bears N. 46 3/4° W., 27.1 ft. dist., mkd. 1/4 S23 BT.</p> <p>Corner is located alongside a fence cor., with wire fences extending N., S., and W.</p> <hr style="width: 20%; margin: 20px auto;"/> <p>N. 1° 37' 19" E., beginning new measurement.</p>
1355	<p>Spur, slopes N. 70° W.</p>
2509.46	<p>The cor. of secs. 13, 14, 23, and 24, perpetuated by Frear, Douglas County Deputy Surveyor, in 1919; subsequently perpetuated by Byron, Douglas County Deputy Surveyor, in 1957; monumented with an iron pipe, 1 1/4 ins. diam., firmly set, projecting 4 ins. above ground; from which the remains of an original bearing tree</p> <p style="padding-left: 40px;">A roothole bears S. 10° E., 33.0 ft. dist., alongside of which is a down decayed oak, size indeterminate, no marks visible.</p> <p>and a bearing tree mkd. by Frear</p> <p style="padding-left: 40px;">A fir, 24 ins. diam., bears S. 65 1/4° W., 9.1 ft. dist., with a healed blaze.</p> <p>and a bearing tree mkd. by Byron</p> <p style="padding-left: 40px;">An oak, 12 ins. diam., bears N. 55 1/4° E., 11.7 ft. dist., with a healed blaze.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 23 ins. in the ground, directly over the iron pipe, with brass cap mkd.</p> <p style="text-align: center;">T 29 S R 6 W S 14 S 13 ----- S 23 S 24 2019</p> <p>and new bearing trees</p>

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET									
	<p>A fir, 4 ins. diam., bears S. 13 1/4° E., 23.5 ft. dist., mkd. X BT.</p> <p>An oak, 17 ins. diam., bears N. 31 3/4° W., 38.7 ft. dist., mkd. T29S R6W S14 BT.</p> <p>Corner is located alongside a fence cor., with wire fences extending N., E., and S.</p>								
	<p>From the cor. of secs. 26, 27, 34, and 35, reported by Moore and Browning in 2002, monumented with an iron post, 2 1/2 ins. diam., firmly set, projecting 3 ins. above ground, with a brass cap mkd.</p> <div style="text-align: center;"> <table border="1"> <tr> <td>T 29 S</td> <td>R 6 W</td> </tr> <tr> <td>S 27</td> <td>S 26</td> </tr> <tr> <td>S 34</td> <td>S 35</td> </tr> <tr> <td colspan="2">1958</td> </tr> </table> </div> <p>from which the bearing trees reported by Moore and Browning</p> <p>A fir, 11 ins. diam., bears N. 87 3/4° E., 27.1 ft. dist., with a healed blaze.</p> <p>A fir, 26 ins. diam., bears S. 6° E., 14.5 ft. dist., with a healed blaze.</p> <p>A fir, 15 ins. diam., bears S. 13° W., 30.6 ft. dist., with a healed blaze.</p> <p>A fir, 44 ins. diam., bears N. 10° W., 32.0 ft. dist., with a healed blaze.</p> <p>Corner is located alongside a fence cor., with wire fences extending N. and E. N. 1° 03' 13" E., bet. secs. 26 and 27.</p>	T 29 S	R 6 W	S 27	S 26	S 34	S 35	1958	
T 29 S	R 6 W								
S 27	S 26								
S 34	S 35								
1958									
2240	Creek, 4 ft. wide, course N. 10° E.								
2541.37	<p>The 1/4 sec. cor. of sec. 26 only, reestablished by Johnstone, PLS No. 498, in 1978; there is no remaining evidence of the original cor. and this position is accepted as a careful and faithful reestablishment of the cor.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 10 ins. above ground, with a yellow plastic cap mkd. LS, from which the bearing trees mkd. by Johnstone</p> <p>A yew, 11 ins. diam., bears N. 85 1/4° E., 28.8 ft. dist., with scribe marks 1/4 visible on open blaze.</p> <p>A cedar, 25 ins. diam., bears S. 13 1/4° E., 11.3 ft. dist., with a healed blaze.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 20 ins. in the ground, directly over the iron rod, with brass cap mkd.</p>								

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
	<p style="text-align: center;">T 29 S R 6 W 1/4 S 26 2019</p>
	<p>Corner is located W., 11 ft. dist., of wire fence, extends N. and S.</p> <hr style="width: 20%; margin: auto;"/>
	<p>N. 1° 23' 47" E., beginning new measurement.</p>
123.35	<p>The 1/4 sec. cor. of sec. 27 only, reported by Rogers and Seibold in 1990, monumented with an iron post, 2 1/2 ins. diam., firmly set, projecting 7 ins. above ground, with a brass cap mkd.</p>
	<p style="text-align: center;">1/4 S 27 T 29 S R 6 W 1958</p>
	<p>from which the remains of the bearing trees reported by Rogers and Seibold</p> <ul style="list-style-type: none"> A fir, 22 ins. diam., bears S. 3 1/2° W., 46.5 ft. dist., with a healed blaze. A roothole bears S. 10° W., 17.2 ft. dist., alongside of which is an uprooted, decayed fir stump, 50 ins. diam., no marks visible. (Original) A roothole bears S. 30 1/2° W., 28.4 ft. dist., alongside of which is a down decayed fir, 33 ins. diam., no marks visible. A maple, 19 ins. diam., bears N. 13° W., 60.2 ft. dist., with a healed double blaze. (Record, 55.4 ft. dist.)
	<p>Corner is located W., 6 ft. dist., of wire fence, extends N. and S.</p> <p>From this cor., a point established as the 1/4 sec. cor. of sec. 27 only, by Markham Jr., PE No. 2880, in 1951. This point was not correctly positioned and was not utilized for control in this survey, bears N. 54° 27' 25" W., 1.00 ft. dist.; monumented with an iron pipe, 1 1/4 ins. diam., firmly set, projecting 13 ins. above ground.</p> <hr style="width: 20%; margin: auto;"/>
	<p>N. 2° 00' 13" W., beginning new measurement.</p>
265	<p>Creek, 6 ft. wide, course N. 25° W.</p>
2230	<p>Graveled road, 14 ft. wide, bears N. 60° E. and S. 65° W.</p>
2418.40	<p>The cor. of secs. 22, 23, 26, and 27, reported by Thielsen and White in 1958-59; perpetuated by Smith, PLS No. 2469, in 2011, under CS67/33-17; monumented with an iron post, 2 1/2 ins. diam., firmly set, projecting 14 ins. above ground, with a brass cap mkd.</p>

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	<table border="1" style="margin: auto;"> <tr> <td style="text-align: center;">T 29 S</td> <td style="text-align: center;">R 6 W</td> </tr> <tr> <td style="text-align: center;">S 22</td> <td style="text-align: center;">S 23</td> </tr> <tr> <td style="text-align: center;">S 27</td> <td style="text-align: center;">S 26</td> </tr> <tr> <td colspan="2" style="text-align: center;">1958</td> </tr> </table>	T 29 S	R 6 W	S 22	S 23	S 27	S 26	1958	
T 29 S	R 6 W								
S 22	S 23								
S 27	S 26								
1958									
	<p>from which the remains of the bearing trees reported by Thielsen and White</p> <p style="padding-left: 40px;">A decayed fir stump, 26 ins. diam., bears S. 46° E., 15.5 ft. dist., with a healed blaze.</p> <p style="padding-left: 40px;">A fir, 34 ins. diam., bears S. 16 1/2° W., 10.6 ft. dist., with scribe marks T29S R6W BT visible on bark.</p> <p style="padding-left: 40px;">A fir, 21 ins. diam., bears N. 57 1/2° W., 19.8 ft. dist., with a healed blaze. (Original)</p> <p>and a bearing tree mkd. by Smith</p> <p style="padding-left: 40px;">A fir, 12 ins. diam., bears N. 40 1/2° E., 36.9 ft. dist., with a healed blaze.</p> <p>and a new bearing tree</p> <p style="padding-left: 40px;">A fir, 6 ins. diam., bears S. 69° E., 32.0 ft. dist., mkd. T29S R6W S26 BT.</p> <hr/> <p>From the cor. of secs. 23, 24, 25, and 26.</p> <p>N. 88° 38' 18" W., bet. secs. 23 and 26.</p>								
724.56	<p>From this point, a point established as a property cor. by Barnes, PE 2138, in 1974, bears S., 1.54 ft. dist.; monumented with an iron pipe, 1 in. diam., firmly set, projecting 6 ins. above ground. Point is located on a spur, slopes N. 25° E.</p>								
1025	<p>Ravine, drains N. 10° W.</p>								
1288.21	<p>The E 1/16 sec. cor. of secs. 23 and 26, established by Cain, Douglas County Deputy Surveyor, in 1913; perpetuated by Cole, Douglas County Deputy Surveyor, in 1915; subsequently perpetuated by Lang, PLS No. 2295, in 2005; and is accepted as the cor.; monumented with an iron pipe, 1 in. diam., firmly set, projecting 1 in. above ground, from which the remains of the bearing trees mkd. by Cain</p> <p style="padding-left: 40px;">A decayed fir stump, 50 ins. diam., bears S. 55° E., 37.4 ft. dist., no marks visible.</p> <p style="padding-left: 40px;">A decayed fir stump, 58 ins. diam., bears N. 20° W., 29.5 ft. dist., no marks visible.</p> <p>and the bearing trees mkd. by Lang</p>								

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
	<p>A fir, 12 ins. diam., bears N. 27 3/4° E., 12.3 ft. dist., with a healed blaze.</p> <p>A fir, 12 ins. diam., bears S. 70° W., 11.4 ft. dist., with a healed blaze.</p>
	<p>At the corner point</p>
	<p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, directly over the iron pipe, with brass cap mkd.</p>
	<p style="text-align: center;"> S 23 E 1/16 ——— S 26 2019 </p>
	<p>Corner is located alongside a fence cor., with wire fences extending N. and W.</p>
	<p style="text-align: center;">—————</p> <p>N. 89° 18' 59" W., beginning new measurement.</p>
535	<p>Creek, 1 ft. wide, course N. 10° E.</p>
615	<p>Creek, 3 ft. wide, course N. 5° W.</p>
870	<p>Ridge, bears N. 20° E. and S. 20° W.</p>
1281.95	<p>The 1/4 sec. cor. of secs. 23 and 26, reestablished by proportionate measurement by Cain, Douglas County Deputy Surveyor, in 1913; perpetuated by Markham Jr., PE No. 2880, in 1959. There is no remaining evidence of the original cor. and this point is accepted as a careful and faithful reestablishment of the cor.; monumented with an iron pipe, 1 in. diam., firmly set, projecting 5 ins. above ground, from which a bearing tree mkd. by Cain</p>
	<p>A fir, 46 ins. diam., bears N. 3° W., 10.8 ft. dist., with a healed blaze.</p>
	<p>and the bearing trees mkd. by Markham Jr.</p>
	<p>A madrone, 24 ins. diam., bears N. 68 3/4° W., 104.1 ft. dist., with a healed blaze.</p>
	<p>A madrone, 23 ins. diam., bears N. 53 1/2° W., 67.5 ft. dist., with a healed blaze.</p>
	<p>At the corner point</p>
	<p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, directly over the iron pipe, with brass cap mkd.</p>
	<p style="text-align: center;"> T 29 S R 6 W S 23 1/4 ——— S 26 2019 </p>

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
	and a new bearing tree A fir, 8 ins. diam., bears S. 38 3/4° W., 22.9 ft. dist., mkd. 1/4 S26 BT. Corner is located alongside of wire fence, extends E. and W. <hr/>
	N. 89° 25' 59" W., beginning new measurement.
555	Graveled road, 16 ft. wide, bears N. 45° E. and S. 45° W.
855	Ravine, drains N. 20° E.
1000	Graveled road, 16 ft. wide, bears S. 35° E. and N. 50° W.
1395	Ridge, bears N. 30° E. and S. 20° W.
1515	Enter swamp area, continuing along the line for 160 ft, exit swamp.
1920	Graveled road, 12 ft. wide, bears N. 40° E. and S. 45° W.
2250	Ravine, drains N. 30° E.
2574.97	The cor. of secs. 22, 23, 26, and 27. <hr/>
	N. 0° 56' 31" E., bet. secs. 22 and 23.
510	Creek, 8 ft. wide, course N. 65° E.
1010	Spur, slopes N. 15° E.
1271.90	The S 1/16 sec. cor. of secs. 22 and 23, established by Dolan, PLS No. 1076, in 1982; and is accepted as the cor.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 5 ins. above ground, with a grey plastic cap mkd. LS 1076, from which the bearing trees mkd. by Dolan A fir, 31 ins. diam., bears S. 76 1/4° E., 22.2 ft. dist., with a healed double blaze. A fir, 31 ins. diam., bears N. 60 1/2° W., 26.9 ft. dist., with a healed double blaze. At the corner point Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, directly over the iron rod, with brass cap mkd. <div style="text-align: center;">S 1/16 S 22 S 23 2019</div>


Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
	<p>Corner is located alongside of wire fence, extends N. and S.</p> <p>From this cor., a point established as the S 1/16 sec. cor. of secs. 22 and 23, by Markham Jr., PE No. 2880, in 1950. This point was not correctly positioned and was not utilized for control in this survey, bears N. 88° 45' 47" W., 1.80 ft. dist.; monumented with an iron pipe, 1 1/4 ins. diam., firmly set, projecting 8 ins. above ground, from which the remains of the bearing trees mkd. by Markham Jr.</p> <p>A roothole bears S. 32 3/4° E., 31.3 ft. dist., alongside of which is a down decayed maple, size indeterminate, no marks visible.</p> <p>A myrtle, 17 ins. diam., bears S. 71° W., 27.4 ft. dist., with a healed blaze.</p> <hr/> <p>N. 0° 58' 47" E., beginning new measurement.</p>
884.11	<p>A point established as a property cor. by Dolan, PLS No. 1076, in 1982; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 6 ins. above ground.</p>
912.45	<p>From this point, a point established as a property cor. by McLind, PLS No. 934, in April of 1971, bears E., 10.89 ft. dist.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 2 ins. above ground.</p>
1271.07	<p>The 1/4 sec. cor. of secs. 22 and 23, perpetuated by Markham Jr., PE No. 2880, in 1950; subsequently perpetuated by person(s) unknown; from original evidence no longer in existence; monumented with an iron pipe, 1 in. diam., firmly set, projecting 12 ins. above ground, from which the remains of the bearing trees mkd. by Markham Jr.</p> <p>An oak, 16 ins. diam., bears S. 69 1/2° E., 29.2 ft. dist., with a healed blaze.</p> <p>A decayed fir stump, size indeterminate, bears N. 55 1/2° W., 25.5 ft. dist., alongside of which is a broken fragment with illegible scribe marks visible on open blaze.</p> <p>and a bearing tree mkd. by person(s) unknown</p> <p>An oak, 17 ins. diam., bears N. 78 3/4° W., 20.8 ft. dist., with a healed blaze.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 23 ins. in the ground, directly over the iron pipe, with brass cap mkd.</p> <p style="text-align: center;">T 29 S R 6 W 1/4 S 22 S 23 2019</p>

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
	<p>Corner is located alongside a fence cor., with wire fences extending N., E., and S. 75° W.</p>
	<p>From the cor. of secs. 22, 23, 26, and 27.</p>
	<p>N. 89° 03' 38" W., bet. secs. 22 and 27.</p>
1165	<p>Creek, 1 ft. wide, course N. 5° E.</p>
1274.25	<p>The E 1/16 sec. cor. of secs. 22 and 27, reported by Rogers and Seibold in 1990, monumented with an iron post, 2 1/2 ins. diam., firmly set, projecting 14 ins. above ground, with a brass cap mkd.</p>
	<div style="text-align: center;"> <p>S 22 E 1/16 ——— S 27 T 29 S R 6 W 1958</p> </div>
	<p>from which the bearing trees reported by Rogers and Seibold</p>
	<p>A cedar, 30 ins. diam., bears S. 15° E., 14.5 ft. dist., with a healed blaze.</p>
	<p>A cedar, 14 ins. diam., bears N. 60° W., 24.8 ft. dist., with a healed blaze.</p>
	<p>Corner is located alongside a fence cor., with wire fences extending E., S., and W.</p>
	<p>From this cor., a point erroneously established as the E 1/16 sec. cor. of secs. 22 and 27, by Markham Jr., PE No. 2880, in 1950; reported by Rogers and Seibold in 1990, bears N. 70° 11' 23" E., 5.69 ft. dist. (Record, N. 67° 56' E, 5.74 ft.) ; monumented with an iron pipe, 1 1/4 ins. diam., firmly set, projecting 14 ins. above ground; from which the remains of the bearing trees mkd. by Markham Jr.</p>
	<p>A roothole bears S. 62° W., 9.6 ft. dist., alongside of which is a down oak, 10 ins. diam., no marks visible.</p>
	<p>An oak, 21 ins. diam., bears N. 58° W., 30.4 ft. dist., with a healed double blaze.</p>
	<p>From the cor. of secs. 21, 22, 27, and 28, reported by Rogers and Seibold in 1990; perpetuated by person(s) unknown; monumented with an iron post, 2 1/2 ins. diam., firmly set, projecting 6 ins. above ground, (alongside of which is an iron pipe, 1 in. diam., firmly set, projecting 3 ins. above ground) with a brass cap mkd.</p>

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

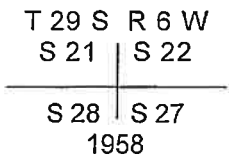FEET	
	 <p>T 29 S R 6 W S 21 S 22 S 28 S 27 1958</p>
	<p>from which the remains of the bearing trees reported by Rogers and Seibold</p> <p>A decayed fir snag, 26 ins. diam., bears N. 42° E., 65.3 ft. dist., no marks visible.</p> <p>A fir, 19 ins. diam., bears N. 59 1/2° E., 28.4 ft. dist., with a healed blaze.</p> <p>A decayed fir stump, 18 ins. diam., bears E., 38.3 ft. dist., no marks visible.</p> <p>A decayed fir stump, size indeterminate, bears S. 29 1/2° E., 54.1 ft. dist., no marks visible.</p> <p>A fir stump, 31 ins. diam., bears S. 14 1/2° W., 91.2 ft. dist., with scribe marks 29S R6W S28 visible on bark. (Record, S. 11 1/4° W., 93.1 ft. dist.)</p> <p>A fir, 31 ins. diam., bears S. 50 1/2° W., 110.9 ft. dist., with a healed blaze.</p> <p>A fir, 58 ins. diam., bears N. 11° W., 7.3 ft. dist., with a healed blaze.</p> <p>and the bearing trees mkd. by person(s) unknown</p> <p>A fir, 22 ins. diam., bears N. 88 1/2° E., 54.2 ft. dist., with a healed blaze.</p> <p>A cedar, 18 ins. diam., bears S. 69 1/4° E., 36.2 ft. dist., with a healed blaze.</p> <p>A fir, 35 ins. diam., bears S. 35 1/4° E., 79.4 ft. dist., with a healed blaze.</p> <p>N. 87° 56' 22" W., bet. secs. 21 and 28.</p>
95	Creek, 2 ft. wide, course N. 10° W.
1290.88	<p>The E 1/16 sec. cor. of secs. 21 and 28, reported by Rogers and Seibold in 1990, monumented with an iron rod, 5/8 in. diam., firmly set, projecting 8 ins. above ground, with an aluminum cap mkd.</p> <p style="text-align: center;">LS 418 E 1/16 21 <hr/>28 1983</p> <p>from which the remains of the bearing trees reported by Rogers and Seibold</p>

**Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 29 S., R. 6 W., Willamette Meridian, Oregon**

FEET	
	<p>A fir, 23 ins. diam., bears N. 26° E., 6.9 ft. dist., with a healed blaze.</p> <p>A fir, 9 ins. diam., bears S. 33° E., 9.2 ft. dist., with a healed blaze.</p> <p>A roothole bears S. 4 1/2° E., 18.5 ft. dist., alongside of which is a down decayed fir, 7 ins. diam., with a healed blaze.</p> <p>Corner is located alongside a wire fence, extends E. and W.</p> <hr style="width: 20%; margin: 10px auto;"/> <p>N. 87° 55' 34" W., beginning new measurement.</p>
1291.23	<p>The 1/4 sec. cor. of secs. 21 and 28, reported by Rogers and Seibold in 1990, monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 6 ins. above ground, (alongside of which is an iron pipe, 1 1/4 in. diam., firmly set, projecting 14 ins. above ground) with a brass cap mkd.</p> <div style="text-align: center; margin: 10px 0;"> <p>T 29 S R 6 W</p> <p>S 21</p> <p>1/4 ———</p> <p>S 28</p> <p>1990</p> </div> <p>from which the remains of the bearing trees reported by Rogers and Seibold</p> <p>A madrone, 36 ins. diam., bears S. 30 1/2° W., 36.6 ft. dist., with a healed double blaze.</p> <p>A fir, 16 ins. diam., bears N. 36 1/2° W., 32.3 ft. dist., with a healed blaze.</p> <p>A decayed fir stump, 12 ins. diam., bears N. 15 1/2° W., 40.6 ft. dist., no marks visible.</p> <p>A decayed fir stump, 22 ins. diam., bears N. 13 1/2° W., 11.6 ft. dist., with a healed blaze.</p> <hr style="width: 80%; margin: 20px auto;"/> <p style="text-align: center;">Dependent Resurvey of Subdivision of Section Lines of Section 21, T. 29 S., R. 6 W., Willamette Meridian, Oregon</p> <hr style="width: 80%; margin: 20px auto;"/> <p style="text-align: center;">Restoring the survey by Rogers and Seibold in 1990</p> <hr style="width: 20%; margin: 10px auto;"/> <p>From the 1/4 sec. cor. of secs. 21 and 28.</p> <p>N. 1° 00' 18" E., on the N. and S. center line of sec. 21.</p>
155	Ridge, bears S. 55° E. and N. 55° W.
300.19	A point established as a property cor. by McLind, PLS No. 934, in April of 1971; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 3 ins. above ground.

**Dependent Resurvey of Subdivision of Section Lines of Section 21,
T. 29 S., R. 6 W., Willamette Meridian, Oregon**

FEET	
550.17	A point established as a property cor. by McLind, PLS No. 934, in April of 1971; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 1 in. above ground.
800.27	A point established as a property cor. by McLind, PLS No. 934, in April of 1971; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 2 ins. above ground.
1050.44	A point established as a property cor. by McLind, PLS No. 934, in April of 1971; monumented with an iron rod, 5/8 in. diam., firmly set, with top flush with the surface of the ground.
1299.67	A point established as a property cor. by McLind, PLS No. 934, in April of 1971; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 6 ins. above ground.
1549.93	A point established as a property cor. by McLind, PLS No. 934, in April of 1971; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 5 ins. above ground.
1799.77	A point established as a property cor. by McLind, PLS No. 934, in April of 1971; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 2 ins. above ground.
2049.61	A point established as a property cor. by McLind, PLS No. 934, in April of 1971; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 4 ins. above ground.
2299.62	A point established as a property cor. by McLind, PLS No. 934, in April of 1971; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 3 ins. above ground (alongside of which is a galvanized iron pipe, 1 1/4 ins. diam., firmly set, projecting 15 ins. above ground).
2544.01	<p>The center 1/4 sec. cor. of sec. 21, reported by Rogers and Seibold in 1990, monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 5 ins. above ground, with a brass cap mkd.</p> <p style="text-align: center;">T 29 S R 6 W C 1/4 S 21 1990</p> <p>from which the remains of the bearing trees reported by Rogers and Seibold</p> <p style="padding-left: 40px;">A fir stump, 23 ins. diam., bears S. 66 1/2° E., 37.0 ft. dist., with a healed blaze.</p> <p style="padding-left: 40px;">A fir snag, 22 ins. diam., bears S. 2 3/4° E., 37.0 ft. dist., with a healed double blaze.</p> <p>and new bearing trees</p> <p style="padding-left: 40px;">A fir, 5 ins. diam., bears S. 5 1/4° W., 18.6 ft. dist., mkd. X BT.</p>

**Dependent Resurvey of Subdivision of Section Lines of Section 21,
T. 29 S., R. 6 W., Willamette Meridian, Oregon**

FEET	<p>A fir, 13 ins. diam., bears N. 59 1/4° W., 30.3 ft. dist., mkd. C1/4 S21 BT. Corner is on top of ridge, bears N. 70° E. and S. 70° W.</p> <p>From this cor., a point established as a property cor. by McLind, PLS No. 934, in April of 1971, reported by Rogers and Seibold, bears N. 1° 18' 32" E., 5.48 ft. dist. (Record, N. 1° 01' 34" E., 5.54 ft.); monumented with an iron rod, 5/8 in. diam., firmly set, with top flush with the surface of the ground.</p> <p>From this same cor., a point established by person(s) unknown, reported by Rogers and Seibold, for unknown purpose, bears S. 27° 10' 33" E., 2.18 ft. dist. (Record, S. 29° 42' 55" E.); monumented with an iron axel rod, 1 1/4 ins. diam., firmly set, projecting 1 in. above ground.</p> <hr/> <p style="text-align: center;">Dependent Resurvey of Subdivision of Section Lines of Section 27, T. 29 S., R. 6 W., Willamette Meridian, Oregon</p> <hr/> <p style="text-align: center;">Restoring the survey by Rogers and Seibold in 1990</p> <hr/> <p>From the center E 1/16 sec. cor. of sec. 27, reported by Rogers and Seibold in 1990, monumented with a stainless steel post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above ground, with a brass cap mkd.</p> <div style="text-align: center;"> <p>E 1/16</p> <p>C ————— C</p> <p>S 27</p> <p>1990</p> </div> <p>from which the bearing trees reported by Rogers and Seibold</p> <p style="padding-left: 40px;">A fir, 12 ins. diam., bears S. 51° W., 9.2 ft. dist., with a healed blaze.</p> <p style="padding-left: 40px;">A fir, 16 ins. diam., bears N. 12 1/2° W., 9.2 ft. dist., with a healed blaze.</p> <p>N. 0° 55' 12" W., on the N. and S. center line of the NE 1/4 of sec. 27.</p>
2443.33	<p>The E 1/16 sec. cor. of secs. 22 and 27.</p> <hr/> <p style="text-align: center;">Subdivision of Section 22, T. 29 S., R. 6 W., Willamette Meridian, Oregon</p> <hr/> <p>From the 1/4 sec. cor. of secs. 22 and 27, reported by Rogers and Seibold in 1990, monumented with an iron post, 2 1/2 ins. diam., firmly set, projecting 8 ins. above ground, with a brass cap mkd.</p>

Subdivision of Section 22,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
	S 22 1/4 ——— S 27 T 29 S R 6 W 1958
	<p>from which the remains of the bearing trees reported by Rogers and Seibold</p> <p>A fir, 22 ins. diam., bears S. 18 1/4° E., 40.6 ft. dist., with a healed blaze.</p> <p>A decayed fir stump, 36 ins. diam., bears S. 23° W., 19.8 ft. dist., no marks visible.</p> <p>A fir, 26 ins. diam., bears N. 18° W., 38.9 ft. dist., with a healed blaze.</p> <p>From this cor., a point erroneously established as the 1/4 sec. cor. of secs. 22 and 27, by Markham Jr., PE No. 2880, in 1950. This point was not correctly positioned and was not utilized for control in this survey, bears N. 68° 16' 42" E., 4.23 ft. dist.; as determined at record bearing and dist. from a bearing tree mkd. by Markham Jr.</p> <p>A myrtle, 19 ins. diam., bears N. 37° E., 44.0 ft. dist., with a healed blaze.</p> <p>N. 0° 28' 59" W., on the N. and S. center line of sec. 22.</p>
1215	Spur, slopes N. 80° E.
1301.00	<p>From this point., a point erroneously established as the center S 1/16 sec. cor. of sec. 22, by Markham Jr., PE No. 2880, in 1950. This point was not correctly positioned and was not utilized for control in this survey, bears E., 4.45 ft. dist.; monumented with an iron pipe, 1 1/4 ins. diam., firmly set, projecting 14 ins. above ground; from which the remains of the bearing trees mkd. by Markham Jr.</p> <p>A decayed fir stump, 15 ins. diam., bears N. 78 1/4° E., 6.0 ft. dist., no marks visible.</p> <p>A decayed fir stump, 24 ins. diam., bears N. 48 3/4° W., 17.1 ft. dist., no marks visible.</p>
1365	Ravine, drains S. 80° E.
2543.24	<p>Point for the center 1/4 sec. cor. of sec. 22, at intersection with the E. and W. center line.</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with brass cap mkd.</p> <p style="text-align: center;">T 29 S R 6 W C 1/4 S 22 2019</p>

Subdivision of Section 22,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
	<p>from which new bearing trees</p> <p>A fir, 25 ins. diam., bears S. 29 1/4° W., 39.8 ft. dist., mkd. C1/4 S22 BT on bark.</p> <p>A fir, 14 ins. diam., bears N. 57° W., 6.3 ft. dist., mkd. X BT.</p> <p>From the cor., a fir, 32 ins. diam., bears S. 37° W., 57.3 ft. dist., with a healed blaze facing east and a location tag.</p>
3272.30	A point established as a property cor. by Bentz, PLS No. 839, in 1984; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 14 ins. above ground, with a yellow plastic cap mkd. BENTZ SURVEY INC.
3385.14	A point established as a property cor. by Bentz, PLS No. 839, in 1984; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 8 ins. above ground, with a yellow plastic cap mkd. BENTZ SURVEY INC.
3585.38	A point established as a property cor. by Bentz, PLS No. 839, in 1988; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 4 ins. above ground, with a yellow plastic cap mkd. BENTZ SURVEY INC.
5157.66	<p>The 1/4 sec. cor. of secs. 15 and 22, reported by Peterson and Berry in 1971, monumented with an iron post, 2 1/2 ins. diam., firmly set, projecting 8 ins. above ground, (alongside of which is an iron pipe, 1 1/4 ins. diam., firmly set, projecting 8 ins. above ground) with a brass cap mkd.</p> <div style="text-align: center;"> <p>S 15</p> <p>1/4 ———</p> <p>S 22</p> <p>T 29 S R 6 W</p> <p>1971</p> </div> <p>from which the remains of the bearing trees reported by Peterson and Berry</p> <p>A fir, 24 ins. diam., bears S. 4° E., 25.1 ft. dist., with a healed blaze.</p> <p>A fir stump, 33 ins. diam., bears N. 14° W., 56.8 ft. dist., with a healed blaze.</p> <p>and a new bearing tree</p> <p>A madrone, 9 ins. diam., bears N. 12° W., 42.4 ft. dist., mkd. 1/4 S15 BT on bark.</p> <p>Corner is located E., 50 ft. dist., of ravine, drains S. 10° E., and alongside a wire fence, extends N. and S.</p> <hr/> <p>From the 1/4 sec. cor. of secs. 22 and 23.</p> <p>N. 89° 59' 59" W., on the E. and W. center line of sec. 22.</p>

Subdivision of Section 22,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
1318.86	<p>From this point, a point erroneously established as the center E 1/16 sec. cor. of sec. 22, by Markham Jr., PE No. 2880, in 1950; as determined at record dists. from the bearing trees mkd. by Markham Jr. This point was not correctly positioned and was not utilized for control in this survey, bears S., 16.57 ft. dist.; from which the remains of the bearing trees mkd. by Markham Jr.</p> <p>An oak, 22 ins. diam., bears N. 32 1/4° E., 61.0 ft. dist., with a healed blaze.</p> <p>An oak, 13 ins. diam., bears S. 27 3/4° W., 47.5 ft. dist., with a healed blaze.</p>
2615.05	<p>The center 1/4 sec. cor. of sec. 22.</p>
3836.87	<p>The center W 1/16 sec. cor. of sec. 22, established by Johnstone, PLS No. 498, in 1980; and is accepted as the cor.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 12 ins. above ground, with an aluminum cap mkd.</p> <p style="text-align: center;">T29S R6W SEC 22 C. W. 1/16 1980 LS 498</p> <p>from which the bearing trees mkd. by Johnstone</p> <p>A fir, 32 ins. diam., bears S. 16 3/4° E., 24.1 ft. dist., with a healed blaze.</p> <p>A fir, 31 ins. diam., bears S. 69 1/2° W., 25.8 ft. dist., with a healed blaze.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, directly over the iron rod, with brass cap mkd.</p> <p style="text-align: center;">W 1/16 C ————— C S 22 2019</p>
1221.98	<p>N. 89° 02' 35" W., beginning new measurement.</p> <p>The 1/4 sec. cor. of secs. 21 and 22, reported by Rogers and Seibold in 1990, monumented with an iron post, 1 1/4 ins. diam., firmly set, projecting 9 ins. above ground, with a brass cap mkd.</p> <p style="text-align: center;">COUNTY SURVEYORS OFFICE T 29 S 1/4 S 21 S 22 R 6 W 1971</p>

**Subdivision of Section 22,
T. 29 S., R. 6 W., Willamette Meridian, Oregon**

FEET	<p>from which the remains of the bearing trees reported by Rogers and Seibold</p> <p style="padding-left: 40px;">A decayed fir stump, 16 ins. diam., bears N. 77 1/4° E., 9.6 ft. dist., with a healed blaze.</p> <p style="padding-left: 40px;">A fir, 26 ins. diam., bears S. 44 1/2° E., 14.2 ft. dist., with a healed blaze.</p> <p style="padding-left: 40px;">A decayed fir stump, 28 ins. diam., bears S. 2 3/4° W., 16.5 ft. dist., with scribe marks BT visible on open blaze.</p> <p style="padding-left: 40px;">A decayed fir stump, 30 ins. diam., bears S. 59 3/4° W., 35.3 ft. dist., with illegible reverse scribe marks visible on open blaze.</p> <p style="padding-left: 40px;">A fir, 17 ins. diam., bears S. 77 1/4° W., 25.7 ft. dist., with a healed blaze.</p> <p>Corner is located N., 80 ft. dist., of graveled road, 14 ft. wide, bears S. 80° E. and N. 70° W.</p> <hr/> <p>From the W 1/16 sec. cor. of secs. 22 and 27, reported by Thielsen and White in 1958-59; monumented with an iron post, 2 1/2 ins. diam., firmly set, projecting 9 ins. above ground, with a brass cap mkd.</p> <div style="text-align: center; padding: 10px 0;"> <p>S 22 W 1/16 ——— S 27 T 29 S R 6 W 1958</p> </div> <p>from which a bearing tree mkd. by Thielsen and White</p> <p style="padding-left: 40px;">A fir, 26 ins. diam., bears S. 68 1/2° E., 89.1 ft. dist., with a healed blaze.</p> <p>and a new bearing tree</p> <p style="padding-left: 40px;">A cedar, 7 ins. diam., bears N. 44 3/4° W., 32.6 ft. dist., mkd. W1/16 S22 BT.</p> <p>Corner is located alongside a fence cor., with wire fences extending E. and S., and is located W., 20 ft. dist., of spur, slopes N.</p> <p>N. 0° 42' 31" E., on the N. and S. center line of the SW 1/4 of sec. 22.</p>
2549.08	<p>The center W 1/16 sec. cor. of sec. 22.</p> <hr/> <p style="text-align: center;">Subdivision of Section 23, T. 29 S., R. 6 W., Willamette Meridian, Oregon</p> <hr/> <p>From the 1/4 sec. cor. of secs. 23 and 26.</p>

Subdivision of Section 23,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
	N. 1° 39' 44" E., on the N. and S. center line of sec. 23.
1260.36	<p>Point for the center S 1/16 sec. cor. of sec. 23.</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 26 ins. in the ground, with brass cap mkd.</p> <div style="text-align: center;"> C S 1/16 S 23 C 2019 </div> <p>from which new bearing trees</p> <p style="padding-left: 40px;">A cedar, 9 ins. diam., bears N. 35° E., 41.6 ft. dist., mkd. X BT.</p> <p style="padding-left: 40px;">A cedar, 10 ins. diam., bears S. 68 3/4° E., 16.1 ft. dist., mkd. CS1/16 S23 BT.</p>
2520.72	<p>Point for the center 1/4 sec. cor. of sec. 23, at intersection with the E. and W. center line.</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 21 ins. in the ground, with brass cap mkd.</p> <div style="text-align: center;"> T 29 S R 6 W C 1/4 S 23 2019 </div> <p>from which new bearing trees</p> <p style="padding-left: 40px;">A fir, 9 ins. diam., bears N. 35 3/4° E., 29.4 ft. dist., mkd. C1/4 S23 BT.</p> <p style="padding-left: 40px;">A madrone, 7 ins. diam., bears N. 28 3/4° W., 16.2 ft. dist., mkd. C1/4 S23 BT on bark.</p>
3775.17	<p>The center N 1/16 sec. cor. of sec. 23, established by McLind, PE No. 934, in 1977; and is accepted as the cor.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 7 ins. above ground, from which the bearing trees mkd. by McLind</p> <p style="padding-left: 40px;">A madrone, 15 ins. diam., bears S. 57 1/2° E., 39.6 ft. dist., no marks visible.</p> <p style="padding-left: 40px;">A fir, 21 ins. diam., bears N. 3° W., 72.5 ft. dist., with a healed blaze.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 26 ins. in the ground, directly over the iron rod, with brass cap mkd.</p>

Subdivision of Section 23,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
1255.57	<div style="text-align: center;"> <p>C N 1/16 S 23 C 2019</p> </div> <p>Corner is located W., 25 ft. dist. of a fence cor., with wire fences extending N., S., and W.</p> <hr style="width: 20%; margin: 10px auto;"/> <p>N. 1° 41' 53" E., beginning new measurement.</p> <p>The 1/4 sec. cor. of secs. 14 and 23, perpetuated by Frear, Douglas County Deputy Surveyor, in 1919; subsequently perpetuated by Byron, Douglas County Deputy Surveyor, on April 19, 1962; from original evidence no longer in existence; monumented with an iron pipe, 1 in. diam., firmly set, projecting 8 ins. above ground, from which the bearing trees mkd. by Frear</p> <p style="padding-left: 40px;">An oak, 14 ins. diam., bears N. 50 3/4° E., 171.0 ft. dist., with a healed blaze.</p> <p style="padding-left: 40px;">A cedar, 45 ins. diam., bears S. 18 1/4° E., 106.7 ft. dist., with a healed blaze.</p> <p>and a bearing tree mkd. by Byron</p> <p style="padding-left: 40px;">An oak, 13 ins. diam., bears N. 12 1/4° E., 43.9 ft. dist., with a healed blaze.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, directly over the iron pipe, with brass cap mkd.</p> <div style="text-align: center; margin-top: 20px;"> <p>T 29 S R 6 W S 14 1/4 ——— S 23 2019</p> </div> <p>Corner is located alongside a fence cor., with wire fences extending S. 20° E., W., and N. 20° W.</p> <hr style="width: 20%; margin: 10px auto;"/>
1273.76	<p>From the 1/4 sec. cor. of secs. 23 and 24.</p> <p>N. 88° 48' 48" W., on the E. and W. center line of sec. 23.</p> <p>The center E 1/16 sec. cor. of sec. 23, established by McLind, PLS No. 934, in 1977; and is accepted as the cor.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 3 ins. above ground, from which the bearing trees mkd. by McLind</p>

Subdivision of Section 23,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
	<p>An oak, 14 ins. diam., bears N. 38 1/2° E., 42.5 ft. dist., with a healed double blaze.</p> <p>A cedar, 29 ins. diam., bears N. 16° W., 43.4 ft. dist., with a healed double blaze.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, directly over the iron rod, with brass cap mkd.</p> <div style="text-align: center;"> <p>E 1/16</p> <p>C-----C</p> <p>S 23</p> <p>2019</p> </div> <p>Corner is located S., 15 ft. dist., of dilapidated fence cor., with wire fences extending N. and E.</p> <p>From this cor., a point established by person(s) unknown for unknown purpose, reported by Lang, PLS No. 2295, in 2005, and was not utilized for control in this survey, bears N. 20° 10' 20" E., 13.43 ft. dist.; monumented with an iron pipe, 3/4 in. diam., firmly set, projecting 3 ins. above ground.</p> <hr style="width: 20%; margin: 10px auto;"/> <p>N. 88° 56' 07" W., beginning new measurement.</p>
45	Creek, 3 ft. wide, course N. 20° W.
1273.22	The center 1/4 sec. cor. of sec. 23.
3878.71	The 1/4 sec. cor. of secs. 22 and 23.
	<hr/> <p>From the E 1/16 sec. cor. of secs. 23 and 26.</p> <p>N. 1° 28' 09" E., on the N. and S. center line of the SE 1/4 of sec. 23.</p>
636.68	A point established as a property cor. by Lang, PLS No. 2295, in 2005; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 2 ins. above ground.
670	Graveled road, 13 ft. wide, bears S. 70° W. and N. 80° W.
1251.56	Point for the SE 1/16 sec. cor. of sec. 23, at intersection with the E. and W. center line of the SE 1/4.
	<p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 26 ins. in the ground, with brass cap mkd.</p> <div style="text-align: center;"> <p>SE 1/16 S 23</p> <p>2019</p> </div>

**Subdivision of Section 23,
T. 29 S., R. 6 W., Willamette Meridian, Oregon**

FEET	
	<p>from which new bearing trees</p> <p>A fir, 9 ins. diam., bears S. 18 1/2° W., 21.3 ft. dist., mkd. SE1/16 S23 BT.</p> <p>A fir, 6 ins. diam., bears N. 53 1/2° W., 22.5 ft. dist., mkd. X BT.</p> <p>Corner is located S., 15 ft. dist., of fence cor., with wire fences extending S. and W.</p>
2512.16	The center E 1/16 sec. cor. of sec. 23.
	<hr/> <p>From the S 1/16 sec. cor. of secs. 23 and 24.</p> <p>N. 88° 55' 34" W., on the E. and W. center line of the SE 1/4 of sec. 23.</p>
1280.97	The SE 1/16 sec. cor. of sec. 23.
2450	Spur, slopes N. 10° W.
2558.55	The center S 1/16 sec. cor. of sec. 23.
	<hr/> <p>N. 89° 10' 23" W., on the E. and W. center line of the SW 1/4 of sec. 23.</p>
510	Spur, slopes N. 20° W.
1306.41	From this cor., a point established by person(s) unknown, for unknown purpose, bears N., 16.62 ft. dist., and was not utilized for control in this survey; monumented with an iron axel rod, 1 in. diam., firmly set, projecting 1 in. above ground.
2580	Spur, slopes N. 15° E.
2590.62	The S 1/16 sec. cor. of secs. 22 and 23.
	<hr/> <p align="center">Subdivision of Section 25, T. 29 S., R. 6 W., Willamette Meridian, Oregon</p> <hr/>
	<p>From the 1/4 sec. cor. of secs. 25 and 36.</p> <p>N. 0° 02' 36" W., on the N. and S. center line of sec. 25.</p>
1283.44	Point for the center S 1/16 sec. cor. of sec. 25. Not monumented.
2566.88	The center 1/4 sec. cor. of sec. 25, established by an Administrative Survey conducted by the BLM in 1977; subsequently recovered and utilized for the subdivision of section 25 by Johnstone, PLS No. 489, in 1978; and is accepted as the cor.; monumented with an iron pipe, 1 1/4 ins. diam., firmly set, projecting 9 ins. above ground, from which the remains of the bearing trees mkd. by the Administrative Survey

Subdivision of Section 25,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
	<p>A decayed cedar stump, 11 ins. diam., bears S. 54 1/2° E., 16.8 ft. dist., with scribe marks BT visible on open blaze.</p> <p>A cedar, 18 ins. diam., bears S. 87 3/4° W., 12.2 ft. dist., with a healed blaze.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, directly over the iron pipe, with brass cap mkd.</p> <p style="text-align: center;">T 29 S R 6 W C 1/4 S 25 2019</p> <p>and a new bearing tree</p> <p>A fir, 12 ins. diam., bears S. 66 1/2° E., 14.0 ft. dist., mkd. C1/4 S25 BT.</p> <p>Corner is located alongside a fence cor., with wire fences extending N. and W.</p> <hr style="width: 20%; margin: 10px auto;"/> <p>N. 0° 06' 02" W., beginning new measurement.</p>
1080	<p>Spur, slopes N. 35° E.</p>
1301.89	<p>The center N 1/16 sec. cor. of sec. 25, established by an Administrative Survey conducted by the BLM in 1977; subsequently recovered and utilized for the subdivision of sec. 25 by Johnstone, PLS No. 489, in 1978; and is accepted as the cor.; monumented with an iron pipe, 1 1/4 ins. diam., firmly set, projecting 7 ins. above ground, from which the remains of the bearing trees mkd. by the Administrative Survey</p> <p>A tin-capped, decayed fir stump, 23 ins. diam., bears N. 53 1/2° E., 24.4 ft. dist., with no marks visible on partially healed blaze.</p> <p>A fir, 15 ins. diam., bears N. 56° W., 24.7 ft. dist., with a healed blaze.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 23 ins. in the ground, directly over the iron pipe, with brass cap mkd.</p> <p style="text-align: center;">C N 1/16 S 25 C 2019</p> <p>and a new bearing tree</p> <p>A fir, 13 ins. diam., bears N. 55 1/2° E., 32.0 ft. dist., mkd. CN1/16 S25 BT.</p>

Subdivision of Section 25,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
	<p>Corner is located alongside a fence cor., with wire fences extending E. and S.</p> <hr style="width: 20%; margin: auto;"/> <p>N. 0° 04' 46" W., beginning new measurement.</p>
1302.43	<p>The 1/4 sec. cor. of secs. 24 and 25.</p> <hr style="width: 80%; margin: auto;"/> <p>From the 1/4 sec. cor. of secs. 25 and 30, on the E. bdy. of the Tp.</p> <p>N. 88° 10' 09" W., on the E. and W. center line of sec. 25.</p>
1398.31	<p>The center E 1/16 sec. cor. of sec. 25, established by Johnstone, PLS No. 498, in 1978; and is accepted as the cor.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 6 ins. above ground, with an aluminum cap mkd.</p> <p style="text-align: center;">T 29 S R 6 W CE 1/16 S25 1978 LS 498</p> <p>from which the remains of the bearing trees mkd. by Johnstone</p> <p style="padding-left: 40px;">A fir snag, 19 ins. diam., bears N. 74° E., 29.2 ft. dist., with a healed blaze.</p> <p style="padding-left: 40px;">A pine, 21 ins. diam., bears S. 19 1/2° W., 40.6 ft. dist., with a healed blaze.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 26 ins. in the ground, directly over the iron pipe, with brass cap mkd.</p> <p style="text-align: center;">E 1/16 C ————— C S 25 2019</p> <p>and a new bearing tree</p> <p style="padding-left: 40px;">A cedar, 15 ins. diam., bears N. 59 1/2° E., 15.2 ft. dist., mkd. CE1/16 S25 BT.</p> <hr style="width: 20%; margin: auto;"/> <p>N. 88° 08' 42" W., beginning new measurement.</p>
1396.63	<p>The center 1/4 sec. cor. of sec. 25.</p> <hr style="width: 20%; margin: auto;"/> <p>N. 88° 13' 36" W., beginning new measurement.</p>

Subdivision of Section 25,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
60	Spur, slopes N. 25° W.
765	Spur, slopes N. 10° E.
1100	Creek, 3 ft. wide, course N.
1315.16	<p>The center W 1/16 sec. cor. of sec. 25, established by Johnstone, PLS No. 498, in 1978; and is accepted as the cor.; monumented with an iron rod, 5/8 in. diam., firmly set, projecting 9 ins. above ground, with an aluminum cap mkd.</p> <p style="text-align: center;">T 29 S R 6 W CW 1/16 S25 LS 498 1978</p> <p>from which the remains of the bearing trees mkd. by Johnstone</p> <p style="padding-left: 40px;">A decayed fir stump, size indeterminate, bears N. 32° E., 14.1 ft. dist., no marks visible.</p> <p style="padding-left: 40px;">A fir, 15 ins. diam., bears S. 25 1/4° E., 18.4 ft. dist., with a healed blaze.</p> <p>At the corner point</p> <p>Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, directly over the iron pipe, with brass cap mkd.</p> <p style="text-align: center;">W 1/16 C—C S 25 2019</p> <p>and a new bearing tree</p> <p style="padding-left: 40px;">A fir, 16 ins. diam., bears N. 56 3/4° E., 24.0 ft. dist., mkd. CW1/16 S25 BT.</p> <p>Corner is located alongside of wire fence, extends E. and W.</p> <p style="text-align: center;">_____</p> <p>N. 88° 09' 56" W., beginning new measurement.</p>
150	Spur, slopes N. 45° E.
245	Draw, course N. 30° E.
725	Spur, slopes N.
1250	Draw, course N. 30° W.
1313.94	<p>The 1/4 sec. cor. of secs. 25 and 26.</p> <p style="text-align: center;">_____</p>

**Subdivision of Section 25,
T. 29 S., R. 6 W., Willamette Meridian, Oregon**

FEET	
	From the center E 1/16 sec. cor. of sec. 25.
	N. 0° 45' 28" E., on the N. and S. center line of the NE 1/4 of sec. 25.
1294.13	The NE 1/16 sec. cor. of sec. 25, established by an Administrative Survey conducted by the BLM in 1977; subsequently recovered and utilized for the subdivision of section 25 by Johnstone, PLS No. 489, in 1978; and is accepted as the cor.; monumented with an iron pipe, 1 1/4 ins. diam., firmly set, projecting 7 ins. above ground, from which the remains of the bearing trees mkd. by the Administrative Survey
	A pine, 30 ins. diam., bears S. 3° E., 73.8 ft. dist., with a healed blaze.
	A fir snag, 22 ins. diam., bears N. 88 3/4° W., 10.2 ft. dist., no marks visible.
	At the corner point
	Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 23 ins. in the ground, directly over iron pipe, with brass cap mkd.
	NE 1/16 S 25 2019
	and a new bearing tree
	A cedar, 7 ins. diam., bears N. 53 1/4° W., 49.9 ft. dist., mkd. NE1/16 S25 BT.

	N. 0° 40' 52" E., beginning new measurement.
25	Graveled road, 12 ft. wide, bears N. 25° E. and S. 20° W.
330	Spur, slopes N. 65° E.
970	Creek, 1 ft. wide, course N. 60° E.
1130	Spur, slopes N. 30° E.
1292.54	The E 1/16 sec. cor. of secs. 24 and 25.

	From the N 1/16 sec. cor. of secs. 25 and 30, on the E. bdy. of the Tp.
	N. 87° 45' 07" W., on the E. and W. center line of the NE 1/4 of sec. 25.
1414.98	The NE 1/16 sec. cor. of sec. 25.

	N. 87° 51' 06" W., beginning new measurement.

Subdivision of Section 25,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
20	Graveled road, 12 ft. wide, bears N. 25° E. and S. 20° W.
1095	Creek, 2 ft. wide, course N. 25° E.
1416.21	The center N 1/16 sec. cor. of sec. 25.
	From the E 1/16 sec. cor. of secs. 25 and 36.
	N. 0° 41' 28" E., on the N. and S. center line of the SE 1/4 of sec. 25.
40	Creek, 3 ft. wide, course N. 65° E.
345	Creek, 3 ft. wide, course N. 10° W.
1283.13	The SE 1/16 sec. cor. of sec. 25, established by an Administrative Survey conducted by the BLM in 1977; subsequently recovered and utilized for the subdivision of section 25 by Johnstone, PLS No. 489, in 1978; and is accepted as the cor.; monumented with an iron pipe, 1 1/4 ins. diam., firmly set, projecting 3 ins. above ground, from which the remains of the bearing trees mkd. by the Administrative Survey
	A tin-capped cedar stump, 16 ins. diam., bears N. 72 3/4° E., 26.6 ft. dist., with scribe marks SE1/16 S25 BT visible on open blaze.
	A tin-capped cedar stump, 16 ins. diam., bears S. 7° E., 25.3 ft. dist., with scribe marks 1/16 BT visible on partially healed blaze.
	At the corner point
	Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 26 ins. in the ground, directly over the iron pipe, with brass cap mkd.
	SE 1/16 S 25 2019
	and new bearing trees
	A fir, 14 ins. diam., bears N. 74° E., 59.7 ft. dist., mkd. SE1/16 S25 BT.
	A cedar, 13 ins. diam., bears S. 12 1/2° E., 20.5 ft. dist., mkd. SE1/16 S25 BT.
	Corner is located alongside a fence cor., with wire fences extending E. and S.; and W., 10 ft. dist., of graveled road, 12 ft. wide, bears N. 45° E. and S. 60° W.
	N. 0° 44' 17" E., beginning new measurement.
1282.63	The center E 1/16 sec. cor. of sec. 25.

Subdivision of Section 25,
T. 29 S., R. 6 W., Willamette Meridian, Oregon

FEET	
1380.62	From the S 1/16 sec. cor. of secs. 25 and 30, on the E. bdy. of the Tp. N. 88° 09' 15" W., on the E. and W. center line of the SE 1/4 of sec. 25. The SE 1/16 sec. cor. of sec. 25. <hr/>
1379.19	N. 88° 09' 34" W., beginning new measurement. The center S 1/16 sec. cor. of sec. 25. <hr/>