

**Douglas County Surveyor's Record of
Government Corners Renewed**

24 T. S. 5 R. W. W. M.

ROKE-CHAPMAN CO., EUGENE, ORE. 21881

James W. Byron, Deputy County Surveyor
Milo Godfrey
Clete Putnam
March 4 - 7, 1960
C. S. File No. 49/124


54

$\frac{1}{4}$ Section Corner to Sections 24 & 25, T24S R5W.
Found - Orig. 24", now 44" B.Oak Snag N.71°W. 447.5 ft. I open
& find good reverse scribing " $\frac{1}{2}$ "S".
Set Brass Cap at Corner Mkd: County Surveyor's Office, 1960
New BT's: 10" W.Oak bears S. 67°W. 85.8 ft. scribed $\frac{1}{4}$ " S25 CS BT.
10" W.Oak bears N. 59°E. 89.0 ft. scribed $\frac{1}{4}$ " S24 CS BT.

RE-RENEWED, SEE CORNER NO. #111

55

Section Corner to Sections 12 & 13, T24S R5W & Secs. 7 & 18, T24S R4W
Found - Orig. 11", now 30" B. Oak N.54°E. 54.8 ft., center rotted,
opened by Eppstein. (see Ren. #137, 24-4)
Also find Stump Holes that check bearings & distances for
ether Orig. BT's.
Set Brass Cap at Corner Mkd: County Surveyor's Office, 1960
I find Eppstein's BT's. to be thus: 16" W.O. S.31°W. 17.7 ft.
15" W.O. S.20°E. 88.5 ft. (Center Rotting)
14" W.O. N.61°E. 37.0 ft.
10" W. O.N.68°W. 59.9 ft.
I Scribe New B.T.: 10" B.Oak S.29°E. 69.6 ft. scribed S18 T24S R4W CS BT.

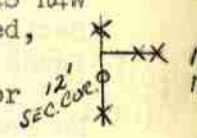

56

$\frac{1}{4}$ Section Corner to Sections 35 and 36.
Found - Orig. 26", now 40" W.Oak S.75°W. 154 ft. (Record S.75°W. 136 ft.)
shows old scars. I do not open.
Find, now 30" W.Oak S.85 $\frac{3}{4}$ °E. 136 ft. (Record S.85 $\frac{3}{4}$ °E. 118.8 ft.),
shows scars, I open but do not find scribing.
Mound of Stone & $\frac{3}{4}$ " Iron Rod at Corner and Stewart's B. Oak
B. T., now overgrown, but shows good scar. I do not open.
I find bearing to be N.82°W. (Stewart N.85°W.) Dist. O.K.
I do not set Brass Cap at Corner but scribed new B.T.
8" W. Oak bears N.30°E. 11.3 ft. scribed $\frac{1}{4}$ " S36 CS BT.

Ren. #10

57

Section Corner to Sections 35 & 36, T24S R5W, & Secs. 2 & 1, T25S R5W.
Found - No. trace of Orig. BT's. found. Stewart's BT's. Found:
18", now 32" Stump S.62°W. 62.5 ft., previously opened, shows
good scribing "CS".
18", now 30" Fir Stump S.57°E. 73.0 ft., shows good scar. I
do not open.
8", now 22" Fir N.67°E. 37.0 ft., shows good scribing "W".
Note - Distances to BT's. recorded by Stewart are measured on slope.
Set Brass Cap at Corner Mkd: County Surveyor's Office, 1960
New BT's: 8" R.Fir bears N.79°W. 43.6 ft. scribed S35 T24S R5W CS BT.
11" R.Fir bears S. 5°W. 45.6 ft. scribed S 2 T25S R5W CS BT.
9" R.Fir bears S.42°E. 50.8 ft. scribed S 1 T25S R5W CS BT.

PER S. HOLT
M 87-24
Now Burned
SWAG

FD. B. C.
7-84

New
Burned
Stumps.

58

$\frac{1}{4}$ Section Corner to Sec. 35, T24S R5W, & Sec. 2, T25S R5W.
Found - 14", now 20" B.Oak N.88°E. 26.7 ft. (Stewart B.T.) I open
& find good reverse scribing "T".
Also find Auto Spring dozed out of ground but near corner.
Set Brass Cap at Corner Mkd: County Surveyor's Office, 1960
New BT's: 10" W.Oak bears N.46°E. 15.0 ft. scribed $\frac{1}{4}$ " S35 CS BT.
8" R.Fir bears S.58°E. 41.6 ft. scribed $\frac{1}{4}$ " S 2 CS BT.

REN. #11

59

$\frac{1}{4}$ Section Corner to Sections 29 and 32.
Found - W.Oak, now 25", N.69 $\frac{1}{2}$ °E. (Rec. N.67 $\frac{1}{2}$ °E.) 71.3 ft. Tree
had been previously opened & grown over again, probably
rotted inside, did not open.
W.Oak, now 24", S.73°W. (Rec. S.71°W.) 53.5 ft., cut open &
found portions of reverse scribing, Part of "B" & "T",
Tree rotten inside.
Set Brass Cap Mkd: County Surveyor's Office, 1960
Blaze & Scribe New Trees: 10" W.Oak N.66°E. 58.0 ft. $\frac{1}{4}$ " S29 CS BT"
12" W.Oak S.45°W. 90.8 ft. $\frac{1}{4}$ " S32 CS BT"
Small Creek Approx. 50 feet East of Corner.