

Douglas County Surveyor's Record of
Government Corners Renewed

26 T. S. 6 R. W. W. M.

KOKE-CHAPMAN CO., EUGENE, ORE. 97195

(768 Cont.)

James W. Byron, Deputy
Milo Godfrey
S. A. Blilow
February 11, 1959
C. S. File No. 49/121

Set Brass Cap at Corner Mkd: $\frac{1}{4}$ $\frac{S10}{S15}$ T26S R6W County Surveyor's Office, 1959

New BT's: Remark Orig., now 30" W. Oak N.12 $\frac{1}{2}$ °E. 34.9 ft., scribed $\frac{1}{4}$ S10 CS BT.

12" W. Oak bears S.61°W. 28.6 ft. scribed $\frac{1}{4}$ S15 CS BT.
Fa. O.K. 5-1964 M.E.G. - C.S. 54/87

Section Corner to Sections 10, 11, 14, & 15. 69


Found - Orig. 18", now 28" W. Oak N.51 $\frac{1}{4}$ °E. 56.1 ft., shows good scars, I do not open.

Orig. 12", now 19" W. Oak N.61°W. 73.9 ft. I open & find good scribing.

Old Stump Holes that check bearing & distance for Orig.

S. E. & S.W. BT's.

Set Brass Cap at Corner Mkd: $\frac{S10}{S15}$ | $\frac{S11}{S14}$ T26S R6W County Surveyor's Office, 1959

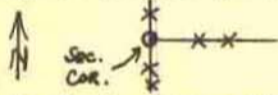

New BT's: 8" W. O. bears East 9.7 ft. scribed S14 T26S R6W CS BT.

11" W. O. bears N.43 $\frac{1}{2}$ °E. 26.0 ft. scribed S11 T26S R6W CS BT.

6" W. O. bears S.57°W. 13.4 ft. scribed S15 T26S R6W CS BT.

12" W. O. bears N.44°W. 21.6 ft. scribed S10 T26S R6W CS BT.

70

James W. Byron, Deputy
Milo Godfrey
S. A. Blilow
March 12, 1959
C.S. File No. 49/121

$\frac{1}{4}$ Section Corner to Sections 14 & 15.

Found - Orig. BT's:

W. Oak (now 24") S.58°E. 112.9 ft., this tree had been previously opened, probably by Eppstein in 1928 and shows good scribe "S". REN. # 23

W. Oak (now 19") N.31°30'E. 99.7 ft., mkd. by Eppstein, showing two good scars. Did not open this tree.

B. Oak (now 24") Orig. BT. N.33°W. 55.8 ft., instead of 53.5 ft. as called for. This tree shows no scars & is starting to die.

At Corner Point Set Iron Pipe with Brass Cap Mkd. "County Surveyor's Office, 1959, T26S R6W $\frac{1}{4}$ S15/S14.

Corner falls in N. & S. Fence Line.

Blaze & Scribe New Tree: 19" Black Oak S.58°W. 28.0 ft. scribed $\frac{1}{4}$ S 15 CS BT." Fa. O.K. 5/1964 M.E.G. - C.S. 52/87

71

Frank Cain, Co. Surveyor
December 8, 1914
Recorded in Volume 2,
Page 267.

L. Corner of Claims No. 38 and No. 62.

Set Sandstone 4" x 4" x 13" marked 38 on West and 62 on East Side. 149

A. W. Oak 20" marked C.S. C.62 T26S R6W bears S.30°E. 60 lks.

72

S. E. Corner Cl. 62.

Sandstone 4" x 4" x 20" marked X 62, from which: 151

A B. Oak 20" marked C.S. C.62 T26S R6W B.T. bears N.14°E. 164 lks.

Meander Post between Sections 5 and 6.

Set Sandstone 3" x 18" x 20" on left bank of River. 73

No Trees Near.

SEE CORNER NO. 77

Note - The above corners were established by Orig. BT's. which I found standing but girdled & dead.

74

James W. Byron
Milo Godfrey
Clete Putnam
Dec. 8, 1959
C. S. 52/5
M-16-59

Sec. Cor. Secs. 6 & 7, T26S R6W, & Secs. 1 & 12, T26S R7W.

Found - 3 Orig. BT's. Orig. 14", now 24" W. Oak N.33°E. 25.1, previously opened, no scribing found.

Orig. 20", now 30" W. Oak S.8°W. 98.3 ft., I open & find good scribing "1".

Orig. 10", now 16" B. Oak Snag S.26 $\frac{1}{2}$ °E. 59.4 ft., I open & find good reverse scribing T W R S".

No trace of Orig. N.W. BT. found.

Set Brass Cap at Corner Mkd. $\frac{S1}{S7}$ | $\frac{S6}{S7}$ T26S County Surveyor's Office, 1959

New BT's: 10" Dbl. W. Oak bears S.28°E. 24.9 ft. scribed S7 T26S R6W CS BT.

8" W. Oak bears N.16°E. 35.2 ft. scribed S6 T26S R6W CS BT.

(continued next page)