

Douglas County Surveyor's Record of  
Government Corners Renewed

28 T. S. 7 R. W. W. M.

ECKE-CHAPMAN CO., EUGENE, ORE. 97196

80

Section Corner to Sections 22, 23, 26, & 27.

Found - 1"x 1" Bar at Corner & at Fence Corner. REN. #4

Orig. 10", now 31" Oak Stump shows reverse scribing "BT"  
N.33°W. 67.3 ft., I find 63.3 ft.

Orig. 18", now 32" W.Oak, partly rotted, shows old scars,  
S.23°E. 62.7 ft.

Orig. N. E. & S. W. BT'S. gone.

I do not Set Brass Cap at Corner. Bar Set by Frear, 1917 is O.K.

New BT's: 9" W. O. bears S.23°W. 33.4 ft. scribed S27 T28S R7W CS BT.

15" Laurel bears N.31°W.19.4 ft. scribed S22 T28S R7W CS BT.

6" R. Fir bears S.73°E. 22.7 ft. scribed S26 T28S R7W CS BT.

7" R. Fir bears N.70°E. 40.1 ft. scribed S23 T28S R7W CS BT.

RE-NEWED CORNER NO. 200

1/4 Section Corner to Sections 27 & 26.

Found - Orig. 24", now 36" W. Oak. I open & find good scribed "1/4 S BT",  
N.35°E. 69.3 ft.

No trace of Original S.W. BT.

Set Brass Cap at Corner Mkd: 1/4 S27/S26 T28S R7W County Surveyor's  
Office, 1958

New BT's: 22" R.Fir bears N.47°W. 27.5 ft. scribed 1/4 S27 CS BT.

10" W.Oak bears N.82°E. 34.3 ft. scribed 1/4 S26 CS BT.

Note: See sketch in C.S. File 49/50 for exact location of corner.

Section Corner to Sections 26, 27, 34, & 35.

Found - Scribed Stake at Corner & BT's. as recorded by Cole. REN. #91

Scribing visible on now 12" Ash, N.10 1/2°W. 5.9 ft.

The S. W. BT. shows good scar.

Set Brass Cap alongside Corner Stake, Mkd. Cap S27|S26 T28S R7W  
County Surveyor's Office, 1958 S34|S35

New BT's: 9" R.Fir bears S.70°E. 28.8 ft. scribed S35 T28S R7W CS BT.

8" W.Oak bears N.27°E. 15.2 ft. scribed S26 T28S R7W CS BT.

1/4 Section Corner to Sections 34 & 35.

Found - Now 24" Shell of 24" Oak Stump N.10°E. 130.0 ft., record  
10" W. Oak N.10°E. 138.6 ft.


Orig. 12", now 44" B. O. N.5°W. 132.0 ft., shows old scar,  
center rotted. I do not open. See F.B. 37, Pg. 1. for  
renewal of thei Corner by Cole.

6" x 4" x 24" Cedar Stake on ground 10 ft. West of Corner  
scribed 1/4 S CS .

Set Brass Cap at Corner Mkd: 1/4 S34/S35 T28S R7W County Surveyor's  
Office, 1958.

New BT's: 9" B. Oak bears N.74°E. 41.4 ft. scribed 1/4 S35 CS BT.

18" W. Oak bears N.80°W. 6.5 ft. scribed 1/4 S34 CS BT.

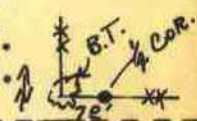

Section Corner to Sec. 25 & 36, T28S.R7W. & Secs. 30 & 31, T.28S.R6W.  
& S. E. Corner to D. L. C. No. 58.

Found - Orig. 40", now 42" Oak Snag S.80°W. 73.9 ft., center rotted,  
no scribing found.

Orig. 28", now 36" Oak down, S.71 1/4°E. 223.1 ft., center &  
most of tree rotted, no scribing found.

No trace of other BT's. found.

Set Brass Cap at Corner Mkd. S.E.Cor. DLC 58 S25|S30 T28S Cor. 3.0'  
County Surveyor's Office, 1958 R7W S36|S31 R6W WEST

New BT's: 38" B.Oak bears N.44 1/2°E. 206.6 ft. scribed S30 T28S R6W CS BT.

12" Laurel bears West 47.5 ft. scribed S25 T28S R7W CS BT.

12" W.Oak bears S.61 1/2°E. 12.2 ft. scribed S31 T28S R6W CS BT.

12" Laurel bears South 9.0 ft. scribed S36 T28S R7W CS BT.

Statement signed by J. Harold Nichols: "I state that I have know the  
42" Oak Snag used on this date to determine the position of this  
Section Corner to be a bearing tree & that I saw scribing on this  
B. T. years ago."

James W. Byron, Deputy  
Milo Godfrey  
S.A. Bilow  
November 7, 1958  
C. S. File No. 49/50

81

82

83

84