

Douglas County Surveyor's Record of
Government Corners Renewed

T 28 T. S. R 7 R. W. W. M.

KOKE-CHAPMAN CO., EUGENE, ORE. 21881

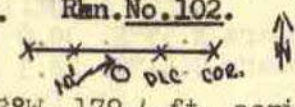
160

$\frac{1}{4}$ Section Corner to Sections 4 and 9.
Found - Old Rifle Barrel in Fence Corner - Fences East & North. REN. #7
Old B. Oak, dead & burned, out inside, N.49 $\frac{1}{2}$ °E. 75.2 ft. (This checks one Orig. B.T.)
Stump Hole S. 4°W. 55.4 ft. (This checks location for one of Mensch's BT's.)
No Brass Cap found at Corner & no trace of other BT's. Located directly under power line, right of way for which has been slashed & burned several years ago.
Alongside Rifle Barrel Set Iron Pipe with Brass Cap Mkd: $\frac{1}{4}$ S 4 T28S R7W
County Surveyor's Office, 1961 S 9
Blaze & Scribe two new BT's: 11" D. Fir N.18°W. 33.1 ft. Mkd: $\frac{1}{4}$ S 4 CS BT.
9" Pine S.9°W. 22.5 ft. Mkd: $\frac{1}{4}$ S9 CS BT.

161

$\frac{1}{4}$ Corner to Sections 18 and 19.
Found - Orig. 20" , now 34" W. Fir N.59°E. 22.4 ft., previously opened, shows good scribe, "B"
Orig. 5", now 14" Fir, down & center rotted, S.35°W. 27.7 ft. (record)
We find should be S.35°W.
Set - Brass Cap at Corner Mkd: County Surveyor's Office, 1961 $\frac{1}{4}$ S18
T28S R7W. S19
New BT's: 15" W. Fir bears S.44°W. 5.0 ft. scribed $\frac{1}{4}$ S19 CS BT.
10" W. Fir bears N.32°W. 17.0 ft. scribed $\frac{1}{4}$ S18 CS BT.

162

S. E. Corner D. L. C. No. 51.
Found - 1" I. P. at corner & Orig. 20", now 40" W. Oak, shows old rotted face & newer scribing, see Wenderoth renewal 1946, N.80°W. 247.0 ft. Ren. No. 102.
Corner Thus: 
New BT: 10" W. Oak bears S.88°W. 179.4 ft. scribed CL BT 61 CS BT

163

$\frac{1}{4}$ Section Corner to Sections 14 and 23
Found - Rock with Cross as recorded by Frear in 1917. - REN. #70
W. Oak, now 30", S.77°E. 153.8 ft., as recorded by Frear. Cut open old scar & fd. good scribing " $\frac{1}{4}$ S".
W. Oak, down & dead, N.88°E. 177.5 ft. as recorded by Frear. Did not find scribing, tree badly rotted.
Alongside Rock set by Frear Set Iron Pipe with Brass Cap Mkd: County Surveyor's Office, 1961, T28S R7W $\frac{1}{4}$ S14
Blaze & Scribe new trees as follows: S23
20" Cedar N.31 $\frac{1}{2}$ °E. 85.8 ft. Mkd: " $\frac{1}{4}$ S14 CS BT".
10" B. Oak N.31°W. 34.7 ft. Mkd: " $\frac{1}{4}$ S14 CS BT".
No trees handy in Section 23.

164

Section Corner to Sections 27 - 28 - 33 - 34.
Found - Orig. 20", now 34" W. Oak S.25°W. 220.4 ft. This BT. was opened years ago, 50 years. We open & find old axe work but center rotted. No scribing found.
No other Orig. BT's. found, we also find Old Oak Stake at Corner & in place. I believe that BT. was opened and Stake set by Theil, 1899, see cemetery survey.
We rerun Theil's tie to N.W. corner of cemetery and fall about one chain North but O.K. E. & W. Tie from Sec. Cor. to S.E. Corner D.L.C. 51 checks O.K.
Set Brass Cap at Corner alongside Oak Stake Mkd: S28 | S27 T28S R7W
County Surveyor's Office, 1961 S33 | S34
30" W. O. bears N.29 $\frac{1}{2}$ °W. 178.0 ft. scribed S28 T28S R7W. CS BT.
17" W. O. bears N.69°E. 98.9 ft. scribed S27 T28S R7W CS BT.
10" W. O. Bears S.65°E. 270.0 ft. scribed S34 CS BT.
Rescribe Orig., now 34" W. O. S.25°W. 220.4 ft. S33 T28S R7W CS BT.

James W. Byron Deputy County Surveyor
Milo Godfrey
Clete Putnam
April 27, 1961
C. S. File No. 49/50

SEE CORNER NO. #235