

Douglas County Surveyor's Record of  
Government Corners Renewed

T. 28 S. T. S. R. 8 W. R. W. W. M.

KOKE-CHAPMAN CO., EUGENE, ORE. 21881

128


Section Corner to Sections 35 & 36, T28-SW. &  
Sections 2 & 1, T29-SW.

Found - G.L.O. Brass Cap at Sec. Cor. Mkd: properly, in 1924.

New BT's: 9" Dbl. W. Oak bears S. 15° W. 86.0 ft. mkd. T29S R8W S2CS BT.  
9" D. Fir N. 14° E. 29.4 ft. mkd. T28S R8W S36 CS BT.

No trees available in N. W. Quad.

Note - This corner lies 1.5 ft. S.W. of Fence. Corner.

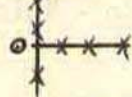

129

1/4 Corner to Sec. 36, T28-SW. & Sec. 1, T29-SW.

Found - GLO Brass Cap at 1/4 Corner, properly marked in 1924

Orig. 20" B.Oak, now down, S. 69° E. 51.0 ft., opened for scribe "S".


Orig. 30" W.Oak, now down, N. 8° W. 63.4 ft.

No trace of 1924 "BT's", evidently removed when fence was put in.

New BT's: 6" D. Fir S. 42° E. 59.0 ft. mkd. "1/4 S1 CS BT."

18" D. Fir North 45.7 ft. mkd. "1/4 S36 CS BT".

Note - This corner lies north of fence corner 1.5 feet.

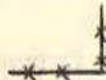

MICROFILM TO HERE 10/67

130

1/4 Corner to Sections 35 and 36.

Found - 1957 County Surveyor's Brass Cap (not recorded) *(SEE RECORDS RENEWAL #182)*

No trace of 1/2" I.P. called for in Ren. #3.

18" W. Oak, alive, S. 73 1/2° E. 110.0 ft., scars plain.

36" B.Oak, now stump, S. 57° W. 40.6 ft., scribe visible. #197

17" D. Fir S. 87° E. 96.7 ft., blazes healed.

No other new bearing trees.

Orig. 18" now 32" B.Oak, alive, S. 55° E. 93.1 ft.,

possible scribe marks visible.

Three way fence corner bears S. 35° E. 13.0 ft., fences W.- N. & S.

No suitable trees available to west for new bearing tree.

1/13/69

1/4 Corner to Sections 25 and 36.

Set by proportionate measurement.

Set - 1" I.P. & Brass Cap mkd: County Surveyor's T 28 S R 8 W  
Office 1/4 S 25  
1969 S 36

Mark BT: Possible 1924 Resurvey Bearing Tree, shows good axe scar, not recorded, as follows:

22" Bl.Oak S. 3° E. 369.7 ft. mkd: "1/4 S36 CS BT".

No trees close in section 25.

Note - At a Point 10.0 ft. north of 1/4 corner, set 3/4"x 30" I.R., 12" below ground surface. Also set 6 ft. steel fence post alongside brass cap. This corner lies in large field.

131

Witness Corner to Sections 25 and 36, T28-SW.

Found - 1" I.P. at point for Witness Corner which is 25 ft. west of true corner point.

No trace of 1924 GLO Brass Cap.

16", now 24" Maple, alive, N. 22° E. 11.9 ft., blaze healed over.

12", now 22" Alder, alive, S. 35° W. 24.4 ft., scribe marks visible on nearly healed blaze.

24", now 30" Ash, alive, N. 27° W. 29.0 ft., scribe marks visible on unhealed blaze.

Set - Brass Cap at Cor. Mkd: County Surveyor's R T 28 S R  
Office 8 S 25 7  
W.O. 25 ft. E. to Corner. 1969 W S 36 W

Set - Old 1" I.P. at true corner point which is 25 ft. east of witness corner in old creek bed. This corner approx. 140 ft. west of tenmile creek.

132

John M. Powell  
Frank Jones & C. Stone  
November, 29, 1966  
C. S. File No. 54/38

SEPT. 68

Vernon "Ray" Tracy  
Frank Jones & V. Perron  
Jan. 1969  
C. S. File 52/79

James W. Byron, Co. Surv.  
Vernon "Ray" Tracy & Crew  
January, 1969  
C. S. File No. 54/78

RE-RENEWED SEE CORNER NO.