

Douglas County Surveyor's Record of  
Government Corners Renewed

T 29 T. S. R 1 R.W.W.M.

KORE-CHAPMAN CO., EUGENE, ORE. 21881

Dennis Gaylord  
U.S.F.S.  
Deputy Doug. Co.  
Surveyor Office  
Roland Simshaueser  
April 20, 1978  
C.S. 59/46

Section Corner for Secs. 1 and 12 only of T29-2. 124  
Found - 1917 US GLO brass cap properly stamped on a 1 1/2" I.P. 4" above ground.  
A 24" Fir stump bears N.35°W., 13.86 ft. Open & find scribing & reverse.  
BT location for SW BT falls in Road #2846.  
Placed a County BT sign on the stump.  
Corner stone for section corner for 6 and 7 bears N.1°15'E., 8.1 ft. (Rec. North 7.92 ft.)


No new monument set.

New Accessories:

A 5/8" Iron Rod with a 1" Alum. cap marked bears N.34°W., 12.6 ft.



A 5/8" Iron rod with a 1" Alum. cap marked bears S.51°30'W., 9.8 ft.

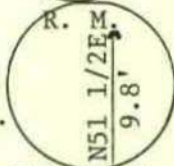

No trees available for BT's

Corner lies 20 ft. North of FS Road #2846 in a clearcut.

4/20/78

Dennis Gaylord USFS  
Deputy, Doug. Co.  
Surveyors Off.  
Randal Lopez  
April 27, 1978  
C.S. 59/46

Section Corner for Secs. 6 and 7 only. (West) 125

Found - Orig. corner stone set solidly in place & marked with one groove on the north face & five grooves on the south face.  
Stone measures 15" x 10" x 8".

A 14" Fir stump bears S.45°30'E., 15.6 ft. (Rec. 15.84') Open & find scribing & reverse "T29S".

Pine BT to the NE is gone. Falls in landing.

The corner for Secs. 1 and 12, T29-2, (Brass cap set by GLO) bears S.1°15'W. 8.1 ft. (Rec. South 7.92').

Set - Moving the orig. corner stone aside, I SET in its place a 2 1/2" Brass cap on a 1" I.P. stamped County Surveyors Office 1978

T 29 S  
S 6  
S 7

I bury the corner stone along side the iron pipe.

New Accessories:

A 5/8" Iron rod with a 1 1/2" Alum. cap bears N.48°E., 12.4 ft. stamped



A 5/8" Iron rod with a 1 1/2" Alum. cap bears S.21°30'E., 28.5 ft. stamped



No trees available for BT's.

Corner is located 40 ft. North of Forest Serv. Rd. #2846 & in a clearcut un

4/27/78

William Ruppert  
For: U.S. National  
Forest  
January, 1978  
M 70 - 2

Tps. corner for Sec. 36; and sec. 1, T30-1W and sec. 31, T29-1E. 126

Found - 1" pipe with 1968 Douglas County Surveyors Office brass cap.

54" Pine stump, S.01°07'E., 72.7 ft. Ren. #12

21" D. Fir windfall, S.15°53'E., 59.0ft/ (probably moved)

15" Incence cedar, N.49°36'E., 70.2 ft. visible scribe

17" Madrone, N.55°43'W., 97.3 ft. visible scribe.

Scribed new BT: 6" D. Fir, S.26°59'W., 60.3 ft. "T30S R1W S1 BT"

1/78

David K. Bateman  
For: U.S. Forest  
Service  
July 12, 1978  
M 72 - 24

Center 1/4 Corner for Sec. 35. 127

Set - 2 1/2" x 30" Galv. I.P. with brass cap

BT's- 32" D. Fir, N.01°W., 60.4 ft. scribed "C 1/4 S35 BT"

34" D. Fir S.36°W., 5.2 ft. scribed "C 1/4 S35 BT".

Bearing trees are tagged and banded with red paint. A brass washer stamped "PLS 1068" is nailed to lower blaze.

7/12/78

1-27