

Douglas County Surveyor's Record of  
Government Corners Renewed

T 29 S. T. S. R 5W R.W.W.M.


KOKE-CHAPMAN CO., EUGENE, ORE. 97101

134

S. W. Corner to D. L. C. No. 48.  
Found - Stone at Corner & N.W. BT. as recorded. - Ren. # 49  
S.W. BT., now stump, We open & find good scribing, distance  
should be 35.9 ft. not 335.9 ft.  
S.E.T. - 4' Cedar Post alongside Corner Stone.  
New BT: 8" W.Oak bears S.  $1\frac{1}{2}^{\circ}$ E. 135.9 ft. scribed SW Cl 48 CS BT.

135

$\frac{1}{4}$  Corner to Sections 7 and 8.  
Found - Now 20" W.O. N.  $60^{\circ}$ W. 27.4 ft. shows good scribing " $\frac{1}{4}$ S".  
Also find Orig. S.E. BT, now down. - Ren. # 37  
Set - Brass Cap at Cor. Mkd: County Surveyor's Office, 1962  
 $\frac{1}{4}$  S 7/8 T29S R5W.  
New BT: 8" W.Oak bears N.  $42^{\circ}$ E. 18.2 ft. scribed  $\frac{1}{4}$  S8 CS BT.

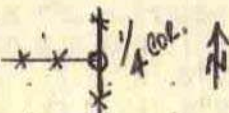

136

N. W. Corner to D.L.C. No. 38.  
Found - 2" I.P. 30" above ground at corner & at base of old Oak Stake.  
Also find, now 34" W.Oak S.  $40\frac{1}{2}^{\circ}$ E. 34.0 ft., shows good scars. - Ren. # 53  
New BT: 10" W.Oak bears N.  $6^{\circ}$ W. 12.3 ft. scribed NW CL 38 CS BT.  
Note - Fence 70 feet East.

137

$\frac{1}{4}$  Corner to Sections 4 and 9.  
Found - 1 $\frac{1}{4}$ " I. P. at corner & now 15" Alder S.  $60^{\circ}$ W. 25.4 ft., snag  
shows good bark scribing. House to N.E. burned. Rock  
foundation still in place. - Ren. # 63  
New BT's: 2 $\frac{1}{2}$ " Cedar bears N:  $83^{\circ}$ W. 92.0 ft. scribed  $\frac{1}{4}$  S4 CS BT.  
12" DbL Cedar bears S.  $45\frac{1}{2}^{\circ}$ E. 105.5 ft. scribed  $\frac{1}{4}$  S9 CS BT.

138

Section Corner to Sections 5 - 4 - 8 - 9. - REFER TO COR No. 76  
Found - 1" I.P. at corner. & 10", now 12" Maple S.  $71^{\circ}$ E. 113.0 ft. is O.K.  
Describe - Now 30" Laurel N.  $35^{\circ}$ W. 125.0 ft. as T29S R5W CS BT.  
Do five trees near to N.E. or S.W.

139

$\frac{1}{4}$  Corner to Sections 15 and 14.  
Found - 7/8" I.R. at cor. & Both BT's. as recorded by Evans, except.  
N.W. BT., now stump. - Ren. # 90  
Note -  $\frac{1}{4}$  Corner is 8' West of N.S. Fence.  
New BT: 48" Laurel bears N.  $17^{\circ}$ W. 50.2 ft. scribed  $\frac{1}{4}$  S15 CS BT.

140

$\frac{1}{4}$  Corner to Sections 8 and 17.  
Found - Orig. 24", now 36" Laurel S.  $35^{\circ}$ E. 39.6 ft., previously opened,  
shows good scribing " $\frac{1}{4}$ S"BT".  
Both BT's., now stumps, the N.W. BT. shows scribing as recorded by  
Cain. Cain's corner bears S.  $46^{\circ}$ E. 12.5 ft. REN. # 19  
Do not find Original N.E. BT.  
I use Orig. S.E. BT. to fix position of  $\frac{1}{4}$  Cor. I believe that Cain either  
was in error or did not find Orig. SE BT. Also, my location of  $\frac{1}{4}$  Cor.  
checks location of old fence corner.  
Set - Brass Cap at Cor. Mkd:  $\frac{1}{4}$  S8 T29S R5W County Surveyor's  
Office, 1962.  
New BT: 8" R.Fir bears N.  $46\frac{1}{2}^{\circ}$ E. 9.2 ft. scribed  $\frac{1}{4}$  S8 CS BT, scribed High.  
Note - Corner is on steep North Slope 40' North of E.W. Ridge.

141

$\frac{1}{4}$  Cor. to Sections 8 and 9.  
Found - Orig. 12", now 24" W.O. "S8 E" 54.1 ft. shows scar. We also  
find now 10" W.Oak S.  $69^{\circ}$ W. 5.9 ft. We open near base & find scribing  
Note - E. W. Fence at Corner. - Ren. # 20  
Set - Brass Cap at Cor. & under E.W. Fence Mkd: County Surveyor's  
Office, 1962  $\frac{1}{4}$  S8/S9 T29S R5W.  
New BT's: Rescribed now 10" W.O. S.  $69^{\circ}$ W. 5.9 ft. "BT".  
Rescribed Orig., now 24" W.Oak S.  $8^{\circ}$ E. 54.1 ft.  $\frac{1}{4}$  S9 CS BT.

James W. Byron, Deputy County Surveyor  
Dale McFarland and John Powell  
March 1962  
C. S. File No. 49/64

RE-RENEWED, SEE CORNER NO. #236

RE-RENEWED, SEE CORNER NO. #210

RE-RENEWED, SEE CORNER NO. #239